


SEC. 14 T. 39 N. R. 9 E W.

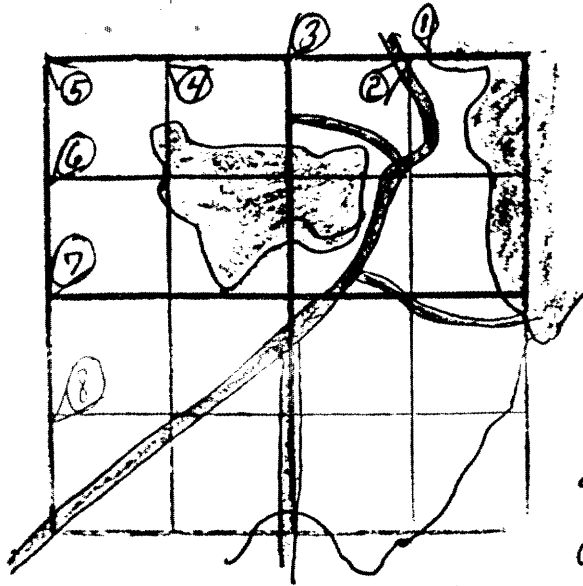

① ~~N 1/4 NE 1/4~~ Member Cor. North side NW 1/4 of section

at 67.89 east of NW Cor fell 3.35 north
of M.C. New B.T. Tam. 14" - S 29° E - 11.2L;
PW 18" - N 41° W - 0.275 ch. (Vaughn 5/19/12)
at 63.223 east of NW Cor replaced old wood
post with ^{W.C.D.} DNR post. Remains of NW O.B.T. BT
found PW (stb.) 15" - S 49° E - 0.263 ch. (~~found~~)
~~although~~; PW (stb.) 15" - S 23° W -
0.604 ch., both by Genest Crq. (Jlg 1972)

② N 1/4 NE 1/4 at 20.551 put in a 2" IP on a pole in spruce swamp
1.592 west of M.C. New B.T. PW 12" - S 42° W - 0.607 ch.; PW 15" -
N 51° W - 0.120 ch. A 2" capped IP bears S 78° W - 0.815 ch. (Jlg 72)

③ N 1/4 Sec 14 Ground overrun of 5.46 & set proportional 1/4 Cor. at 43.50
east of NW Cor. PW (stb.) 28" - N 88° E - 0.845 ch. (Vaughn 5/19/12)
at 41.080 east of NW Cor & 41.102 west of NE Cor. (~~found~~) Ground corner
perpetrated by Walsh Yarnis used by Fisher & Wincertsen. Replaced a capped wood
post with DNR post. Walsh's old B.T. stb 18" ~~at~~ eastly from corner very rotten.
New B.T. PN 15" - N 86° E - 0.764 ch.; PN 12" - S 59° E - 0.430 ch.; PN 18" - S 22° E
0.635 ch. (Jlg 1972)

RECEIVED & FILED
Florida County Surveyor's Office
1/6/88
4350

④ N¹/₄ NW¹/₄ at 21.75 east of NW cor. set '8. PW (sup) 20"
60°E-13; PW (sup.) 24"- 13°E - 0.115 ch (Vaughn 5/19/17)
at 20.540 put our pipe by a yellow 3/4" I.P. by Jennings. OR 12"-
S 26°E - - 0.361 ch; OR 14"- S 75°W - 0.325 ch. (Jlg 1972)

⑤ NW cor. Sec. 14 set the section corner 5.39 (orig. distance) south
of the hole & on the orig line. PW 8" S 70°E - 38 ch; Oak 7" S 30°E -
0.355 ch (Vaughn 5/19/17) Vaughn's PW 8" now 22" - S ^{85°}~~55°~~E - 0.380 ch - ;
Yes Oak 7" is S 36°E ^{0.275 ch +} is broken off. Other B.T. present are PW 14" - N 35°E -
1.718 ch; PW 18" - N 81°E - 0.293 ch. New B.T. PN 18" - S 24°E - 0.633 ch.
Dug 1 foot of earth off of large flat rock & chiseled X for cor corner on it.
Angled steel sign post over X of corner. (Jlg 1972)


⑥ W¹/₄ NW¹/₄ at 20.764

① W¹/₄ Sec 14 a w.c.d. ~~file~~ at 41.528 each way (Jly 1946)

② W¹/₄ SW¹/₄ at 20.764

SEC. 14 T. 39 N. R. 7 E.

L 618

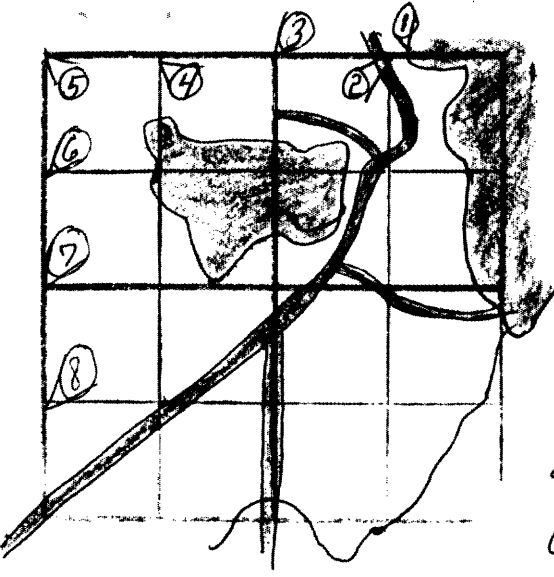

① ~~At 67.89~~ Member Cor. North Line - West of Pattern
 at 67.89 east of NW Cor fell 3.35 north
 of M.C. New B.T. $Tham. 14'' - S 29^\circ E - 11.11$;
 $PW 18'' - N 41^\circ W - 0.275 ch$ (Vaughn 5/19/17)
 at 63.223 east of NW cor replaced old wood
 post with ^{W.C.D.} DNR. ~~post~~. Remains of NW O.B.T. BT
 $Present PW (stp.) 15'' - S 49^\circ E - 0.263 ch$ (~~Post by Vaughn~~)
~~at 63.223 east of NW cor replaced old wood~~
 $0.604 ch.$, both by Geneset Eng. (Jlg 1972)

② N 1/4 NE 1/4 at 20.551 put in a 2" IP on a pole in spruce swamp
 1.592 west of M.C. New B.T. $PW 12'' - S 42^\circ W - 0.607 ch.$; $PW 15'' -$
 $N 51^\circ W - 0.120 ch.$ a 2" capped IP bears $S 78^\circ W - 0.815 ch.$ (Jlg 72)

③ N 1/4 Sec 14 Ground overrun of 5.46 & set proportional 1/4 Cor. at 43.50
 east of NW Cor. $PW (stp.) 28'' - N 88^\circ E - 0.845 ch.$ (Vaughn 5/19/17)
 at 41.080 east of NW Cor & 41.102 west of NE Cor. (~~Post by Vaughn~~) Ground corner
 perpetuated by Walsh & Sons used by Fisher & Wincertsen. Replaced a capped well
 post with DNR. ~~post~~. Walsh's old B.T. $stp 18''$ ~~at~~ east of corner very rotten.
 New B.T. $PN 15'' - N 86^\circ E - 0.764 ch.$; $PN 12'' - S 59^\circ E - 0.430 ch.$; $PN 18'' - S 22^\circ E -$
 $0.635 ch.$ (Jlg 1972)

④ N¹/₄ NW¹/₄ at 21.75 east of NW cor. set ¹/₈. PW (app) 20"
60°E-13; PW (app.) 24"- 13°E - 0.115 ch (Vaughn 5/19/17)
at 20.540 put our pipe by a yellow 3/4" I.P. by Jennings. OR 12"-
S 26°E - -0.361 ch; OR 14"- S 75°W - 0.325 ch. (Jlg 1972)

⑤ NW cor. Sec. 14 Set the section corner 5.39 (orig. distance) south
of the hole & on the orig line. PW 8" S 70°E - 38 ch; Oak 7" S 30°E -
0.355 ch (Vaughn 5/19/17) Vaughn's PW 8" now 22" - S ^{85°}~~80°~~E - 0.380 ch - ;
"Yes Oak 7" is S 36°E ^{0.275 ch +} is broken off. Other B.T. present are PW 14" N 35°E -
1.718 ch; PW 18" N 81°E - 0.293 ch. New B.T. PN 18" - S 24°E - 0.633 ch.
Dug 1 foot of earth off of large flat rock & chiseled X for cor corner on it.
Angled steel sign post over X of corner. (Jlg 1972)

⑥ W¹/₄ NW¹/₄ at 20.764

⑦ W¹/₄ Sec 14 a u.c.d. pipe at 41.528 each way (Jlg 1946)

⑧ W¹/₄ SW¹/₄ at 20.764 Found 2" W.C.D. Brass Cap Made New BTs, MS 6" N62°E
7.74', MS. 12" N81°W 14.75' (Visser, 3/15/95)