


SEC. 11 T. 39 N. R. 9

L615

① N¹/₄ NE¹/₄ at 21.139 set 2" IP on joben marking. BT. are Tom 5" - S83°E - 0.441 ch.; Tom 5" - S12°E - 0.874 ch.; PW 11" - N89°W - 0.738 ch. (Dg 1972)

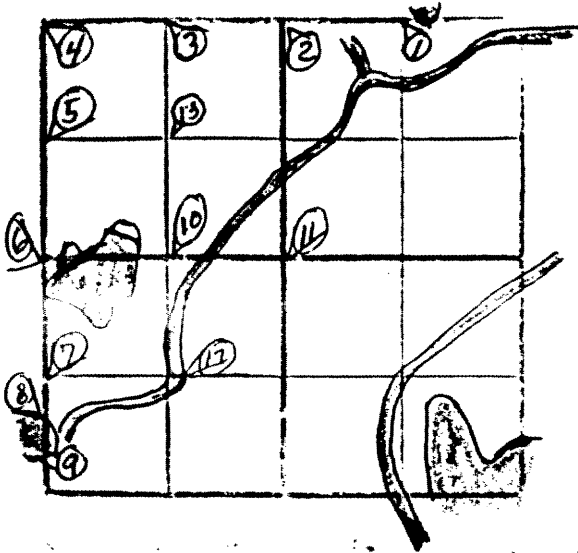

② N¹/₄ Sec 11 at 126.53 ch west of SE cor. sec 1 fell 3.87 north of ¹/₄ post, 2 tom. marked for ¹/₄ post, opl sites call for bush of sugar. Don't set this corner was set by Allen when the corner cost wood. Y^d will use it. One old BT. is down, old bearing Tom 8" - S10°W - 20 - Newberry

PW 10" - N15°W - 50 (Vaughn 5/4/09)

② N¹/₄ Sec 11 Found ¹/₄ post set by Allen equi-distant between NE & NW cor when they were standing. Post east 42.16 & fell 29 north of NE cor. Corrected line west & ran west from ¹/₄ cor. 42.16 & set NW cor. (Vaughn 5/19/17) Replaced Allens wood post with WCD post Allens BT. Tom 8" (8' alt.) ~~was~~ S10°W - 0.200 ch has orange Vaughns PW 12" now a stp. - Nook - 50 link has scrubby. Corner is 2± link west of fence corner which runs S-N-E. New BT. Tom 8" - N32°E - 0.957 ch.; Tom 6" - S31°W - 1.633 ch. (Dg 1972)

③ N¹/₄ NW¹/₄ at 21.08 set ¹/₈ PW (stp.) 20" - S26°E - 0.235 ch. (Vaughn 5/18/17) at 20.666 set corner 18± ch. east of road. New BT. PW 12" - S19°W - 0.830 ch. PW 22" - N58°W - 0.495 (Dg 1972)

RECEIVED & FILED
16154
Oreida County Surveyors Office
Date 1/5/88
By M. J.
OCS Area #

④ NW Cor. Sec 11 Doubled across NE ~~corner~~ corner &
N $\frac{1}{4}$ Cor. set by Allen, going 42.16 & set NW Cor. PW (stb.) 28" - N25°W -
0.782 ch.; PW (stb.) 40" - S29°E - 0.260 ch. (~~Vaughn 5/19/17~~) corner is 80.82
north of SW Cor. (Vaughn 5/19/17) set DNR pipe. New BT. 8R 10" - S77°E - 0.611 ch.
NH 6" - S28°E - 0.441 ch.; PW 12" - N11°W - 0.847 ch.; Vaughn's corner is
S 52°W - 1.864 ± (Jlg. 1972)

⑤ W $\frac{1}{4}$ NW $\frac{1}{4}$ - set 18 Cor. - Nothing for bearings (Vaughn 5/19/17) at
19.889 set 1" IP painted red for 18 1.237 ± north of fence. New BT. OR 14" -
N46°E - 0.468 ch.; BW 9" - S69°E - 0.324 ch. Fence corner is S 39°W
1.719 ch. (Jlg 1972)

⑥ W $\frac{1}{4}$ Sec 11 - Did not find W $\frac{1}{4}$. at 80.82 north of SW Cor. fell 222 east
of NW Cor. PW (stb.) 18" - N31°W - 0.335 ch.; PW 16" - S66°W - 0.760 ch.
(Vaughn 5/19/17) at 39.778 set DNR pipe for new $\frac{1}{4}$ Cor 93 ± lbs east
of woven wire fence. New BT. PW 12" - S61°W - 0.521 ch.; 8R 12" -
S75°W - 1.678 ch.; PW 13" - N49°W - 0.276 ch. (Jlg 1972)

⑧ SW $\frac{1}{4}$ SW $\frac{1}{4}$ Sec 18. - Nothing for bearings (Vaughn 5/19/17) at 19.889 set
 1" I.P. painted red for 18 66 \pm lh east & 1.69 \pm north of woven wire fence.
 New B.T. PN 7" - S 48 $^{\circ}$ W - 0.386 ch.; MH 15" - N 61 $^{\circ}$ W - 0.865 ch
 (Jg 1972)

⑨ Monroe Co. - West line - North of Biggs Lake Found where orig. line cross the
 lake & set M.C. on line. Orig. corner gone. PW 20" - S 79 $^{\circ}$ W - 79 (Vaughn 5/19/17)
 Replaced 1" I.P. & old scribed post with DNR pipe. New B.T. PN 11" - N 14 $^{\circ}$ E -
 0.409 ch.; PW 10" - N 65 $^{\circ}$ E - 0.209 ch.; 15' Rock - 40' NW (Jg 1972)


⑨ Monroe Co. - West line - South of Biggs Lake Found where orig. line cross
 the lake & set the M.C. on line ^{orig. corner gone.} PN 18" - N 56 $^{\circ}$ W - 0.275 ch.; PW - 10" - N 63 $^{\circ}$
 48 lh (Vaughn 5/19/17) Replaced Vaughn's SMC with DNR pipe. - This steps
 still there. New B.T. PN 18" - S 89 $^{\circ}$ E - 0.276 ch.; MH 8" - S 09 $^{\circ}$ E - 0.181 ch.
 Jg corner is 26 \pm lh south of marsh & 93 \pm lh. south of water. (Jg 1972)

⑩ N¹/₄ SW¹/₄ PW 16" - S 85° W 0.54 ch.; PW 10" - S 71° E - 0.730 ch.

(Vaughn 5/19/17)

Set 1 1/4" Iron Pipe on hill old BT. PW 12" N 09° W 15.55, PW 6" N 88° E 30.55
(Seymour 82)

⑪ Old Sec 11

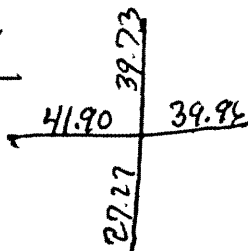

PN (stb.) 18" - S 73° E - 14 ch.; PN (stb.) 18" - S 84° W
19 ch. (Vaughn 5/19/17)

⑫ Old SW¹/₄ at 20.98 east of W¹/₄ SW¹/₄. Bench 8" - N 15° W - 50 ch.; PW 10" -
S 22° E - 26 ch. (Vaughn 5/19/17)

Set 1 1/4" I.P. BTs. PW 10" S 47° E 22.25', BW 15" S 73° W 23.55'

⑬ NW 1/16 Set 1 1/4" I.P. on 20' Tam pole in swampy area

BTs. Tam 3" S 29° W 13.50', SB 3" S 16° E 9.60'

(Seymour 82)