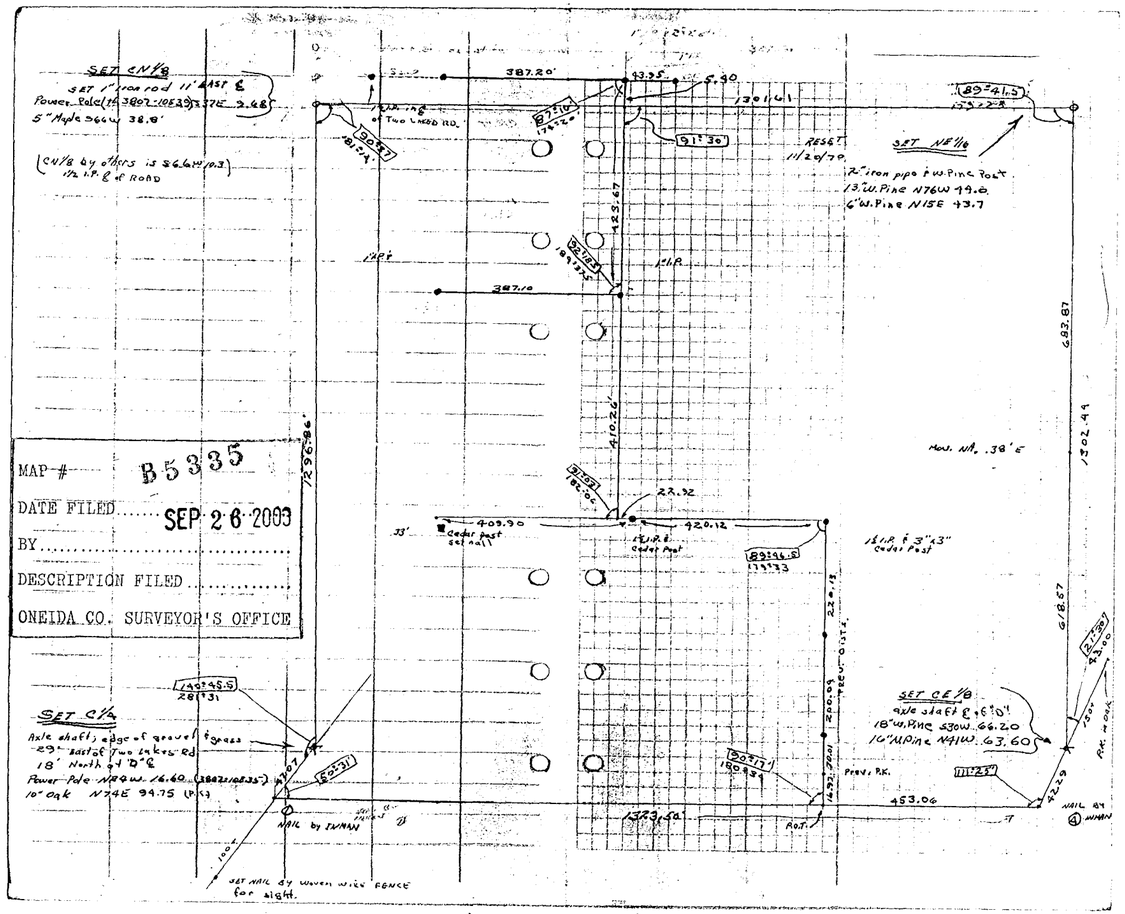

MAP # B5335

DATE FILED SEP 26 2003

BY

DESCRIPTION FILED

ONEIDA CO. SURVEYOR'S OFFICE

90°17	16.97	453.06	1302.44		200.86
180-34			618.57		
89-46.5		409.90	683.87		
179-33		22.97	1302.44		
87-10	387.20	487.00			
174-20					
92-18.5		11.34			
184-37.5		66.00			
90°37.3		200.80			
		1400.80			
		1301.61			
		1300.80			
		81			

SW-NE SEC 10
T38N, R9E

6

Adamski (D)

6 Nov. 1970 — KRAEMER, Adams
Clear ± 45°

Tied to Dislo-mat traverse, and two of scott's pipe

10 Nov. 1970 — KRAEMER, Adams
Clear ± 45°

Tied to five more I.P. (by others). Also CN 1/8 by others, set C1/4 & CN 1/8; NE 1/16

20 Nov. 1970 — KRAEMER
Snow ± 35° — Adams

Cut N-line of forty. Angle at NE cor. was 0°02' large and we measured .81 short. So moved NE cor. .81 EAST and returned angle checks 0°01' small.

on N-line

SECTION SUBDIVISION WORKSHEET

NORTHWOODS SURVEYORS - 1970

SEC. 10 - 38 - 7

B5335

13,113.13 / 13,941.83

N 1/8 Corner 15,263.05 / 12,637.52

1/8 Cor 15,285.54 / 13,931.54

S 89-05 E

1294.22' 2588.44 1294.22'

N 85-15 E 394.42E 394.82

S 1/4 Cor. 15,308.03 / 15,225.57

1296.86 45-27 W

N 0° 27.2' W 1302.45'

1308.05

1/16 Cor. 13,933.13 / 13,941.83

1/8 Cor 13,966.18 / 12,640.93

N 89-15.2 E 1301.61

N 89-15.2 E 1301.61

1/8 Corner 14,000.09 / 15,248.33

N 45-41.4 E 3746.58

2593.70 N 0-44 E 2593.72

1296.86

N 0° 27.2' W 1302.44'

2616.11

1308.05

C 1/4 12,669.31 / 12,643.15

W 1/4 12,645.89 / 9936.60

2686.70 N 89-07 W 2657.35'

2686.69 N 89-30 E 5304.69'

45-02.8

89-37.5

90-22.5

1309.07' N 89-58 E 1329.50'

2618.05' 12,632.79 / 12,613.46

1/8 Cor 12,680.73 / 13,952.12

1309.02'

44-55.1

1/4 Cor (prop.) 12,694.16 / 15,161.09

N 0-47 W 5232.22'

N 39-06.6 E 4707'

N 21-05.5 E 42.29'

N 0°-07.5' W 2647.35

2673.60

S 44-05.4 W 3754.19'

S 39-30 E 1544'

S 39° W 365.80'

N 45-27.2 W 3771.88'

44-12.9

45-11.7

S 85-16 E 325.00

S 88-06 W 2499.62'

N 88-13 W 1150.03'

S 85-13 W 605.03'

N 89-54 W 2858.33'

S 72-32 W 659.94'

9995.71 / 12648.92

9995.34 / 12858.33

9999.46 / 12,200.69

10,383.87 / 10,409.19

10,076.29 / 15,096.61

10,000 / 10,000

Sec Cor

Sec Cor

Bearings Solar from SE SE Sec 3

3116.60 3737.27 358.00

89-54 2858.33

Section 10 38-7

Note: Gensor Engr. subdivided Section 15 in 1954, and positioned the S1/4 of Sec. 10 276.54' from the M.C. to the East. This follows Doris 1893 work - see Oneida Map File # L 1052. Gensor's map is Dwg. No. 1477 dated 7/20/54. This section subdivision may not be correct...

8/21/2003

MAP # B5335
DATE FILED SEP. 26 2003
BY
DESCRIPTION FILED
ONEIDA CO. SURVEYOR'S OFFICE

B5335