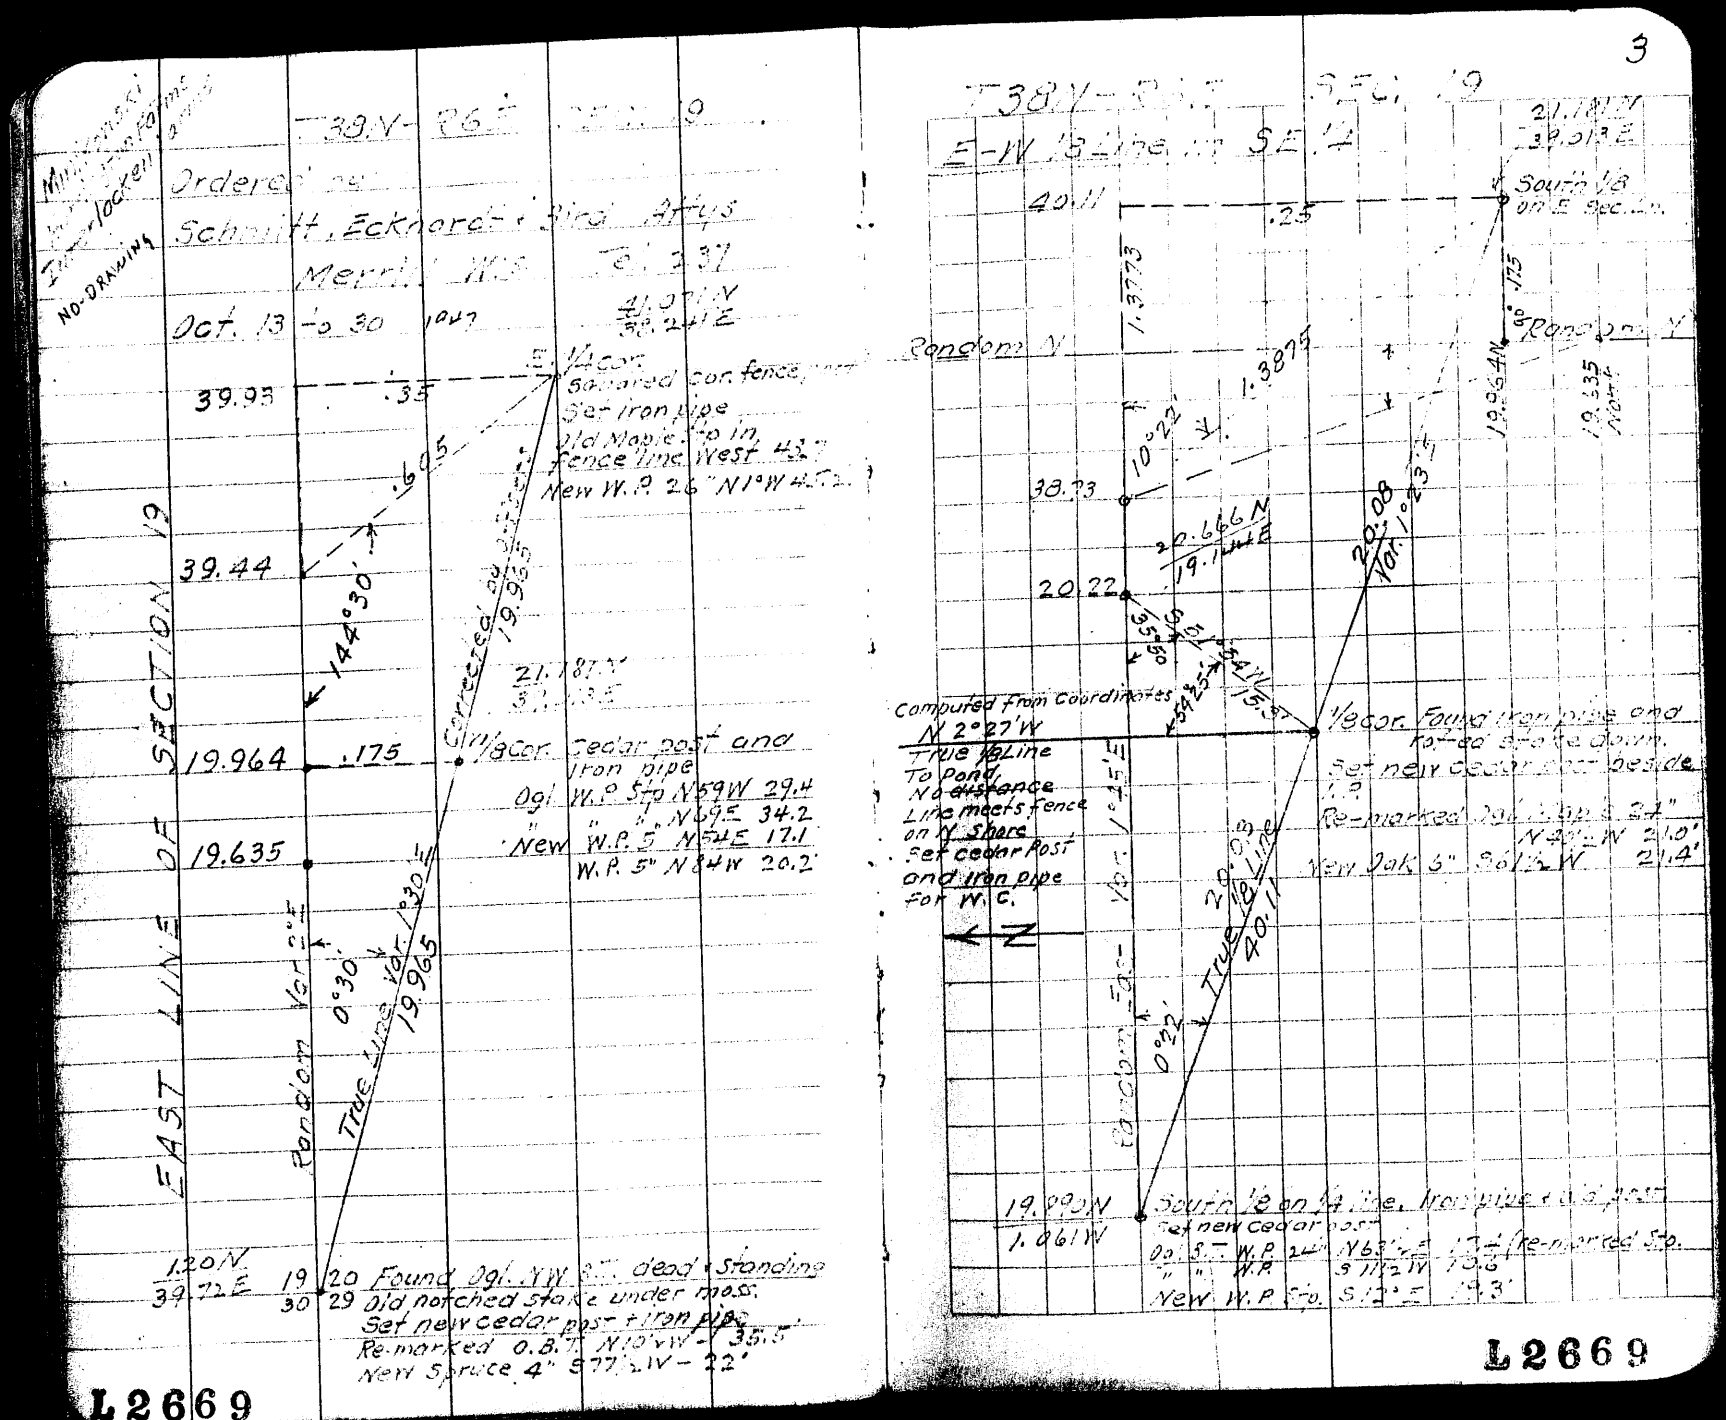
T38N-R6E SEC. 19
Ordered by
Schmitt, Eckhardt & Bird Attys
Merrill Wis. Tel. 237
Oct. 13 to 30 1947
NO-DRAWING
EAST LINE OF SECTION 19
39.93
.35
39.44
.605
144°30'
19.964
.175
19.635
Random Var. 2°E
0°30'
True Line Var. 1°30'E
19.965
Corrected by offsets
19.965
E. 1/4 cor.
Squared cor. fence post
Set iron pipe
Old Maple Stp in fence line West 43.7
New W.P. 26" N1°W 45.2
21.187 N
1/8 cor. Cedar post and iron pipe
Ogl. W.P. Stp N59W 29.4
" " " N69E 34.2
New W.P. 5" N54E 17.1
W.P. 5" N84W 20.2
1.20 N
39.72 E
19 20
30 29
Found Ogl. NW B.T. dead & standing
Old notched stake under moss.
Set new cedar post + iron pipe
Re-marked O.B.T. N10½W - 35.5'
New Spruce 4" S77½W - 22'
L2669
T38N-R6E SEC. 19
E-W 1/8 Line in SE 1/4
40.11
.25
South 1/8 on E Sec. Ln.
21.181 N
39.013 E
1.3773
Random N
1.3875
10°22'
38.73
20.666 N
19.144 E
20.22
35°50'
S51°54'W
15.5'
54°25'
20.08
Var. 1°23'E
19.964 N
19.635 North
Computed from Coordinates
N 2°27'W
True 1/8 Line
To Pond
No distance
Line meets fence
on N Shore
Set cedar Post
and iron pipe
for W.C.
1/8 cor. Found iron pipe and rotted stake down.
Set new cedar post beside
Re-marked Ogl. Maple 24"
N40½W 21.0'
New Oak 6" S61½W 21.4'
Random East Var. 1°45'E
0°22'
True 1/8 Line
40.11
19.990 N
1.061 W
South 1/8 on 1/4 line. Iron pipe & old post
Set new cedar post
Ogl. S.T. W.P. 24" N63½E 17.4 (re-marked Stp.
" " W.P. S11½W 18.6
New W.P. Stp. S12°E 19.3'
L2669