


SEC. 20 T. 39 N. R. 7 E.

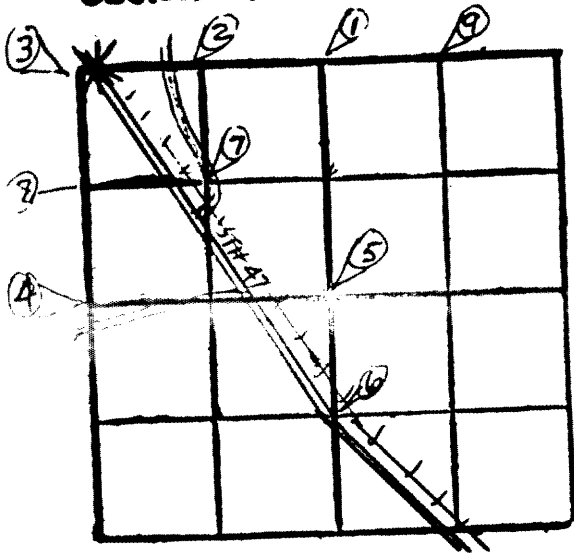

① N $\frac{1}{4}$  Sec 20 set 2" DNR brass cap (by prop-  
~~er~~ Perr's 1899 from c $\frac{1}{4}$  20 to N $\frac{1}{4}$  20 distance)  
 Corner is approx 60' south into swamp.  
 BT made BW 18" N 1 $^{\circ}$  E 114.55', PN 20" N 84 $^{\circ}$  W 189.50'  
 (6-11-81 Seymour, Viissers, Freund)  
 Also BT made Apr 17" N 49 $^{\circ}$  W 99.20', BW 14" N 5 $^{\circ}$  W 117.95'  
 Seymour 4-24-84  
 See corner file

② N $\frac{1}{4}$  NW $\frac{1}{4}$  at 1321.42' from NW 20 set 1 $\frac{1}{4}$ " iron pipe BT's SB 4" N 25 $^{\circ}$  W 19.60',  
 and PN 10" N 34 $^{\circ}$  E 65.68' (10-12-81 Seymour, Freund)

③ NW 20 found axel shaft (with wood post) BT's Mpl 20" S 17 $^{\circ}$  W 8.4' and old stp 16" N 25 $^{\circ}$  W 5.6'  
 (2-27-78 Viissers, Freund) Marker post set 165' east on South edge Hwy 47.  
 See corner file

④ W $\frac{1}{4}$  20 found 1 $\frac{3}{4}$ " iron pipe and wood post. BT's PW stp 20" N 20 $^{\circ}$  W 33.7' and  
 PW 16" stp N 65 $^{\circ}$  W 13.2' (2-28-78 Viissers, Freund, Olson)  
 See corner file

⑤ C $\frac{1}{4}$  20 found 1 $\frac{3}{4}$ " iron pipe (probably Dorr's) PW stp 19" N 40 $^{\circ}$  W 34.8' (2-20-78 Viissers, Freund, Anderson)

⑥ W $\frac{1}{4}$  SE $\frac{1}{4}$  found 1" iron pipe (probably Dorr's) M 6" S 81 $^{\circ}$  E 7.2', BW 6" S 26 $^{\circ}$  E 13.3'

OS Area #	SP 77
RECEIVED & FILED #	APR 22 1988
Field County Surveyor's Office	

L784

⑦ C<sup>1</sup>/<sub>4</sub> NW<sup>1</sup>/<sub>4</sub> found 1" iron pipe and post (2-27-78 Vickers, Freund)

⑧ W<sup>1</sup>/<sub>4</sub> NW<sup>1</sup>/<sub>4</sub> Oneida Co. concrete well casing Hem. 29° 11' 13" E 100' (1911-1912)

⑨ N<sup>1</sup>/<sub>4</sub> NE<sup>1</sup>/<sub>4</sub> Set 1" i.p. (30' east of swamp) BT<sup>s</sup> OR 12" S 85° W 13.25'  
PW 6" S 43° E 20.55'  
Seymour 11/18/03