MAP # 1, 2426 DATE FILED NOV 1.6 2007

SURVEY LANDMARK PRESERVATION RECORD

It is the primary purpose of this record to preserve the location of any survey landmark subject to disturbance, removal or to be rendered inaccessible, as provided by Section 59.74(2), Perpetuation of Ednamarks, Wisconsin Revised Statutes.

County:

City, Village, Town:

Section:

Town:

Range:

**ONEIDA** 

**MONICO** 

28

36

11

Describe what was found, its location and origin. If known, describe if the monument found is a 1/16 corner or other subdivisional corner; a monument called for in a deed; a monument shown on a survey map or plat ect. and in what Gov't Lot, 1/4-1/4 Section or other PLSS subdivisional tract.


April 25. 2005 - Due to road construction Nicolet Surveyors, Inc. was hired by the Oneida County Land Information Office to preserve the location of this survey marker. We found a 3/4" iron pipe in good condition. This corner is shown as a computed position on the Plat of Survey by Thomas Boettcher dated 8/16/1999 - Oneida County Land Information Office Map Number B-4338. This corner lies approximately 70' North of U.S. Highway "8" and 4' South of the Old Highway "8" roadbed and is not in danger of being disturbed due to the road construction.

November 7, 2007 - The Oneida County Land Information Office hired us to go and revisit the corner because the installation of a new power line may have disturbed this corner. We found a 3/4" iron pipe with the top half bent. We replaced it with a 3/4" iron rebar and set witness corners as shown below.

Show approximate location of survey landmark on this Section diagram:

O

B 3

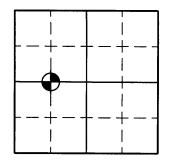

Plan view map of survey landmark location with bearing and distance ties to a minimum of four(4) described witness or reference monuments of concrete, natural stone, metal, live bearing trees or equivalent material and/or described GPS method and precision. 1" = 50'NOTES:

14" Tamarack 3 60 D Nail Set




1. All bearing were taken with a hand compass and distances measured with a tape measure.

2. We found a 3/4" iron pipe with the top bent at the corner location and replaced it with a 3/4" iron rebar.

*LEGEND* 

( 1/2" Iron Pipe Found

3/4" x 24" Iron Rebar Set Weighing 1.50 lbs/lin. ft.



Metal R/W post found next to corner

ROADBED

Seal



## PROFESSIONAL LAND SURVEYOR CERTIFICATE:

This survey landmark is being referenced for the express purpose of location preservation and is not intended as an attestment of the legal significance and/or positional accuracy thereof.

Therefore, this survey landmark location should be further evaluated and verified for any future land surveying or related usage purposes

I, Jonathan W. Dulin, hereby certify that I am duly licensed as a Professional Land Surveyor in the State of Wisconsin; that the location of this survey landmark was referenced by me under my direct supervision and/or control; and that the information shown is true and correct to the best of my knowledge and belief.

Signed:



8

B