(a) CORNER LOCATION:

West M.C. on south line of Section 15

Township 38 North

Range 7 East

Town Lake Tomahawk

County of Oneida

O. C. COORDINATES

North: 215041.1661


East: 213968.3644 Control Station: O. C. 269

Latitude: 45°47'50.32754" N

Longitude: 89°37'00.22707" W

Datum: NAD - 83 (91)

Method: Direct RTK - GPS

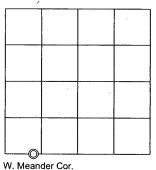


**SECTION 15** 

THIS MONUMENT RECORD HAS BEEN PREPARED FOR THE PURPOSE OF REFERENCING THE CORNER POSITION TO THE ONEIDA COUNTY COORDINATE SYSTEM USING GPS METHODS. PROVIDE DESCRIPTION OF THE CORNER MONUMENT IN DETAIL.

April 18, 2009 - Recovered capped 2.4" o.d. aluminum monument extending 7" above ground level, near the easterly shore of South Two Lakes, as described in U.S. Public Land Survey Monument Record by Michael Romportl, RLS # 1624, dated July 10, 1987 and filed in the Oneida County Register of Deeds Office on August 2nd 1987.

MAP # 1, 2589	
DATE FILED, 5/8/09	e e e elo e ele <sup>-</sup> g <sup>-</sup> 0)
ВУХ 47	• • • • • • • • • • •
DESCRIPTION FI ED	
ONEIDA CO. SURVEYOR'S	OFFICE

I, JAMES D. REIN, REGISTERED LAND SURVEYOR NO. S-1234 HEREBY CERTIFY THAT THE CORNER LOCATION ON THIS RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THE INFORMATION SHOWN HEREON IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

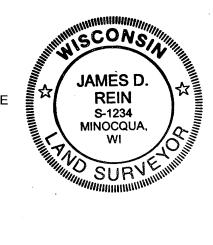

2589A

L 2589A

(a) CORNER LOCATION:

Wit. to the southeast corner of Section 16

Township 38 North

Range 7 East

Town of Lake Tomahawk

County of Oneida

O. C. COORDINATES

North: 216155.3935


East: 212973.3341

Control Station: O. C. 269 Latitude: 45°47'50.32754" N

Longitude: 89°37'00.22707" W

Datum: NAD - 83 (91)

Method: Offset trav - RTK - GPS control

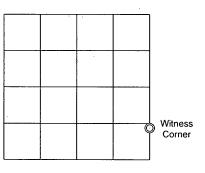

**SECTION 16** 

THIS MONUMENT RECORD HAS BEEN PREPARED FOR THE PURPOSE OF REFERENCING THE CORNER POSITION TO THE ONEIDA COUNTY COORDINATE SYSTEM USING GPS METHODS. PROVIDE DESCRIPTION OF THE CORNER MONUMENT IN DETAIL.

April 18, 2009 - Recovered a brass capped 2.4" o.d. iron pipe painted red, extending 12" above ground level and referenced by bearing trees as shown on a map of survey by Marvin E. Seymour, RLS #1412, for the Wisconsin Department of Natural Resources, dated December 3, 1987 and filed as C575 in the Oneida County Surveyor's Office.

I, JAMES D. REIN, REGISTERED LAND SURVEYOR NO. S-1234
HEREBY CERTIFY THAT THE CORNER LOCATION ON THIS RECORD
WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL
AND THE INFORMATION SHOWN HEREON IS CORRECT AND COMPLETE
TO THE BEST OF MY KNOWLEDGE AND BELIEF.

SIGNATURE

May 5, 2009



(a) CORNER LOCATION:

East 1/4 corner of Section 16

Township 38 North

Range 7 East

Town of Lake Tomahawk

County of Oneida

O. C. COORDINATES

North: 217591.4861


East: 213041.2639 Control Station: O. C. 269

Latitude: 45°47'50.32754" N

Longitude: 89°37'00.22707" W

Datum: NAD - 83 (91)

Method: Direct RTK - GPS

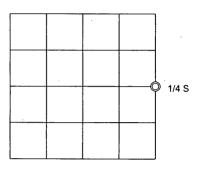

**SECTION 16** 

THIS MONUMENT RECORD HAS BEEN PREPARED FOR THE PURPOSE OF REFERENCING THE CORNER POSITION TO THE ONEIDA COUNTY COORDINATE SYSTEM USING GPS METHODS. PROVIDE DESCRIPTION OF THE CORNER MONUMENT IN DETAIL.

April 18, 2009 - Recovered a Wisconsin Conservation Department brass capped 2.4" dia. iron pipe extending 33 inches above ground level, as described in U.S. Public Land Survey Monument Record by Marvin E. Seymour, RLS #1412, dated December 3, 1987 and filed in the Oneida County Register of Deeds Office on December 4, 1987.

I, JAMES D. REIN, REGISTERED LAND SURVEYOR NO. S-1234
HEREBY CERTIFY THAT THE CORNER LOCATION ON THIS RECORD
WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL
AND THE INFORMATION SHOWN HEREON IS CORRECT AND COMPLETE
TO THE BEST OF MY KNOWLEDGE AND BELIEF.

SIGNATURE

May 5, 2
DATE



#### (a) CORNER LOCATION:

South 1/4 corner of Section 15 Township 38 North

Range 7 East

Town Lake Tomahawk

County of Oneida

O. C. COORDINATES

North: 215088.7480 East: 215660.9877


Control Station: O. C. 269

Latitude: 45°47'50.32754" N

Longitude: 89°37'00.22707" W

Datum: NAD - 83 (91)

Method: Direct RTK - GPS

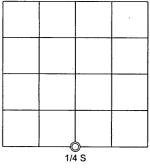

**SECTION 15** 

THIS MONUMENT RECORD HAS BEEN PREPARED FOR THE PURPOSE OF REFERENCING THE CORNER POSITION TO THE ONEIDA COUNTY COORDINATE SYSTEM USING GPS METHODS. PROVIDE DESCRIPTION OF THE CORNER MONUMENT IN DETAIL.

April 18, 2009 - Recovered capped 2.4" o.d. aluminum monument extending 3 inches above ground level as described in that U.S. Public Land Survey Monument Record by Michael Romportl, RLS # 1624, dated July 10, 1987 and filed in the Oneida County Register of Deeds Office on August 21, 1987.

I, JAMES D. REIN, REGISTERED LAND SURVEYOR NO. S-1234
HEREBY CERTIFY THAT THE CORNER LOCATION ON THIS RECORD
WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL
AND THE INFORMATION SHOWN HEREON IS CORRECT AND COMPLETE
TO THE BEST OF MY KNOWLEDGE AND BELIEF.

SIGNATURE

May 5th, 2009 DATE

