


E. T. 38 N. R. 7 E.

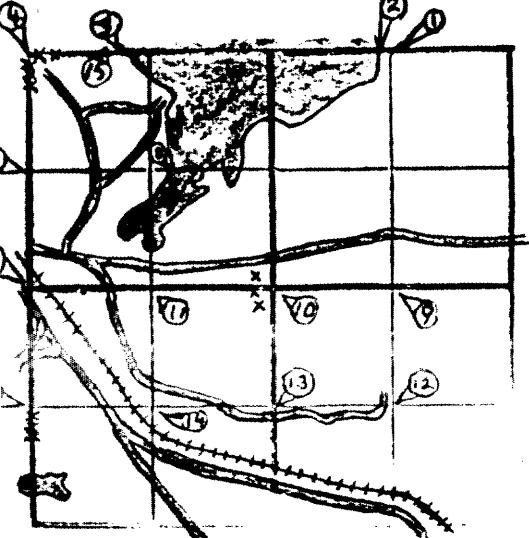

(1.683 east of orig. M.C.) 61

① $N \frac{1}{4} NE \frac{1}{4}$ At 19.859 get 1" fca

Pipe. B.T.'s On 10" S46°W 0.224 ch,
Mr 5" N73°W 0.461 ch. (JLg, 1965)

found 2" iron pipe + BT³ OR 12" S46°W 14.48',
MR 5" N73°W 30.34'
Seymour 11/6/80

② Meander Cor - North Line - East of Dorothy Lake ~~Orig M.C. - see corner file~~

1 piece of Ha22's concrete 6x6 post dug up
At 21.542 west of the NE Cor set 2" Brass Cap. ^{for} Old B.T.'s Stn Pn 26"
N88°E 0.170 (orig.), Stn. Pn 20" S46°E 0.100 ch. (orig) New B.T.'s
Mr 8" N36°E 0.342 ch. (JLg 1965), Or 7" S47°E 0.2.33 ch. (JLg 1965).

see corner file

13745-1

RECEIVED & FILED	APR 22 1988
Onida County Surveyor's Office	By C.S. JL
Date	APR 22 1988
OCS Area #

606

③ Meander Cor - North Line - West of Dorothy Lake At 63.761 west of the

NE Cor $\frac{5}{15}$. 67⁵ east of the NW Cor. (measured as if post straight-top was W.Ly)
6x6 concrete post by Ha22¹⁹³² Orig. stump, S36°E 0.130 ch. (S34°E 0.189 ch.)

New B.T.'s Bw 8" S55°E 0.182 ch, Or 7" S45°W 0.172 ch, Rock 7X8
4.5ft N55°W 0.515 ch (JLg, 1965) found 6x6 comp post with top half broken off, dug at and
replaced it with 2" I.P. w/DNR brass cap set flush with ground so ice won't damage it. Was set from Bw 8" + OR 7" BT³ fca.
New BT³ Bw 3" S18°W 10.9', a witness corner was set 35.0' west on sec. line (Seymour 10-26-77)

See corner file

Orig. Pine 30" N 43° E 0.265" (Dorr 11/27/1893)

Orig. NW cor. 6th corner monument 6" exposed by recent dist.

(4) NW Cor. Sec 2

from 3 orig. stumps. New B.T.'s Y. Pine 9" S 26° E 1.532. Y. Pine 14" N 60° E 0.1293 ch. (Hall) At 79.436 west of NE cor. set cor. st. post of Brass Cap. B.T.'s Mr 6" N 30° E 0.724 ch., Or 9" N 39° W 0.304 ch. (JLg, 1965) tall 2 pine B.T.'s are O.K. - a live & scabbed.

see Coomer file

⑤ NW NW $\frac{1}{4}$ Pine 18" N 74 $\frac{1}{2}$ ° E 0.293/4 ch. (Dorr 11/27/1893). Set in on monument at NW NW $\frac{1}{4}$, found Dorr's Pw 18", N 74 $\frac{1}{2}$ ° E 0.293/4 ch (Raughn Sect. 28, 1915). Dorr's Pw 18", N 20° E 0.380 ch noted by Raughn Aug. 16 1917. At 13.846 south of NW cor. set 2 Brass Cap, Iron Pipe by Lytle (JLg's map 1965) Old B.T.'s Pw 15" S 05° W 0.567 ch. Pw/Mr 9" S 78° E 0.318 ch. (JLg, 1965)

Sec. 2 - 38-7 (Cont.)

⑥ W 1/4 Sec. 2 Woodpost, 4". B.T. ASPEN 7" S 58°W 0.375 ch. (Darr 11/27/1893)

At 53.626 south of NW cor & 40.001 North of SW cor at ~~orig 1/4 cor~~
wood post set 2" Iron Pipe Brass Cap by Lytle (Jlg's map 1965)
 B.T.'s Dr 0.15? Also 2 1/2 ft. high scribed in wood by Dr. 0.15 &
 Iron Kassler (1936) (Jlg, 1965)

⑦ W 1/4 SW 1/4 B.T. PINE 24" S 42°W 0.102 ch. (Darr 11/27/1893) At 53.6265 south

of the NW cor, & 20.0005 north of the SW cor. set 2" Iron Pipe. Brass Cap
 2" Iron Pipe unanchored, surrounded by rocks
 by Lytle (Jlg's map 1965) B.T.'s Pine Stp 24" S 51°W - 0.167 ch (orig.?),
 Old Pn 12" S 57°W 0.636 ch, New Pn 14" S 08°E 0.608 ch, Dr 7" N 43°E 0.394 ch.
 (Jlg, 1965)

RECEIVED & FILED	4786
Onida County Surveyor's Office	
Date	APR 22 1988
By	S. J.
OCS Area #

⑧ Meander Cor - North 1/4 Line - West of Dorothy Lake At 21.952

east of W 1/4 NW 1/4 & 0.268 west of the west shore of Dorothy Lake
 set WCD Iron Pipe, Brass Cap (Jlg's map, May, 1965) BT's Dr 12"
 S 025°W 0.046 ch, Dr 11" N 48°E 0.091 ch. (Jlg)

- ⑨ N $\frac{1}{4}$ SE $\frac{1}{4}$ At 35.055 south of N $\frac{1}{4}$ NE $\frac{1}{4}$, 39.211 N of S $\frac{1}{4}$ SE $\frac{1}{4}$ &
19.111 E & W ~~Set~~^{used old} 1" Iron pipe (Jlg's map, May, 1965) B.T.S Pw 15" N 46° W
0.705 ch, Mh 7" S 24° E 0.309 ch. (Jlg 1965)
- ⑩ Ctr Sec. 2 At 34.632 S of N $\frac{1}{4}$ (in lake) & 39.630 N of S $\frac{1}{4}$ Cor, ~~Set 2"~~^{38:222}
~~west of east $\frac{1}{4}$ Cor & 39.198 east of the west $\frac{1}{4}$ Cor. Set 2"~~
IVCD Brass Cap Iron Pipe (Jlg's map, May, 1965) B.T.S Pg 14" S 55.2° E 0.340 ch,
Pg 8" N 54° E 0.879 ch (Jlg 1965)

⑪ N $\frac{1}{4}$ SW $\frac{1}{4}$ At 39.816 north of S $\frac{1}{4}$ SW $\frac{1}{4}$ & 19.599 E & W set 1" Iron Pipe. (Alg's map May 1965) B.T.'s Mr 5" S 78° W 0.208 ch or 13" S 04° W 0.262 (Alg 1965)

⑫ Ctr. SE $\frac{1}{4}$ At 19.465 $\frac{1}{2}$ East & west set 1" Iron Pipe. (Alg's map May, 1965)
B.T.'s Mr 7" N 74° E 0.354 ch, Or 12" S 24° E 0.167 ch (Alg 1965)

RECEIVED & FILED #	L 796
Oneida County Surveyor's Office	
Date	APR. 22 1988
By	S. Z.
OCS Area #	

⑬ W $\frac{1}{4}$ SE $\frac{1}{4}$ At 19.815 North & south, 19.465 $\frac{1}{2}$ west & 19.663 east set $\frac{1}{2}$ " x 5' Iron Rod in Road. B.T.'s Mr ~~8~~ 9" S 65° E 0.877 ch, Mr 7" S 26° E 0.432 ch (Alg, 1965) Iron Pipe on line, not corner at north edge of road.

(4) Ctr SW $\frac{1}{4}$ At 19.908 north & south, 19.663 east & west, set
1" iron Pipe. BT's Pn 75' 38°W 0.265 ch., Pn 17" N 46°W 0.432 ch.
(JLg 1965)

(15) Witness Corner - on north sec. line west of Dorothy L. set 2" I.P. DNR brass cap 35.0' west of orig M.C.
that was found & replaced. BT³ BW 9" south 8.2', BW 10" N 57°W 21.9' (Seymour 10-26-77)

⑪ N $\frac{1}{4}$ SW $\frac{1}{4}$ At 39.816 north of S $\frac{1}{4}$ SW $\frac{1}{4}$ & 19.599 E & W set 1" Iron Pipe. (Alg's map May 1965) B.T.'s Mr 5" S78°W 0.208 ch or 13" S04°W 0.262 ch (Alg 1965)

⑫ Ctr. SE $\frac{1}{4}$ At 19.465 $\frac{1}{2}$ East & West set 1" Iron Pipe. (Alg's map May, 1965)
B.T.'s Mr 7" N74°E 0.354 ch, Or 12" S24°E 0.167 ch (Alg 1965)
9/4/85 found both BT's in good shape (grown shr.) degrowth

⑬ W $\frac{1}{4}$ SE $\frac{1}{4}$ At 19.815 North & south, 19.465 $\frac{1}{2}$ west & 19.663 east set $\frac{1}{2}$ " x 5' Iron Rod in Road. B.T.'s Mr ~~9~~ 9" S65°E 0.877 ch, Mr 7" S26°E 0.432 ch (Alg, 1965) Iron Pipe on line, not corner at north edge of road.

⑭ Ctr SW $\frac{1}{4}$ At 19.908 north & south, 19.663 east & west, set
1" Iron Pipe. BT's Pn 75" $38^{\circ}W$ 0.265 ch, Pn 17" $N46^{\circ}W$ 0.432 ch.
(Aug 1965)

⑮ Witness Corner — on north side line west of Dorothy L. set 2" I.P. DNR brass cap 35.0' west of m^g M.C.
that was found & replaced. BT's Bw 9" south 8.2', Bw 10" $N57^{\circ}W$ 21.9' (Seymour 10-26-77)