



T 40N-R0E SEC. 25
 For Robert D. Mortinson Atty.
 Eagle River Wis.

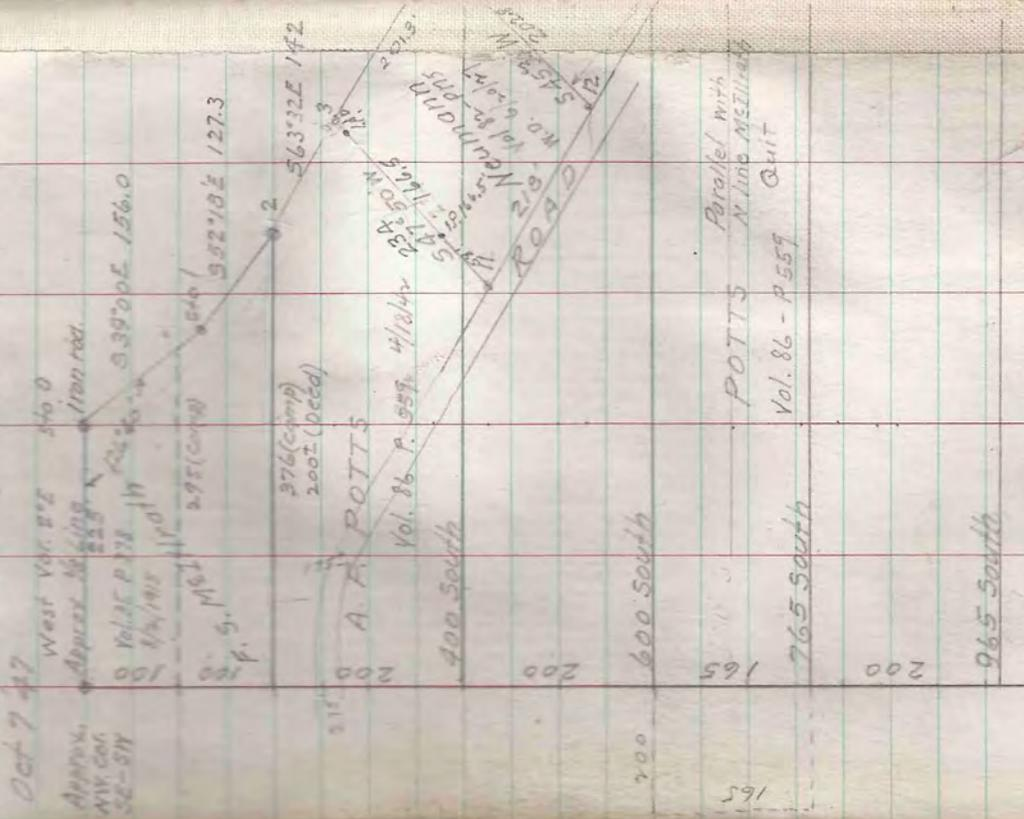

COORDINATES		S	E
540.0	50.00	6.680.17	764.13
1	121.23	7.758.86	774.67
2	199.01	8.834.18	841.50
3	262.30	9.859.38	1039.90
4	370.10	10.789.90	1111.80
5	496.31	11.426.23	144.92
6		12.530.53	329.06

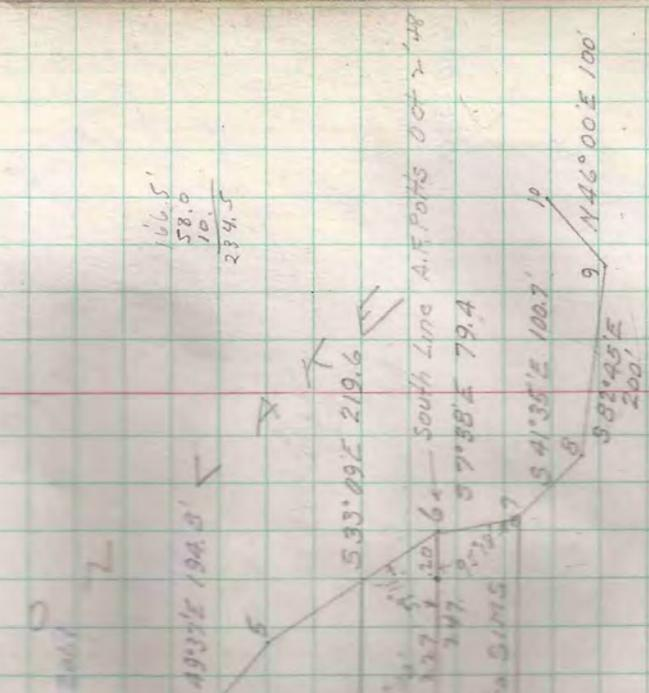


Does not intersect Moon Lake

Milwaukee
Kortright Farms
No. 0-22-11

T38N-R6E SEC. 19

Ordered by
Schmitt, Eckhardt & Bird Attys
Merrill Wis. Tel. 237
Oct. 13 to 30 1927
39.93

E 1/4 Cor.
Squared cor. fence post
Set iron pipe
Old Maple 30 in
Fence line West 43.7
New W.P. 26° N 10° W 45.2

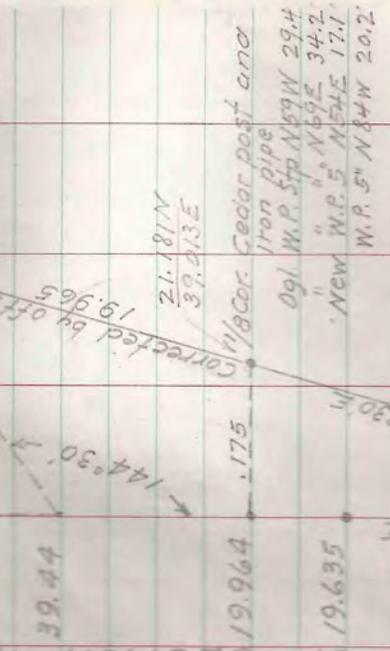


1/8 Cor. Cedar post and iron pipe
Ogl. W.P. 57° N 59° W 29.4
" " N 69° E 34.2
" New W.P. 5° N 54° E 17.1
W.P. 5° N 84° W 20.2

120N
39.72E 19 20 Found Ogl. NW B.T. dead & standing
30 29 Old, notched stake under moss.
Set new cedar post + iron pipe
Re-marked 0.8.T. N 10° W - 35.5
New Spruce 4" S 71° N - 12.

T38N-R6E SEC. 19

E-W 1/8 Line in SE 1/4
40.11

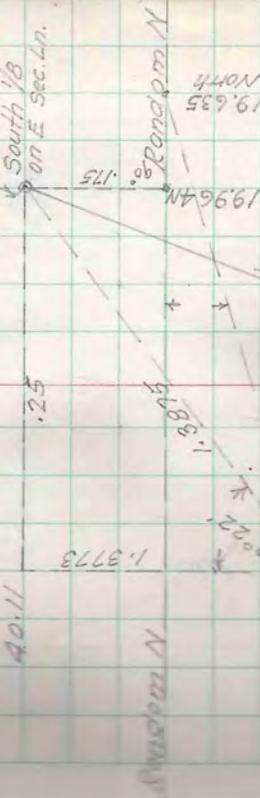


1/8 Cor. Found iron pipe and topped stake joint.
Set new cedar post beside I.P.
Re-marked Ogl. Maple 24"
New Oak 6" S 61 1/2° W 21.4'

19.820N
1.061W
South 1/8 on 1/4 line, iron pipe + old post
Set new cedar post
Ogl. S.T. W.P. 24" N 63 1/2° E 17.4 (re-marked Stp.)
" " W.P. 5 1/2° W 10.6
" New W.P. Stp. S 12° E 19.3

19.964N
21.181N
39.213E
South 1/8 on 1/4 line, iron pipe + old post
Set new cedar post
Ogl. S.T. W.P. 24" N 63 1/2° E 17.4 (re-marked Stp.)
" " W.P. 5 1/2° W 10.6
" New W.P. Stp. S 12° E 19.3


T38N-R6E SEC. 19

N-5 1/4 Line

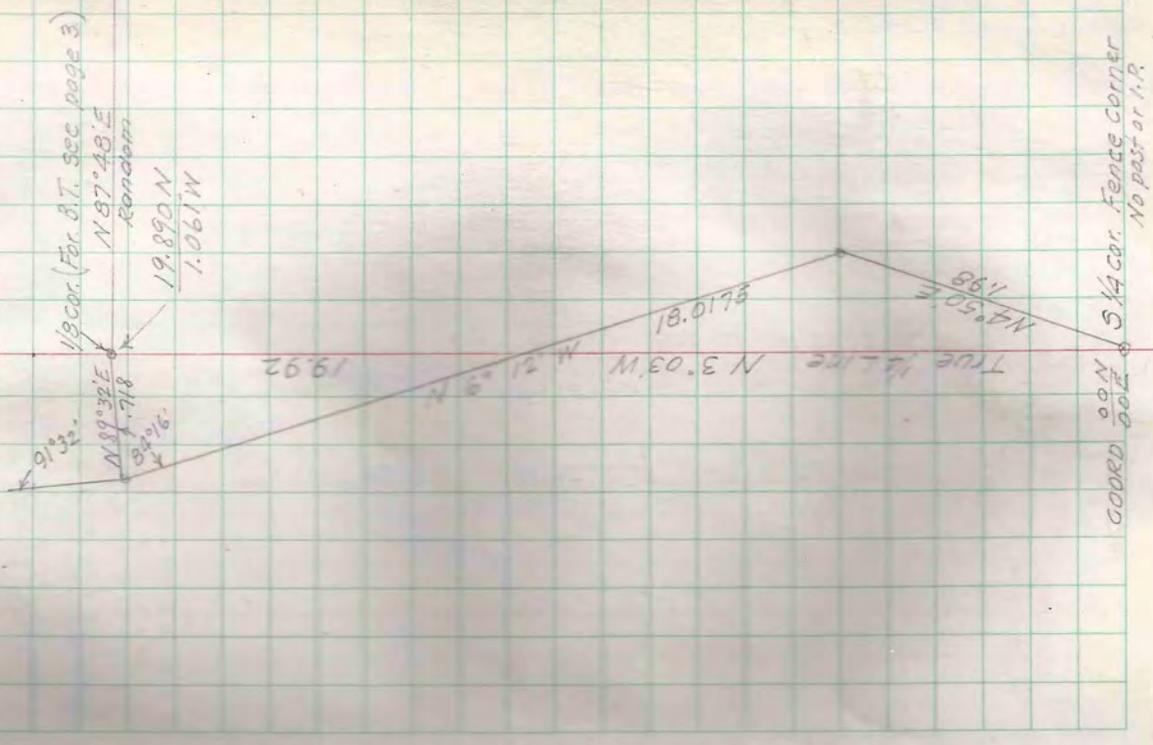

T38N-R6E SEC. 19

South Line of Lot 3

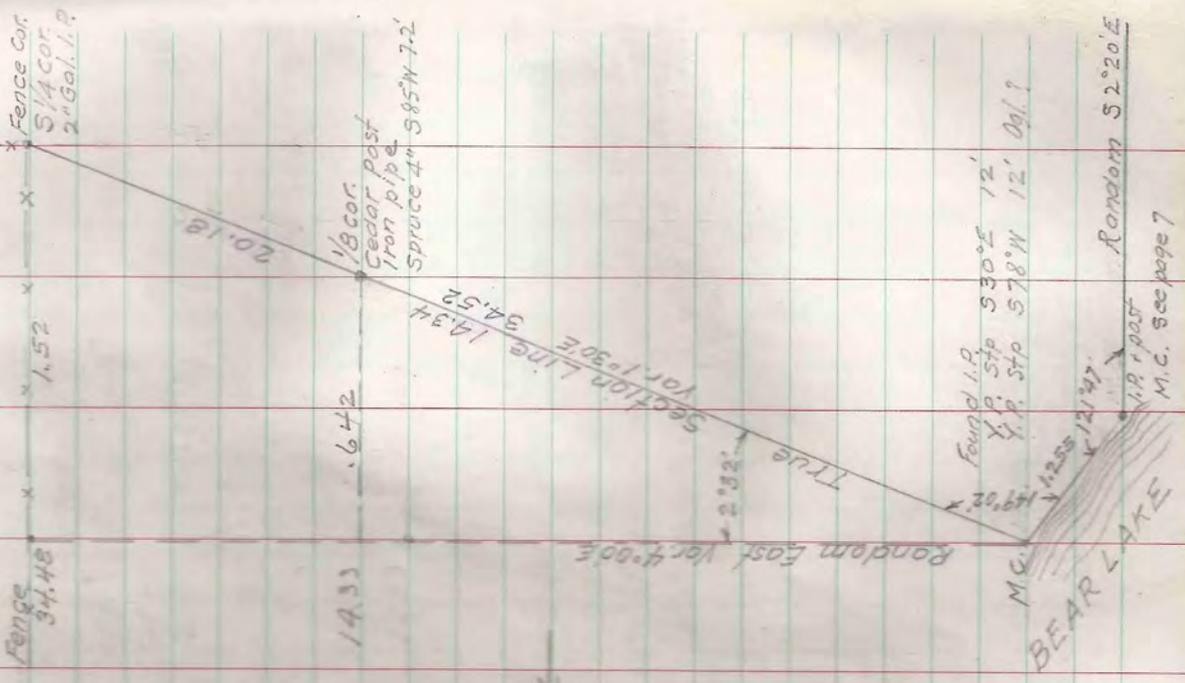

T 38 N - R 6 E SEC. 19

N - S 1/4 Line

39.734 N
1.905 W

Cent. 1/4 cor.
Replaced rotted post
with new cedar post
and iron pipe in
fence line. No B.T.
Og. B.T. Stamp blasted
out & laying N side road.

N 2° 00' W 10.007
N 0° 25' E 7.54
N 17° 35' E 19.86
N 176° 14' W 2.315
N 178° 16' E 1.061 W

660
650.7
310.7

N 87° 32' E 1/8 cor.
19.890 N
1.061 W

N 87° 48' E
Random

T 38 N - R 6 E SEC. 19

E - W 1/4 Line

41.071 N
38.241 E

E 1/4 cor.
S 82° 09' W
1.6075
145° 10'

589.59 W 2.105 E 1/4 cor.
1.54
S 88° 05' W
TO marsh and set cedar post and iron pipe
M.C.
(No dist.)

571.17 E
125.2
174.20 E
34.005
138.01
548.02 E
16.44 N 18.95
N 88° 05' E 40.17
N 88° 19' E
4.514
640.8
1.905 W
39.734 N
Cent. 1/4 cor.
112.06
14.313
11.54




T 38N-R6E SEC. 30

M.C. between 19 and 30 at Bear Lake

Found iron pipe
Pine Stump N 75° E 12.0'
" " S 32° E 12.0'

M.C. on Range Line betw 19 and 24
Found iron pipe and post. No orig S.T.s
The stumps agreeing closely with record.

Marked Pine stump S 35° W 12.0'
" Maple S 57° E 24.0'

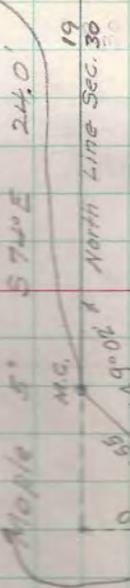

West Line Sec. 30

Set 1/8 cor.

19.52 South of M.C.

80.00 U.S. Govt

N 87° E 22.3'

S 12° W 10.0'


(see page 19 for)

Orig. S.T.
I.P. post.

T 38N-R6E SEC. 30

RANGE LINE - TRAVERSE

BEAR LAKE
M.C.
Dec 1st 2nd, 3rd 47

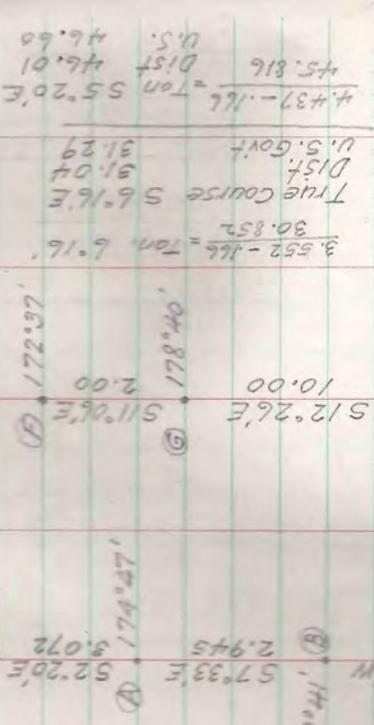


172° 37'	172° 40'	178° 40'	170° 57'	172° 26' E	172° 22'	177° 58'	172° 37'
2.00	2.00	10.00	10.00	10.00	10.00	10.00	10.00
S 11° 06' E	S 172° 37'	S 178° 40'	S 170° 57'	S 172° 26' E	S 172° 22'	S 177° 58'	S 172° 37'
3.072	3.072	3.072	3.072	3.072	3.072	3.072	3.072
57° 33' E	57° 33' E	57° 33' E	57° 33' E	57° 33' E	57° 33' E	57° 33' E	57° 33' E
2.945	2.945	2.945	2.945	2.945	2.945	2.945	2.945
52° 20' E	52° 20' E	52° 20' E	52° 20' E	52° 20' E	52° 20' E	52° 20' E	52° 20' E
3.747	3.747	3.747	3.747	3.747	3.747	3.747	3.747
51° 41' E	51° 41' E	51° 41' E	51° 41' E	51° 41' E	51° 41' E	51° 41' E	51° 41' E
4.437	4.437	4.437	4.437	4.437	4.437	4.437	4.437
3.747	3.747	3.747	3.747	3.747	3.747	3.747	3.747
1.963	1.963	1.963	1.963	1.963	1.963	1.963	1.963
3.072	3.072	3.072	3.072	3.072	3.072	3.072	3.072
3.072	3.072	3.072	3.072	3.072	3.072	3.072	3.072
3.072	3.072	3.072	3.072	3.072	3.072	3.072	3.072
14.99	14.99	14.99	14.99	14.99	14.99	14.99	14.99
30.852	30.852	30.852	30.852	30.852	30.852	30.852	30.852
14.964	14.964	14.964	14.964	14.964	14.964	14.964	14.964
45.816	45.816	45.816	45.816	45.816	45.816	45.816	45.816

3.552-166 = Ton. 6.16
Dist 31.04
TRIG COURSE S 6° 16' E
U.S. GOVT
4.437-116 = Ton. 55.20'E
Dist 46.01
U.S. GOVT
45.816
45.816


Interlocking
TRIANGULATION

Montreal Park

T39N-R6E SEC.23 LOT 1
"MANITU PARK"
Oct 25 47 A.M. Dorwin Ass't.

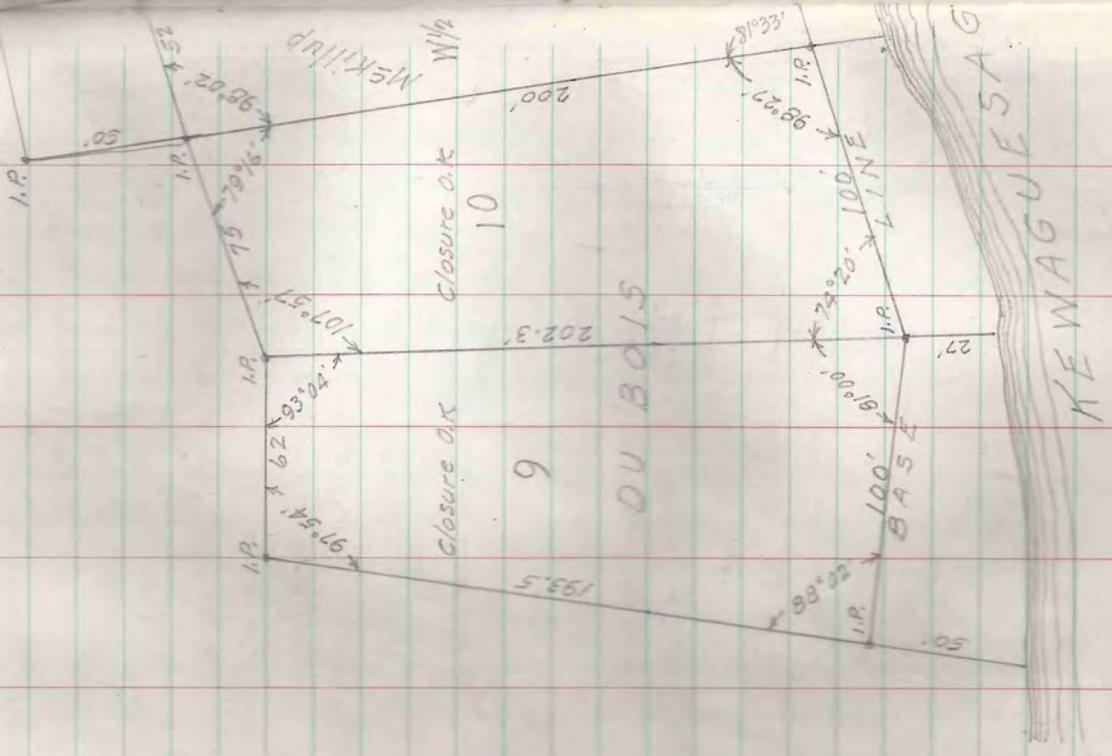

8

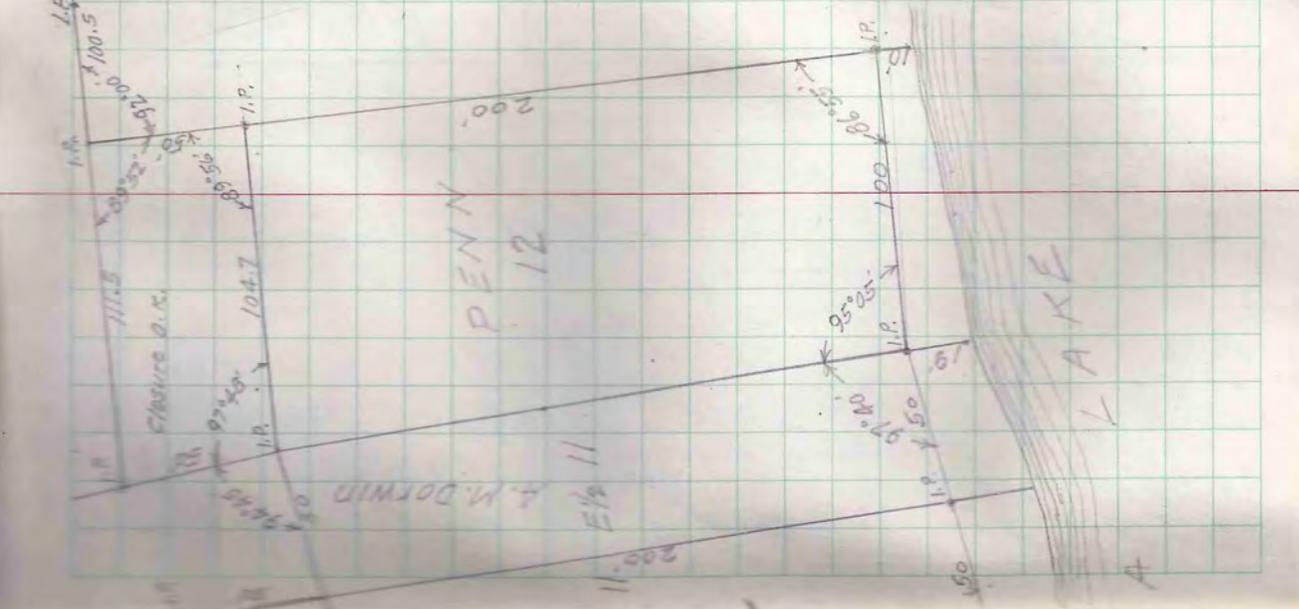

T 38 N - R 6 E - SEC. 19

Finished 12/10/47 (See Page 11)

40.82 N
1.056 E
13 1/8
24 1/9
13.92
5.89° 15' N
41.00 N
12.86 E

Orig. Cor.
Brass Cap
Iron pipe

40.84 (Computed)
20.42

40.61 (Computed)
20.305

Post: iron pipe
Jock Pipe 10"
" 4"

1/8 cor.

N 1° 45' W
14.01

20.42
N 1° 29' W

M.C. South of 1/4 cor.
Found post of 6" B.T. down
Set iron pipe of post.
Marked W.P. 24" NW 16.2'

Old Stamps No marks
NW - 10.6 O.B.T.?
SW - 15.0
00
00

W 1/4 cor.

No post found
Set iron pipe from facings
W.P. 14" N 1/2 W 14.5'
Y.P. 16" S 23° W 25.0'

14.11

5.88° 19' W

14.104 E
1/8 cor.

90°
90°
90°
Post: iron pipe
Y.P. 8" NW 43.9'
" 8" NW 43.9'

19.75

33.86

89° 32'

99.5 N
33.82 E

1/8 cor.

Post: iron pipe in fence line
No B.T.s

20.145
N 2° 09' W

ROAD 20.145

77.4 W 61.8
99° W 27.0

5.88° 47' W
19.62

1/8 cor.
41.128 N
33.039 E

Post: iron pipe

Post: iron pipe in fence line
Jock pipe 7" S 75° W 36.7'
" " 6" N 48° W 37.4'

41.26 N
33.118 E

1/8 cor.
Post: iron pipe in fence cor.
Jock pipe 5" S 75° W 12.6'

Interloc.
Interloc.
Interloc.
sec p

No. pos
From
W
A


N.W. 1/4

T39N-R6E SEC. 4


1/4 Cor. For Noble M. Coe

Dec. 12 1897

Town Line

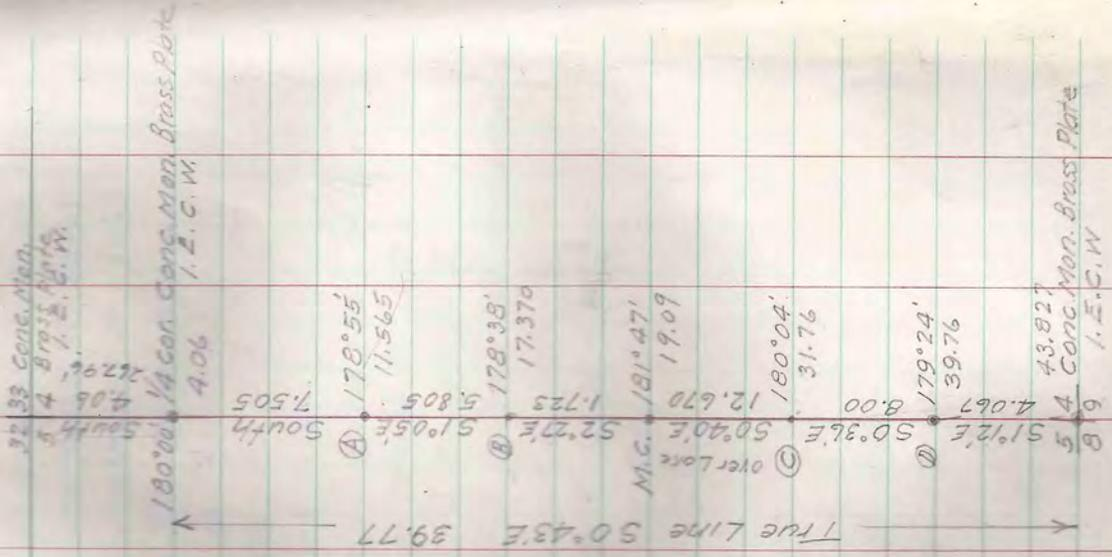

INDIAN RESERVATION LAND

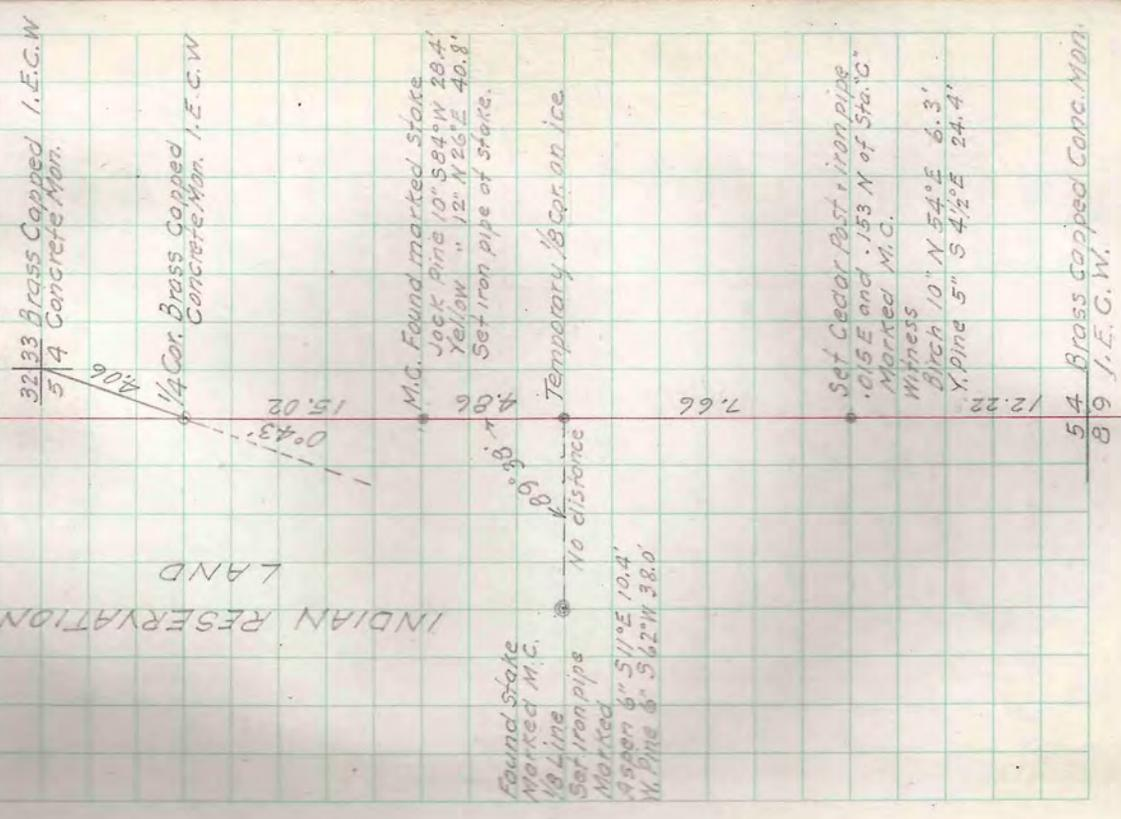

Belknap

T 39 N - R 7 E SEC. 18

Far Dr. Elston L. Belknap
#231 N. Wis. Ave. Milk. Wis.

To locate Govt Lot 5 & SW-SW

Dec. 19-27
 E 1/4 Cor. Post by H.C. Hall in swamp.
 Original tamarack 539°E .85
 White Pine 14" 520°E 1.27 (Hall)
 Norway Pine 12" 572°E 1.19 (")
 Random West with Staff compass & tape.
 20.00 Fell .46 N of B.F. Dorr's 1/8 cor.
 His X Pine 566°W .28 O.K. facing closed.
 Exposed facing. Markings plain.
 Set new post in old post hole and iron pipe.

Dec. 20
 New B.T.s Norway 18" N67°E 21.7
 Dorr's B.T. " 19" S64°W 18.5'
 Thence West random with staff
 compass and tape Var. 1°30'W


20.00 Fell .64 N of Dorr's center 1/4 cor.
 His Birch B.T. almost gone, part of 1/4
 visible. His NW 1/4 Pine standing, facing
 closed. Exposed markings. His other
 NW Pine not found.

Set new post and iron pipe from Dorr's B.T.s
 O.B.T. Birch (rotted stb) 50°30'E 22.4'
 O.B.T. NW Pine 18" N64 1/2°W 12.5'
 New Norway 18" East 14.1'

Thence West random Var. 0° with transit
 and tape.
 1986 fell .12 N of 1 1/2" galv. iron pipe .05 N of
 X Pine stump badly axed, no marks visible.
 Believe this to be stump of Dorr's O.B.T. as no
 other of its size near and being 2.00 ch ±
 south of lake shore as per record.

South Line Sec. 18

Jan. 5 48

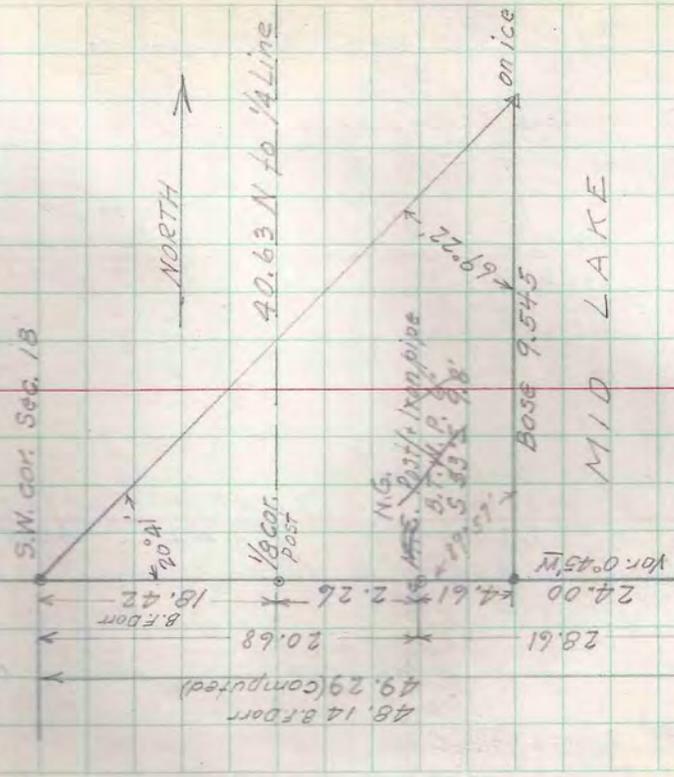

Did not find 2nd M.C.
 Found 3 trees blazed facing central point
 and line blazes East to point 40° NE of
 NE cor. Lot 5 MID LAKE FOREST or 1/8 cor.

T 42 N-R 5 E SEC. 36
Fet Aid Assoc. for Lutherans
Feb 4, 1948

N.W. cor. Found marked post and two
witness trees by Burnette

S 1/4 2" gal. iron pipe & two witness trees

M.C. West of SE cor. 1 1/2" gal. iron pipe No. 873

M.C. North " " Oak & T. No corner.

E 1/4 in road. Two & T's by Burnette (No record)

N.E. cor " " No & T's. (Did not find it)

East M.C. on N line. Wood stake & 2 & T's (Burnette)

East Water " " Iron pipe & & T. stump.

2/5/48 North Line Sec. 36

N.W. cor. Post by Burnette

X.P. 24' N 22° E 106, Y.P. 20' S 70° E 1.03

Random East Var. 0° 45' E

1/201 Sto (A) W shore Alder Lake

At (A) 179° 35' to right

4437 ^{Pign} Wood stake for M.C. (Burnette) E shore

Y.P. N 73° E .36 3/4, Y.P. S 50 1/2° E .44

At M.C. 181° 33' to right

S. 9 1/4" Iron pipe for 1/8 cor. (Burnette)

Y.P. stp. S 51° W -

At 1/8 cor. 176° 00' to right

T 42 N-R 5 E SEC. 36

17

1021 Sto (D)

At (D) 189° 23'

9.60 1/4 Hub (C) At C 180°

.63 1/4 Nail E of road. (C)

P. 79 1/4 Total random distance

Set temporary stakes at 20 + 40 chains
on ice.

Sat Feb. 7 48

East Line Sec. 36

At (C) angle from (D) 83° 00' 72 to N.E. cor.

" " " 262° 30' Var. 1° 45' E

Dist from (C) 19.31 to fence line W

" " " 39.34 " E 1/4 cor as set

from facings of Burnette's & T. stumps. (No record.)

Dist from (C) 41.6575 to Sto (D)

At (D) angle from (C) 180° 04'

Dist from (D) 23.4975 to (E) (M.S. For lands Rd.)

At (E) 223° 34' 12.3650 " (F)

At (E) 223° 31' 2.80 to E. River & bridge

7.2725 to (G)

At (E) 223° 44' 24.00 to (H)

At (H) 183° 34' 8.560 to (I)

At (I) 73° 22' 4.1450 to S 1/4 cor.

S 1/4 cor. 2" Gal. iron pipe yellow

Rotted Birch Stub N 50° E : 40

" Oak " S 20° E : 34

North Line

NE cor - C	S0°20'W	1.717
C - B	N82°30'W	10.234
B - 1/8 cor	S88°07'W	10.207
1/8 - M.C.	N87°53'W	5.96 1/4
M.C. - A	N89°26'W	44.36 1/2
A - M.C.	N89°01'W	5.93 1/4
M.C. - NW cor	N89°01'W	5.06

WEST LINE

NW cor - J	S0°57'W	41.97 1/2
J - W 1/4	N36°45'E	.48
J - K	S0°57'W	39.03 1/4
K - SW cor	E	3.01

East Line

NE cor - C	S0°20'W	.75
C - L	S	19.25
L - E 1/4	S	20.09
E - D	S	2.31 1/4
D - E	S0°04'W	23.49 1/2
E - R	S0°04'W	14.00
R - M.C.	S88°04'W	4.53 1/4

South Line

E - F	S43°39'W	12.36 1/2
F - G	S87°10'W	7.27 1/4
F - H	S87°23'W	24.00 1/4
H - I	N89°02'W	8.560
I - S 1/4 cor	S 15°45'E	4 1/4

E-W 1/4 LINE

L - M	N89°46'W	20.63 1/4
M - 1/8 cor	S82°10'E	.30
M - E 1/8	S0°53'E	20.23 1/2
E 1/8 - N	S89°45'W	12.56 3/4
N - O	S89°49'W	11.58 1/2
O - P	S89°33'W	4.99 1/4
P - Q	S89°35'W	8.59 1/2
Q - Q2	S89°35'W	24.01
Q2 - NW 1/4 cor	N	.04 1/2

ROAD TRAVERSE (Cont'd from P.P)

At B2 from A2	140°24'	N84°35'W	7.60 1/2	C2
" C2	200°54'	N63°41'N	5.47	D2
" D2	220°16'	N23°25'W	6.60 1/2	NW cor
" NW cor to close	24°25'	S1°00'W		K
" "	294°27'	S88°53'E	11°00'	A

T42N - R5E SEC. 36

True Lines				
North Line	N 89° 12' W	20.355	E 1/8 cor.	
"	"	40.84	N 1/4 "	
"	"	61.26	W 1/8 "	
"	"	81.68	NW "	
E-W 1/4 Line	S 89° 13' W	20.320	E 1/8 "	
"	"	40.394	C 1/4 "	
"	"	61.247	W 1/8 "	
"	"	82.10	W 1/4 "	
N-S 1/4 Line	S 0° 37' E	80.34	S 1/4 "	
"	S 0° 37' E	40.83	C 1/4 "	
West Line	S 0° 34' W	41.58	W 1/4 "	
South Line	N 89° 35' W	40.02	S 1/4 "	
East	South	80.06	SE "	
1/8 Line - NE 1/4	N 0° 03' W	20.19	C 1/6 "	
1/8 Line NW 1/4	N 0° 02' W	20.24	E 1/8 - NW line	
1/8 "	N 89° 44' W	20.61	C 1/6	
1/8 "	"	20.64	C 1/6	

T42N - R5E SEC. 36

COORDINATES -

	N	S	W
NE. cor	0	0	0
1/8 E 1/8 on N line	.283		20.353
N 1/4 cor	.570		40.836
A NW "	1.1305		81.6700
M W 1/4 "		40.454	82.080
E 1/4 "		40.057	.006
NW E 1/8 on 1/4 line		40.148	20.326
J C 1/4		40.257	40.398
J S 1/4		79.710	39.979
K NW 1/8 on N line	.8553		61.254
W 1/8 " 1/4 "		40.365	61.252
NE SE. cor		80.060	.020E
C M.C. S Line		80.026	4.577
L E 1/8 "		79.915	20.000
E S 1/8 1/4 "		60.020	40.186
D C 1/16 - SE 1/4		60.030	20.155
E E 1/8 - 1/4 Line		40.148	20.326
R N 1/8 - 1/4 "		19.848	40.609
C 1/16 - NE 1/4		19.957	20.341
C 1/16 - NW 1/4		19.755	61.242

CORNERS

Sat Feb. 14 W.C. (Sta. N offset .016 S)
 2.50 = 49.5 ft East of C 1/4 cor.
 2" x 4" Cedar Post + 1 1/2" I.P.
 Oak. 12' N 13° E 11.6'
 C 1/4 cor. Temporary cor on ice 4.07 E of
 Sta. 0" end offset .03 So.
 W.C. 1.21 East of Sta. 0" end offset 0.02 So.
 2.86 = 189' West of C 1/4 cor.
 2" x 4" Cedar Post and 1 1/4" Iron pipe
 Y.P. 6" S 70° W 12.3'
 W.C. At C 1/4 angle from N 89° 49' E to S 0° 37' E
 true N - S 1/4 line 89° 34'
 9.46 = 624.4 Set 2x4 Cedar Post + I.P.
 B.T. Oak 6' N 73° W 5.3'
 W.C. At C 1/4 89° 34' from S 89° 49' N
 to N 0° 37' W true N - S 1/4 line
 15.985 = 1055 ft
 Set 2x4 Cedar Post + 1 1/4" iron pipe
 B.T. Y.P. 18' S 30° W 37.2'
 1/8 cor. 20.42 N 0° 37' W of C 1/4
 2x4 Cedar Post + 1" iron pipe
 Y.P. 10' N 53° W 41.6'
 Y.P. 12' N 25° E 72.6'

CORNERS (Contd)

N.W. Sec. Cor Post by Burnett. Set 1 1/4" iron pipe
 Y.P. 24" N 22° E 70'
 Y.P. 20" S 70° E 68'
 M.G. Post by Burnett. Set new cedar post and
 3/4" iron pipe W. Pine 40" S 34° W 54.4'
 2 1/4" - 5.06 East of NW. Sec. Cor.
 M.G. 6.275 E of NW. Cor.
 Cedar Post + 3/4" iron pipe
 Aspen 6° S 57° W 5.3' - Aspen 7" N 76° W 5.0'
 M.G. 1.09 South of West 1/8 on N line.
 Cedar Post + 3/4" iron pipe
 Oak 8° S 77° W 15.2' Oak 6" S 3° E 35.9'
 M.G. 8.03 South of N 1/4 cor.
 Cedar Post + iron pipe
 W. Pine 12' S 19° E 3.9'
 M.G. East shore Alder Lake. Did not find
 Burnett's M.C. in stream. The B.T. but no record.
 E 1/8 on N line
 1 1/4" iron pipe X. Pine 5 1/2" N 51° E 4.4 (Burnett)
 N.E. Sec. Cor.
 Both original B.T. stumps. O.K.
 Brass cap reference pipe 20' West.

— CORNERS —

C $\frac{1}{16}$ NW $\frac{1}{4}$ Cedar Post + Iron pipe, No 8.T.
 N $\frac{1}{8}$ on $\frac{1}{4}$ Line Cedar Post + Iron pipe
 Y.Pine 10" N53°W 41.6'
 Y. " 12" N25°E 72.6'
 M.C. 4.66 E of $\frac{1}{8}$ cor. Cedar Post + $\frac{1}{4}$ I.P.
 Y.Pine 12" S62°W 15.7'
 M.C. 4.42 $\frac{1}{2}$ South of $\frac{1}{8}$ cor. Post + I.P.
 Y.Pine 18" S30°W 57.2'
 M.C. 10.75 E of $\frac{1}{8}$ cor and 4.87 W of C $\frac{1}{16}$ cor.
 2" x 4" Post + Iron pipe
 Twin W. Pine 21" N72°E 5.3' (Burnett)
 C $\frac{1}{16}$ in NE $\frac{1}{4}$ Iron pipe in fence cor. No 8.T.s
 W $\frac{1}{8}$ on $\frac{1}{4}$ Line Cedar Post + $\frac{1}{4}$ " Iron pipe
 Birch 10" N40°E 14'
 W.C. 2.86 W of Center $\frac{1}{4}$ cor on ice
 Cedar Post + Iron pipe
 Y.Pine 6" S70°W 12.3'
 W.C. 9.46 S of Center $\frac{1}{4}$ cor on ice
 Cedar Post + Iron pipe
 Oak 6" N73°W 5.3'
 W.C. 7.506 E of Center $\frac{1}{4}$ cor. on ice.
 Cedar Post + Iron pipe
 Oak 12" N13°E 11.6'

CORNERS

C $\frac{1}{16}$ on $\frac{1}{4}$ Line
 1 $\frac{1}{4}$ " I.P. Y.Pine Stp N12°E 13.2' (Burnett)
 New Oak 7" S13°E 29.8'
 " " 6" S75°E 36.8'
 M.C. 7.812 S of $\frac{1}{8}$ cor.
 Cedar Post + $\frac{1}{4}$ " I.P.
 Oak 7" N51°E - 19.4 - Y.Pine 12" S4°E 14.6'
 E $\frac{1}{4}$ Cor. Two 8.T. Stumps by Burnett. No record.
 Lined in 8.T. facings - set temporary point
 in road from which
 Pipe Stp N28°N 64' - Pipe Stp. S89°W 33'
 Set Cedar Post + I.P. S89°43'W on $\frac{1}{4}$ line 25'
 S $\frac{1}{8}$ on $\frac{1}{4}$ Line Cedar Post + I.P.
 Oak 6" S12°E 16.8' Oak 6" S72°W 12.0'
 M.C. 15.69 E of $\frac{1}{8}$ cor. and 4.34 W of C $\frac{1}{16}$ on ice
 Cedar Post + $\frac{3}{4}$ " I.P.
 Oak 8" N5°E 27.8' Oak 4" N67°E 3.5'
 M.C. 3.534 S of C $\frac{1}{16}$ in SE $\frac{1}{4}$ on ice.
 Cedar Post + $\frac{1}{2}$ " Well point - Oak 6" S76°E 33.3'
 M.C. 4.37 S of C $\frac{1}{16}$ in SE $\frac{1}{4}$ on ice.
 Cedar Post + $\frac{1}{4}$ " I.P.
 Y.Pine 12" S50°W - 23.7'

CORNERS -

M.C. 9.437 E of C 1/16 in SE 1/4
 Cedar Post + 1 1/4" I.P.
 Oak 6" N 28° E 53.6 - Oak 8" N 21° W - 47.7'
 S 1/8 on East Sec. Line
 Cedar Post + 1 1/2" I.P. 25' W of Cor. in road

S 1/4 Cor. Found 2" Oak I.P.
 Birch Stub. N 50° E 26.4'
 Oak " S 20° E 22.4'
 E 1/8 on S line

Cedar Post + I.P.
 Maple 6" S 12° W 5.3' Oak 6" N 15° W 28.1

M.C. (34) 1.81 E of 1/8 Cor.
 Cedar Post + I.P.
 Oak 6" S 46° E 12.2' Oak 6" N 5° W 47.6'
 Cedar Post + I.P.
 Oak 10" S 52° W - 6.7'

M.C. (36) 4.60 W of Twp. Cor.
 1 1/2" I.P. U.S. Govt Indian Res. Survey
 No B.T.s

Field Survey finished Sun. Feb. 22 '48
 Computing + mopping 4 days 70 days

TAIN-R3E SEC. 5

At KK	from JJ	144°35'	8.577	to LL
" LL	" KK	191°35'	2.564	" MM
" MM	" LL	189°07'	6.935	" L
" L	" MM	233°22'	to close	" G
Magnetic N 64°00' W				
Computed N 64°05' W				
Total of 20 angles 3959°59' Error 0°01'				
Fri. 4/2 -				
At L	from G	154°40'	32.58	theoretical
E 1/4 cor. Searched area for 0.8.75				
Stumps under ice & water.				
--- Stadia ---				
At D	from E	98°45'	225'	= 3.40
		69°45'	335'	= 5.07
		57°40'	347'	= 5.25
		42°00'	345'	= 5.23
		26°10'	325'	= 4.92
		14°15'	340'	= 5.15
		0°0'	396'	= 6.00
--- LEVELS ---				
B.M. of Sta AA High Water mark Elev. 1572.3				
Rod .87 H.I. 1573.17 -				
Rod 11.57 on Lake ice Elev. 1561.6				

see left


TAIN-R3E - SEC. 5 (contd.)

At X	from W	127°33'	3.230	to Y
" Y	" X	163°59'	2.085	" Z
" Z	" Y	98°00'	4.73	Lake shore
" AA	" Z	190°13'	3.805	AA
" BB	" AA	123°55'	3.70	Lake shore
" CC	" BB	165°15'	4.725	BB
" DD	" CC	86°00'	2.92	Lake shore
" EE	" DD	183°00'	1.36	lake point
" FF	" EE	164°00'	4.39	lake point
" GG	" FF	190°25'	1.59	lake point
" HH	" GG	214°00'	.75	lake point
" II	" HH	319°00'	.75	lake point
" JJ	" II	102°00'	1.10	Lake shore
" KK	" JJ	210°06'	2.096	CC
" LL	" KK	256°05'	1.140	DD
" MM	" LL	158°44'	5.135	EE
" NN	" MM	200°31'	2.50	90°-200E
" OO	" NN	200°31'	3.817	FF
" PP	" OO	90°00'	1.70	over bay
" QQ	" PP	207°24'	2.31	GG
" RR	" QQ	121°30'	5.83	Lake shore
" SS	" RR	246°25'	1.20 1/4	to HH
" TT	" SS	209°25'	10.505	to II
" UU	" TT	222°24'	2.175	" JJ
" VV	" UU	213°54'	2.434	" KK

(See Loose Leaf Binder for Coordinates)

David Carlson

T 39N-R5E SEC. 13 Lot 9
For David W. Carlson
109+6 Ave M*
Chicago 17 Ill.
Tel. Saginaw 0855

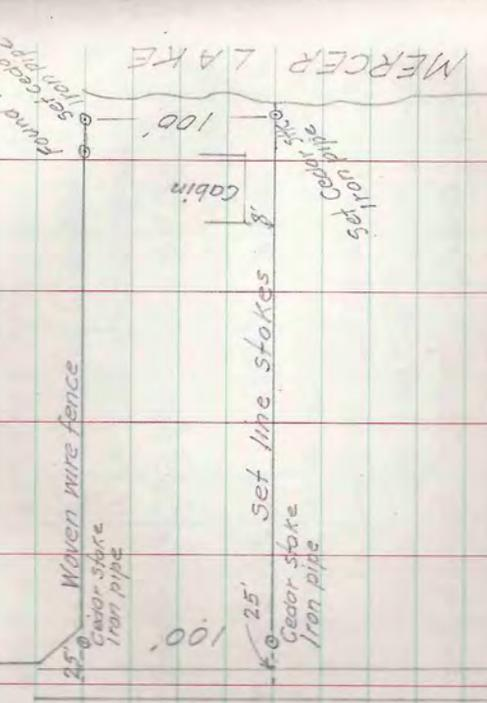

Deed description:
 Begin 750' N of SW cor Sec 13
 T39N-R5E. Thence due East to
 Mercer Lake. Thence Nly along
 lake 100'. Thence due W to Sec.
 line to point 100' N. of P.O.B.
 Thence S to P.O.B.

14. 13
 23 | 24
 Found iron pipe in E of road
 Set reference stakes 20'E & 20'W
 Marked Oak 7" & 1 1/2" W 47.6'


T 39N-R5E SEC. 2

To divide lake shore of Govt Lots 2-3-4
 into parcels.
 For Aid Assn for Lutherans Appleton Wis.
 Began Tues. April 13, 1948

I.P.	M.C. on North line of Evensons Plot							
AA	592' E set Sta A							
AA	222' E 2" iron pipe at N.E. cor of Plot							
AA	325' E Sta "B"							
AA	Ⓐ from M.C. 92°16'	200.0	Sta. "C"					
"	C " A 200°50'	161.0		D				
"	D " C 185°49'	300.0		E				
"	E " D 164°38'	300.0		F				
"	F " E 170°38'	244.4		G				
"	G " F 172°49'	274.5		H				

See Traverse Computation:
 sheets in ring binder

T42N-R7E SEC. 31 LOT 1
For R.E. Johnston Box 91 Boulder Jct.
May 5 '48

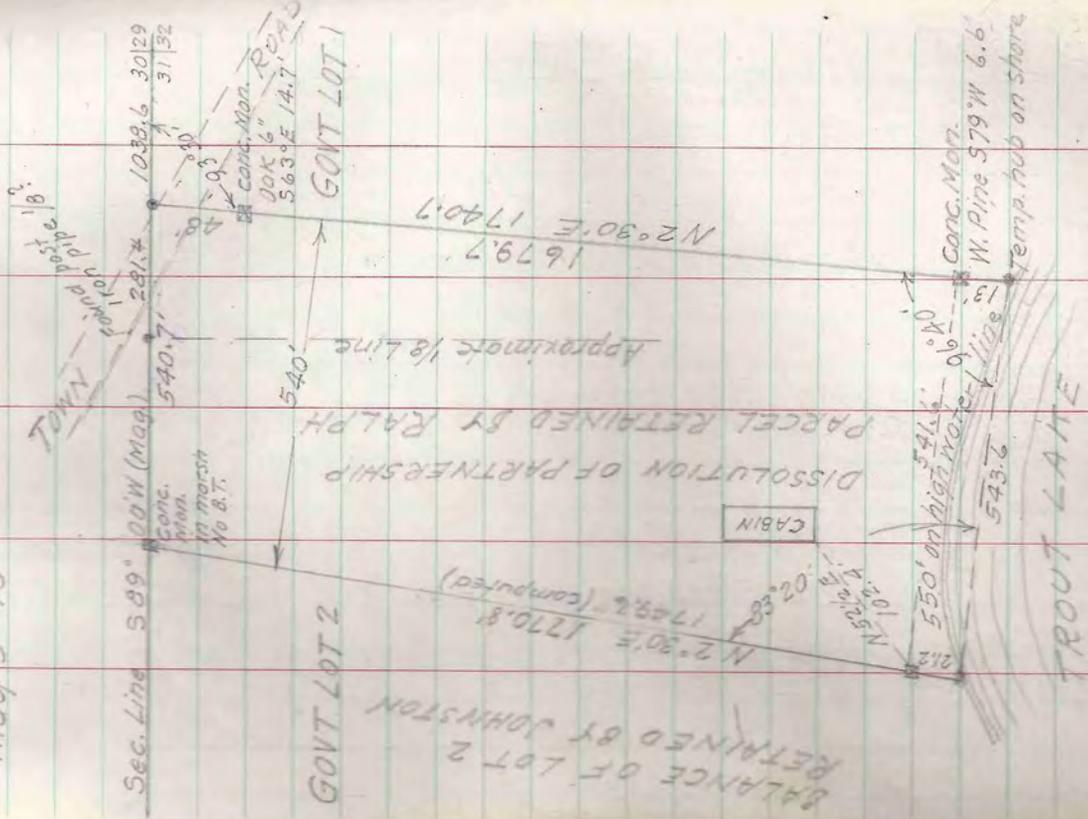

J.G. Ralph
844 E. Washington Ave (Business)
602 Wingra St. (Home)
Madison Wis.


5501 544.6 1400.0
 5501 2166400 13944
 7610
 5164
 2450
 2170

541.6
 344.0
 147.6

38.7
 0.0
 13.0
 1.0
 51.1

R.E. Johnston


T 39 N - R 6 E SEC 20 & 21
 For Ivan Branham Mariagva Wis
 To locate true line between Sec 20 & 21
 and to set 1/8 cor. 1/4 cor and M.C.
 on N shore of Bobcat Lake.
 May 7 18 48

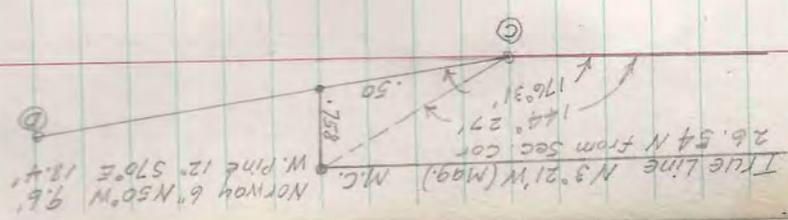

CO-ORDINATES

	NORTH	EAST	WEST
A	N 0° 47' W	5.20	5.199
B	N 0° 47' E	3.20	3.199
C	N 2° 27' E	17.645	17.55
D	N 1° 02' W	13.44	13.337
C to M.C.	N 33° 06' W	.913	.500
1/4 cor			.767
26.54			40.99
.039			.066
			.100

Marked Stake (Holl)
 20 21 Cor. Mark.
 29 28 Iron bar.
 Dgl. Pine Stk N 66° E 1.66
 New X.P. 20° S 26° E 1.066
 " W.P. 28° N 28 1/2° E 1.52

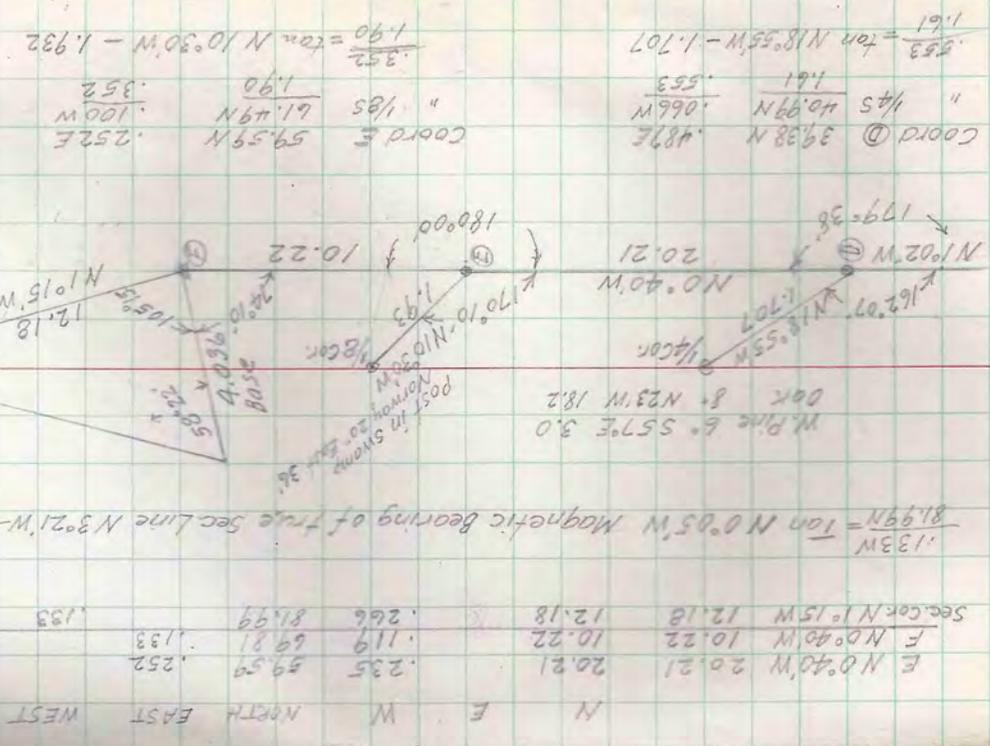

COORD @ 39.38 N .487 E
 " 1/4 S 40.99 N .066 W
 " 1.61
 = tan N 18° 55' W - 1.707
 1.61

COORD E 59.59 N .252 E
 " 1/8 S 61.49 N .100 W
 " 1.90
 = tan N 10° 30' W - 1.932
 1.90

Wet marsh

Wm Weibacker

T 40N-R6E SEC 35 LOT 4

For Wm Weibacker Woodruff Wis.
May 11 '48 Box 21

Began at NW cor Sec 35 Conc. Mpn.
W.P. Stump very old, moss covered and
burned, facing out no marks
S 18° W 7 1/2 kts. Original ?

Jack Pine 18" S 79° W .26 marked S 34
Random South Var 0° 50' E

17.834 Hub A
At A 159° 08' 1.69 to Conc. Men. ^{1/85} ~~At C~~

N.W. cor. random East Var 0° 50' E
angle from South random 90° 01'
20.04 Fell .0575 N of 1" iron rod
from which Aspen 6" S 17° W .23

20.6025 Hub B at W edge of road.
32.00 " C
40.535 " D


At D from C 55° 44' left .905 to arboval
from which Oct 7" N 37° W .375
and X Pine 14" N .19
Both about 20 yrs. old. 1/4 cor. ?

52.535 Hub E

T 40N-R6E SEC 35 LOT 4


Set West M.C. From stumps of original
trees. NW stump marks plain bears N 38° W
dist 18 kts. SW stump S 5° W dist 19 kts.
Point falls in line with fence west end of
Waters edge. Set plain stake.

At E from D 190° 15' 1.53 1/4 to M.C.
At M.C. " E 170° 58' over lake to F

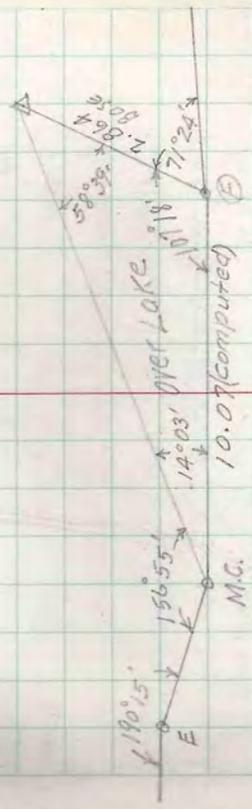

At F from west M.C.	178° 42'	3.388	to G
At G " " F	179° 30'	10.00	" H
At H " " G	171° 58'	3.782	" NE. Sec Cor.
At Sec Cor. " " H	180° 00'	.215	" E
" I " " H	277° 01'	4.972	" J
" J " " I	181° 06 1/2	27.357	" K
" K " " J	203° 24 1/2	8.407	" L
" L From K	92° 18'	27.99	" M
" " " L		1.95	M.C. 1/4 L.O.

T40N-R6E SEC. 35

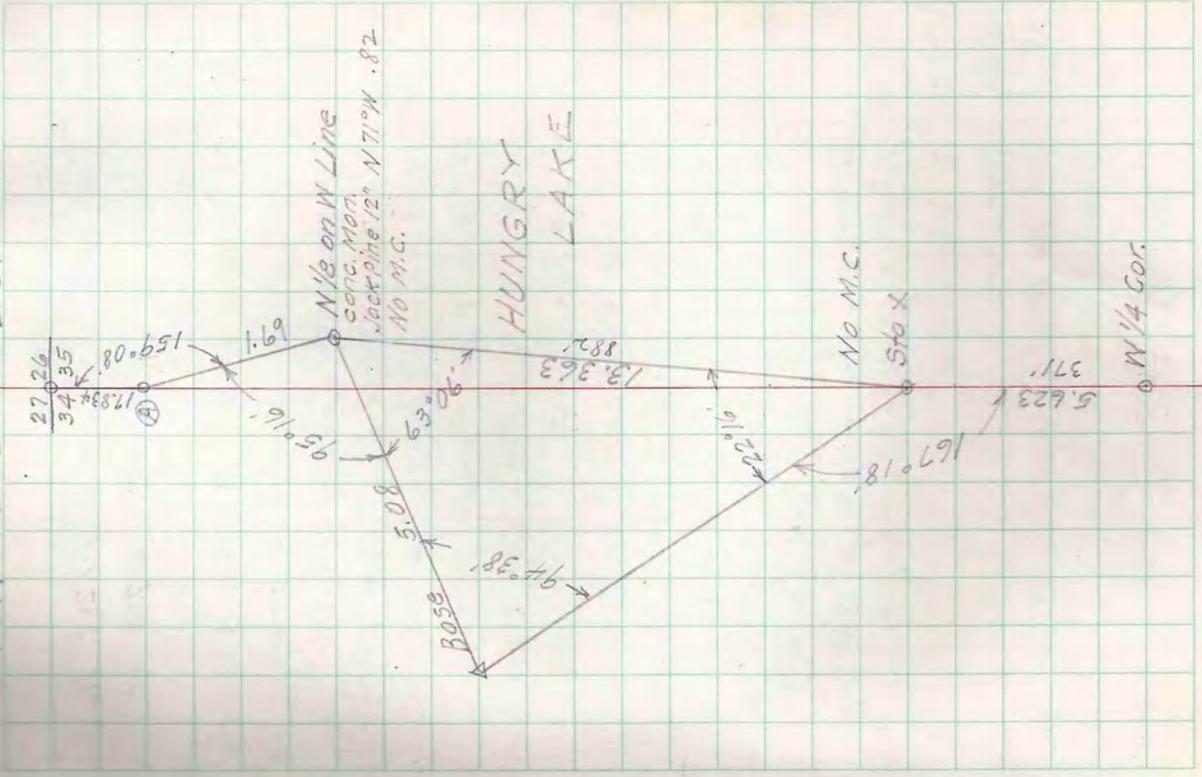

T40N-R6E SEC. 35

		(Comp)	No. M.C.
So. M.C. From SW Cor.	179°52'	10.248	No. M.C.
No. M.C. " So. M.C. in driveway	180°29'	2.755	I.P. (V)
	So. side Highway #47		
At U From No. M.C.	186°31'	6.206	(V)
" V " U	171°31'	6.000	
" W	180°00'	4.000	W
" W	180°00'	5.977	W
" W	179°55'	6.598	W 1/4 Cor.
Sat. May 15 '48		38.784	
W 1/4 Cor. Conc. Mon. (Warner?) from which			
W. Pine Stump (No marks) 5.58' W 12 1/2 (Orig.)			
Roots of Birch 5.64' E 24 1/2 (Orig.)			
Jack Pine Stump marked B.T. N 19° W 2.5 1/2			
At 1/4 Cor. from W	175°20'	5.632	to X
At X " 1/4 Cor.	189°34'	13.363	Conc. Mon. 1/8 S
Did not find Orig. M.C.			
N 1/8 on West Line Conc. Mon. (Warner?)			
from which Jack Pine 12" marked 185			
about 20-25 yrs ago. N 71° W .82 = 54.1'			
Did not find Orig. M.C.			
At 1/8 Cor. from X	158°22'	1.69	Sta A
At A " 1/8 Cor.	200°52'	17.834	NW Cor.

Wellbocker

T40N-R6E SEC. 35 LOT 4

Thurs. May 20 '48

M.C. Set East M.C. on N Sec. line

Drove 1/4" x 36" steel fence post at Waters edge from which

Orig. W.R. Stump B.T. plain S47°E 31.6' ok

" W.P. " " N60°E 39.6' ok.

New X-pine 16" N74°E 38.3'

" Oak 7" S 27°E 43.3'

M.C. West M.C. on N line

Set steel fence post at waters edge from which Og. Tam. B.T. plain N88°W 12.0'

Og. Tam. Monmarks S3°W 12.6'


New Tam. 4" S35°W 22.0'

Double Oak 12" S82°W 53.0'

Set steel fence post on true East line of Govt Lot 4 by offset of .005 E from random Sta. 2.97 N of C 1/6 SW 1/4 into line with conc. Mon. found on E-W 1/4 line

Set steel fence post at lake shore 7.92 N of C 1/6 in SW 1/4 by offset of .014 E of random into true line as above.

T40N-R6E SEC. 35 LOT 4

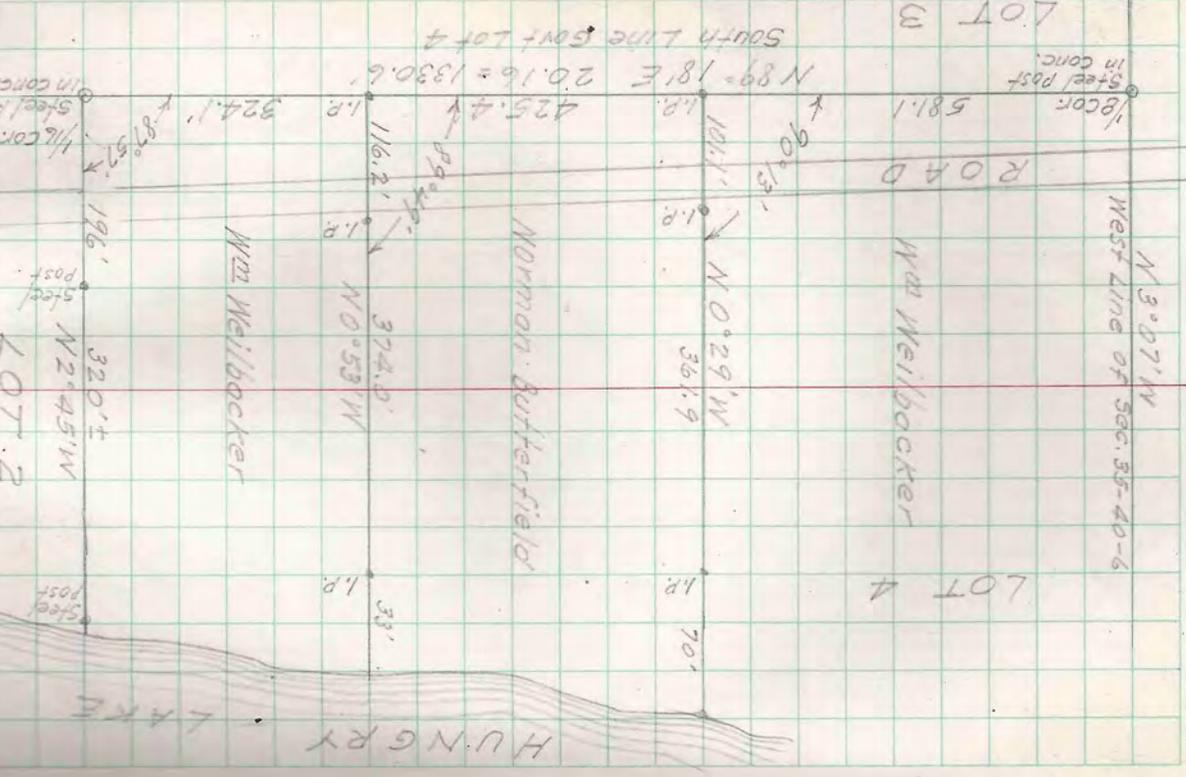

M/M. Wis (Grantor) and Mr. Stuth (Grantee) May 25, 24

6 MILL ST. M.C.
Vol. 102-116 193
198'

Albert. Mykleby Property
Lumber Co. Vol. 58 p. 76 12/4/25
Office

363.5'
218.5'
21'
conc.

CONVEYANCE
Reich
to
Stuth

785.5'
103° 22'
95'
11° P.
108°
17° W
456'

ARBOR VITAE LAKE
5'
11° P.
Fence
168' W
177'
conc.

conc. Mon
C.W. Fisher 152.5'

228'

98°

129'

conc.

75°

30' to Highway

Power pole N 24' & Highway 17'

LINE follows S bank of creek

T40N-R7E SEC 30 LOT 3
For Art Reich 20448 N 12th St.

Highway 70 122' ± 1/4 538' ±

Town Road

Art Reich
Stuth

Geo. Boehm
5124 N. National Ave
Minn

T 38N-R6E SEC. 22

For Geo. Boehm Hazelhurst Wis
To set 1/4 cor. between 22 & 23
and both N 1/2 and S 1/2 corners.
May 26 From SE cor. Sec 22 brushed West
to Hinway 51. Set hubs along Hinway
N to Hinway Y and E to temp 1/4 cor
continued N on Hinway 70 to N line
and E to NE cor.

May 27 TRAVERSE

SE. cor. Sec. 22 - West (Var. 1°30'E)	537.1	570.1	
At A from Sec. Cor.	179°06'	191.0	" B
At B "	180°26'	243.4	Hinway 51 " C
At C "	278°29'	2880.1	D Hinway Y
At D "	180°00'	2484.7	E
At E "	265°18'	248.0	NE Sec Cor.
At D " E	78°40'	433.3	F
At F " D	237°29'	133.6	G
At G " F	190°52'	137.6	Temp 1/4 cor.

T 38N-R6E SEC. 22

SE. cor. A	588°30'W	537.1	14.059'	536.915'	190.832'	243.257'
A - B	587°36'W	191.0	7998.1			
B - C	588°02'W	243.4	8.352'			
C - D	N 6°31'E	2880.1	2861.492'	326.870'		
D - E	N 6°31'E	2484.7	2468.642'	281.992'		
E - NE. cor.	588°11'E	248.0	7.862'	247.875'		
D - F	N 85°11'E	433.3	36.408'	432.069'		
F - G	537°20'E	133.6	106.228'	81.022'		
G - Temp 1/4	526°28'E	137.6	123.178'	61.325'		
COORDINATES - N						
SE. cor.	0	0	0	0	0	0
NE. cor.	5291.86'	114.27'	114.27'	5293.1	114.27'	114.27'
Temp 1/4 cor. (G)	2638.08'	69.72'	69.72'	2646.5	69.72'	69.72'
True 1/4 "	2645.93	57.13	57.13	2646.5	57.13	57.13
Sto. D	2831.08	644.13	644.13	2831.08	644.13	644.13
G	2761.26	131.04	131.04	2761.26	131.04	131.04
TRUE LINES						
SE. cor. NE. cor. N 1/4 W - 5293.1						
SE. cor. - 1/4 cor. N 1/4 W - 2646.5						

T 38N-R 6E SEC. 22

E 1/4 cor. Orig. trees not identified
To set 1/4 cor. on true line between
Sec. corners and at mid distance.

Coord NE cor. 5291.86N 114.27W
" True 1/4 cor. 2645.93N 57.13W
" Temp 1/4 " 2638.08N 69.72W

$2645.93 - 2638.08 = \tan 58^{\circ}03'$
 $69.72 - 57.13$

Temp 1/4 to True 1/4 N 58°03'E - 14.84'
May 28, Set true 1/4 cor. from temp. 1/4 cor
angle from (G) 84°31' to N 58°03'E - 14.84'

Set cedar stake and marked

Wh. Pine 13" 55°E 14.1'

Wh. Pine 10" N 77°E 9.0'

Thence West (Var 1°45'E)

1320 ft and set plain stake

At G from F 184°42' 137.2 True 1/4 cor.

At 1/4 cor. 31°24' to N 1°14'W (true line)

327' Enter Swamp U.S. Govt dist 363'

650' to pond, west end " " 643'

935' Leave swamp " " 924'

950' Distance marker

May 29

From 950' N - 9' N to hub 959' N

Tree on line



1323.5 set cedar post for N 1/8 bet N 22.1 23

B.T. Wh. Pine 6" S 1/5°E 9.4'

At 1/4 cor. between 22.1 23 211°24' from (G)

to true Sec. line S 1°14'E

600 feet set plain stake for S.E. cor.

Hansen property.


2 days

1/20/25
 1/20/25
 1/20/25

T40N-R8E SEC 25

To establish N line of SE-SW 1/4 and line parallel thereto as of Circuit Court and to conform with description as corrected by the court and newly recorded by the Register of Deeds.
 Cruised entire SW 1/4
 Found SW Sec cor. O.K.
 " S 1/8 on W line. Marked post. I.B.T.
 " Ogl. 1/4 cor. O.K.
 " 1/8 cor. E of 1/4 is Conc. Mon. No. 8.T.?
 " 1/16 of NW 1/4 Conc. Mon. I.B.T. 15 yrs. old
 " 1/16 of SW 1/4 Plain Stake of 1 1/2" off So of 1/4 line. ?

Did not find W 1/8 on So line
 " " " S 1/4 cor.

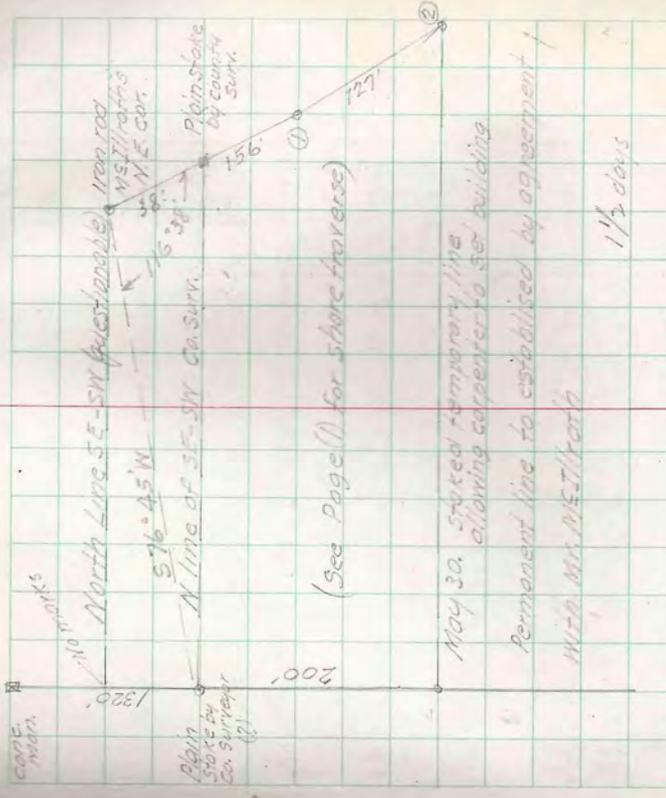

May 30. Spaced temporary line allowing carpenter to set building. Permanent line to established by agreement with Mr. WEST/forth 1 1/2 days


MS Uliath Seaca

W.D. Vol 59-99 7/4/27 Beg on Mon Lake at southwest 1/4 So. 1/8 line of Sec 25. 2 1/2 W on 1/8 line 225'
 2 1/2 S on 90° 100'. 2 1/2 down E 225' 2 1/2 NW to P.O.B.
 W.D. Vol. 64 P171 6/2/1928.
 Beg on Mon Lake 100' SE by from 1/8 line. 2 1/2 W per with 1/8 line 200' to narrow road. N+S.
 2 1/2 S by 90° 100'. 2 1/2 E by 90° 200' to shore of lake. 2 1/2 NW to P.O.B.

T40N-R10E Sec. 13

June 3, 49 For Richard Freberg
 3043 N. Hamilton Chicago Ill.
 To locate boundaries of Lot 10 and line
 N from point on Scattering Rice Lake
 125 NEly from M.C. on So. Sec. line
 From Conc. Men. (Book V Pg 75) of South
 1/8 Cor. on W line - Random E var 2° E
 old post rotated down.
 18.85 fell 1.60 N of Conc. Men. from which
 S.T. W.P. Stp.


June 4 Corrected west line Sec 13 from SW cor
 N to 1/8 cor.
 From 1/8 cor corrected line E (No distance)
 angle from random 4° 51' to 587° 36' E
 set line stakes and projected line
 587° 36' E 100 ft and set plain post.
 Thence Magnetic S 4° 30' E
 Not measured, set line stakes to lake.
 Line fell .06 W of post 125 ft Ely
 of M.C. as set Sept 1947 (Book V-P 75)

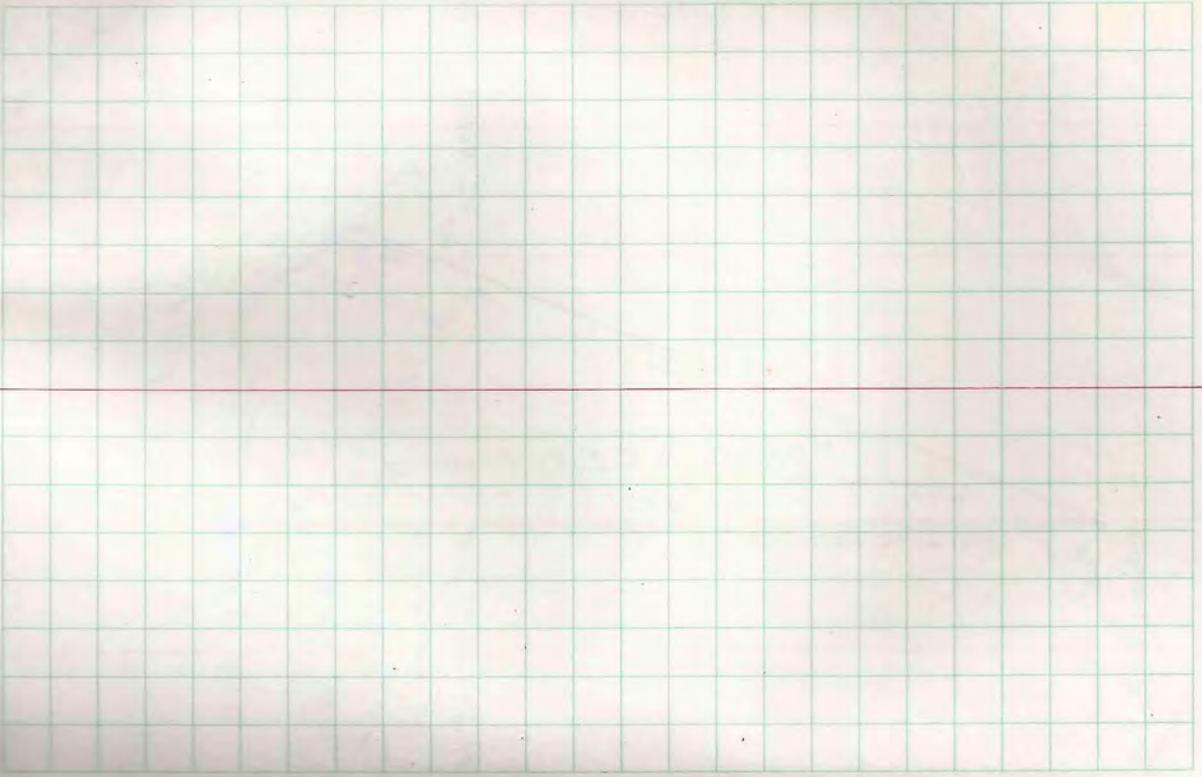

Cor. Sec. 17-18-19-20
 Marked post down. Reset it.
 019. Y. Pine 9" S48W - 43 marks plain
 " W. Pine 24" N55E - 6 No marks (burned)


East M.C. New post and iron pipe
 Original Y. Pine N55°E 24"
 New Oak 7" S62 1/2°E 41 1/4"

W. R. topped stump. No marks
 New Maple 7"
 Oak 4 1/2"
 Maple 6" S47°W -
 8" N24°W -

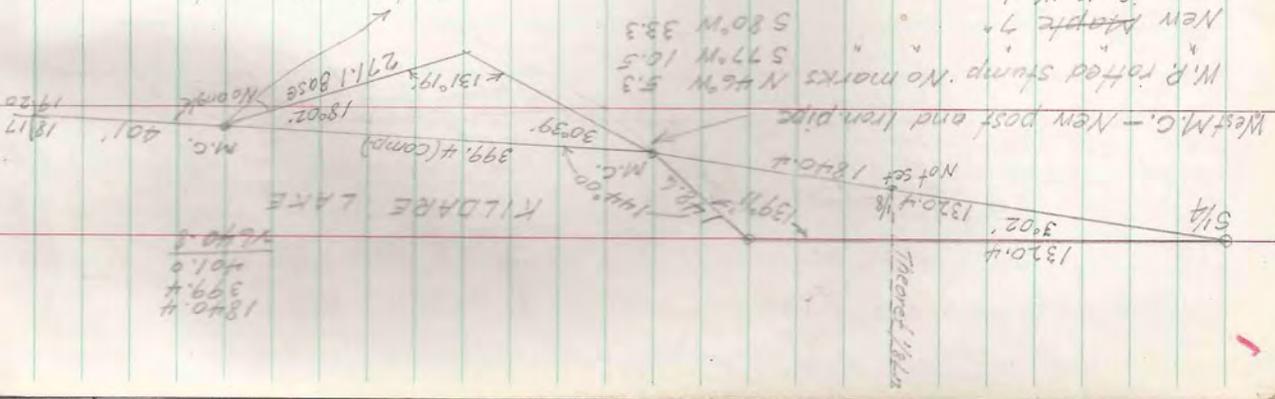

1840.4
 399.4
 401.0
 1640.5


C.E. Rolfsen
Waterford, Wis
June 23, 48
T 40N-R5E SEC. 33 LOT 1

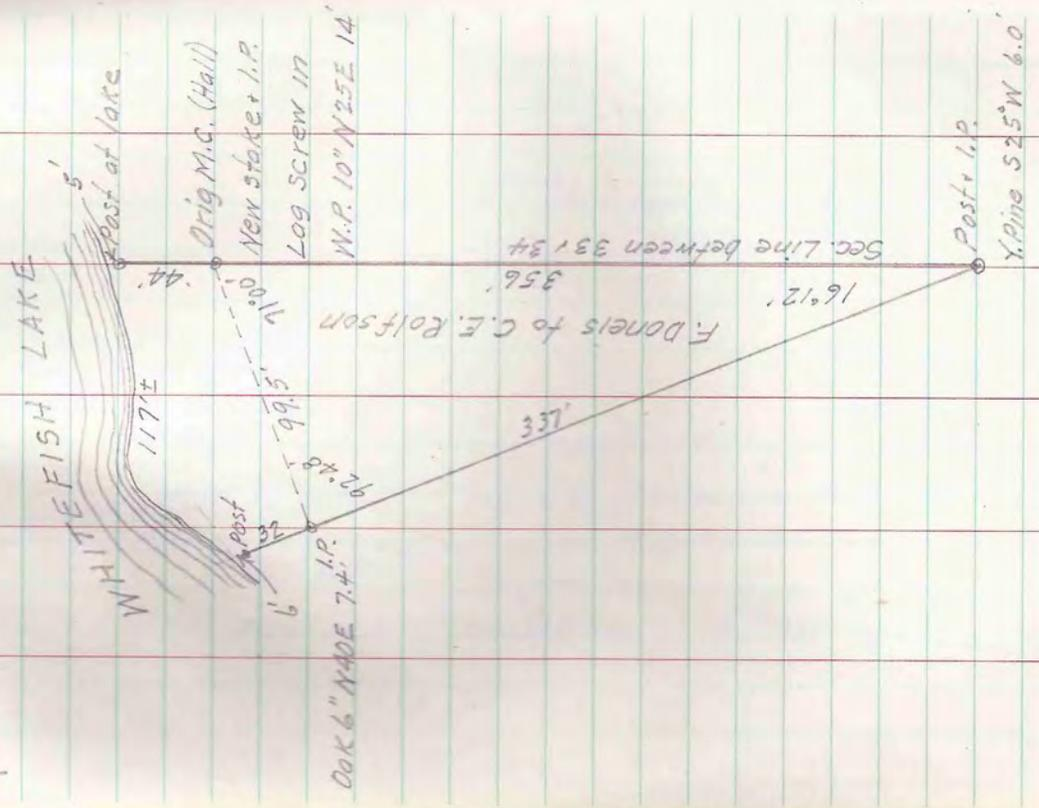

739N-RGE SEC. 35

June 24 48

A.C. Rosoren
Mingo, Ia.

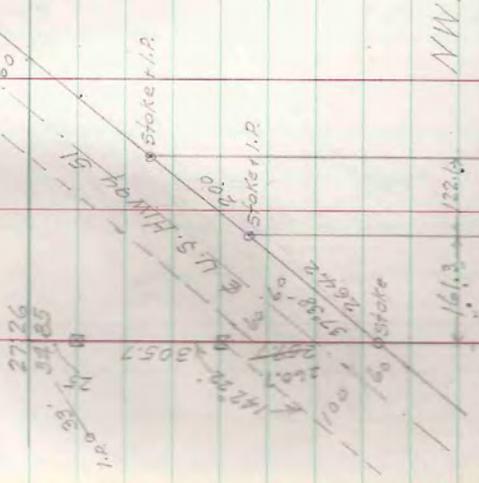

NW 1/4 - NW 1/4

West Line Sec 35

No distance


No distance

1/8 Line


T 40N-R4E SEC. 22 LOT 2

June 25-26-28 '48


A.H. Neffel

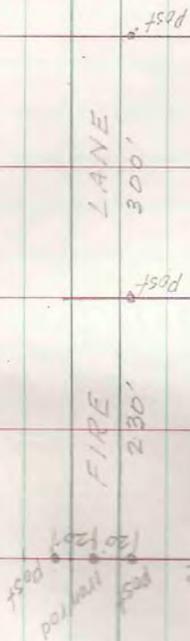


North Line Lot 2
 1167 to 1/85
 120' post
 120' Improved
 120' post

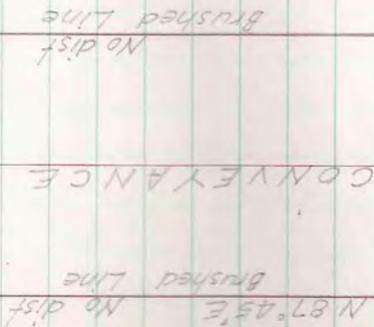


115' hand
 N 87° 45' E (Mag)
 P.R. W.R. Str.
 235.7

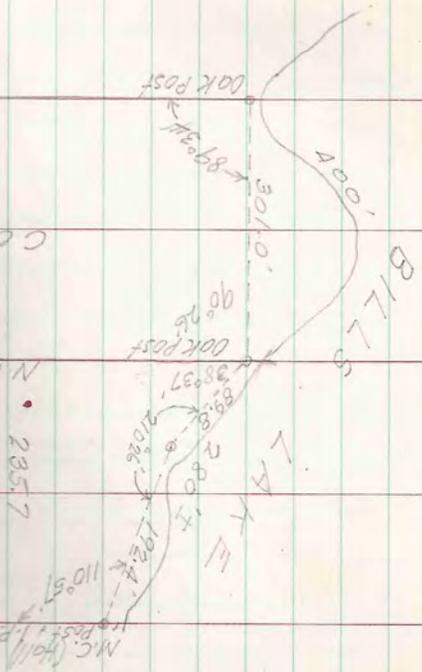


M.C. (Hall)
 110.5' post

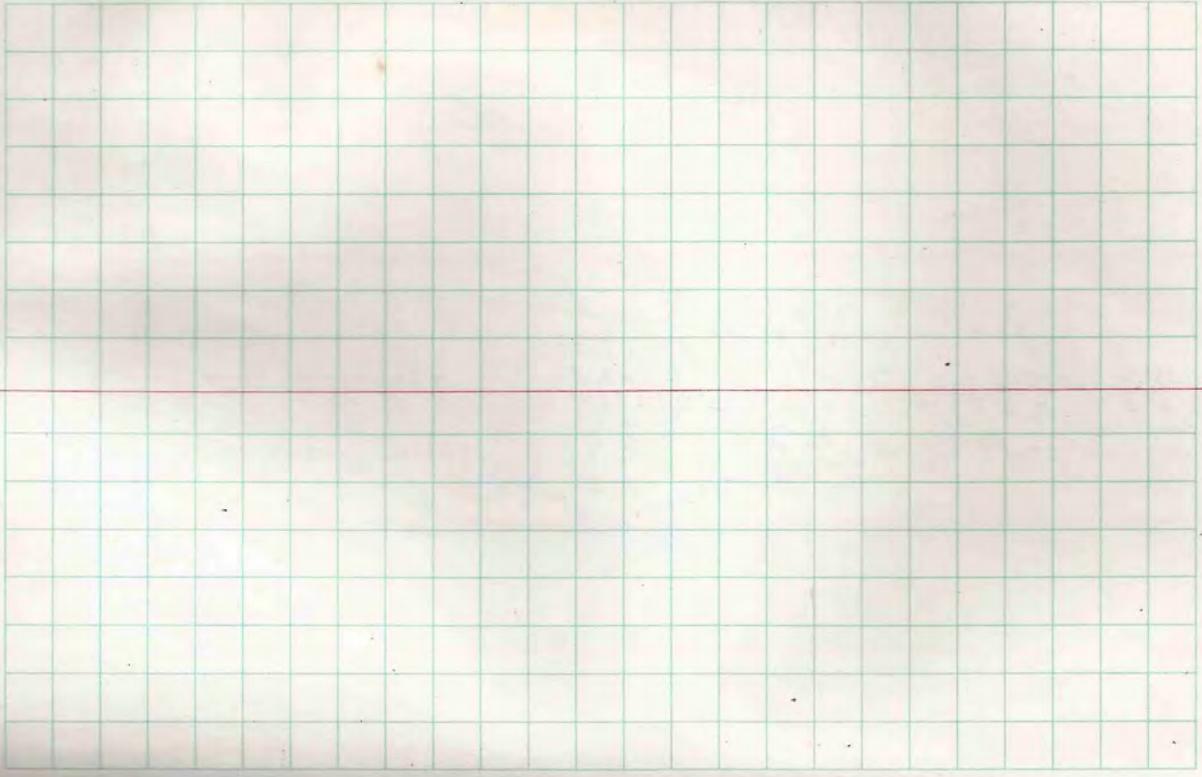

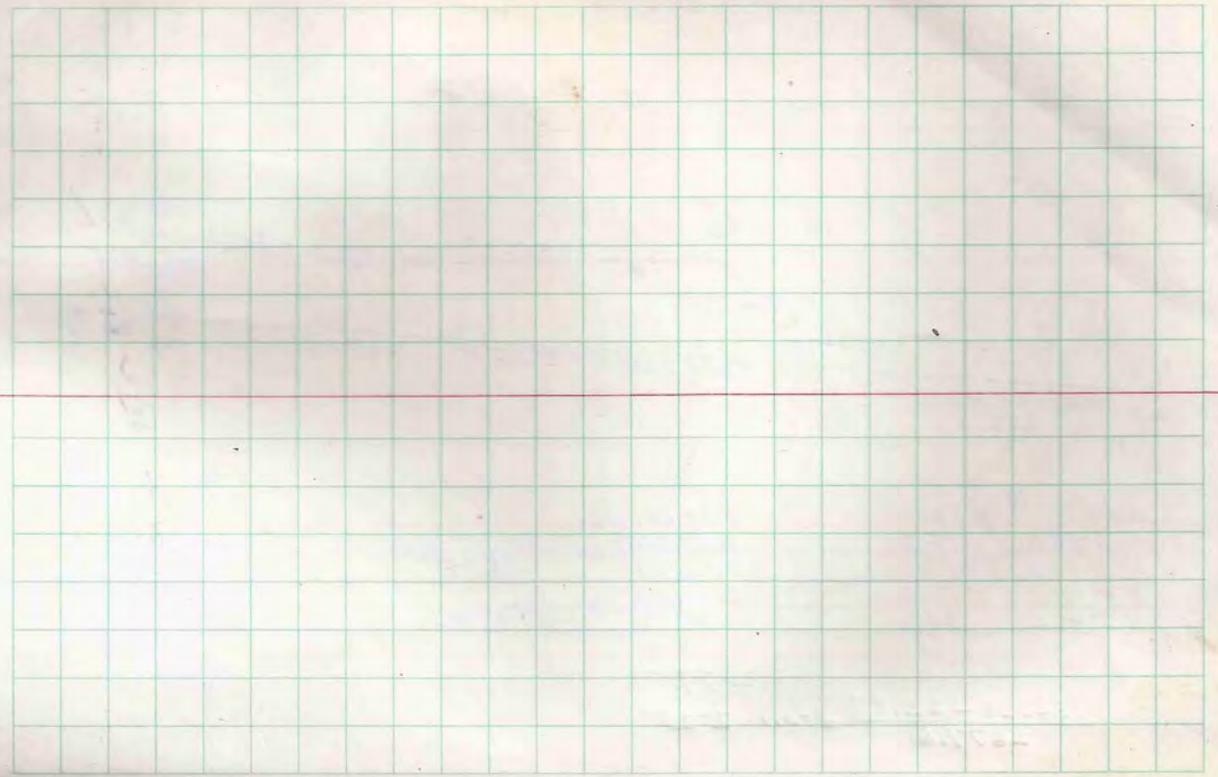

Center 1/4 cor. Set by D.H. Vaughan 1914
 Found rotted post, no marks.
 Set new cedar post with pipe in stake hole.
 D.H.V. Y.P. 5'p. no marks 5' 8'w - 1.3'w
 New oak 5' " Marks plain W38W - 1.3'w
 S30W - 2.4'w
 W31E - 1.5'w

W 1/4 cor. 1 1/2" pipe
 did marked post was down in 1943
 and set 20' N of I.P.
 Y.P. Stump N11°E 43.6' (1943)

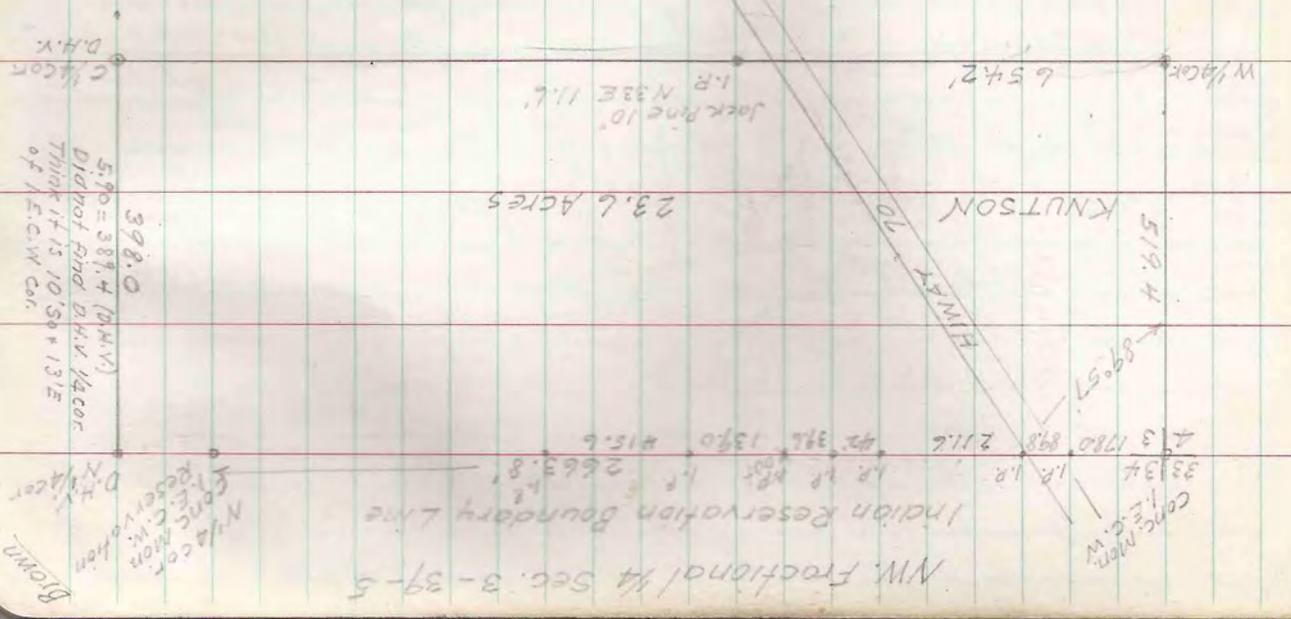

Brown
 NW 1/4 cor.
 Conc. Mon.
 E.C.M.
 Res. Mon.
 D.H.V. 1/4 cor.

NW. Fractional 1/4 Sec. 3-39-5
 Indian Reservation Boundary Line

Conc. Mon.
 E.C.M.

23.6 Acres

KNUTSON

W 1/4 cor. 6 5/4 2'

Jack Pine 10'
 I.P. N33E 11.6'

519.4

89° 57'


I.P. 1.3 1780 898 211.6
 I.P. 1.3 1780 898 211.6
 I.P. 1.3 1780 898 211.6

I.P. 1.3 1780 898 211.6
 I.P. 1.3 1780 898 211.6
 I.P. 1.3 1780 898 211.6

	N	S	E	W
A	5 84°15' E	6.995	7008	6.950
B	N 86°45' E	4.505	755	4.498
C	N 83°37' E	3.827	425	3.803
D	S 89°23' E	4.677	0500	4.677
1/8 S N 52°03' W	-110	066	19.938	088
			19.938	088
			19.938 - 088 = East = 19.85	
			(D.H.V. 19.85) (B.E.D. 19.85)	
E	S 52°03' E	110	066	088
F	S 86°53' E	1.425	078	1.423
G	N 84°52' E	2.270	203	2.261
H	S 89°35' E	9.920	072	9.920
I	N 57°43' E	727	388	615
			3275	5280
			5235	19.587
COORD I	0.427 N	39.437	591	19.742
			39.760	
			At I angle from H - 185° H	
			To set Sta from I - 580°43' E - 2.665	

T 39 N - RGE SEC. 4

1/4 cor Reset

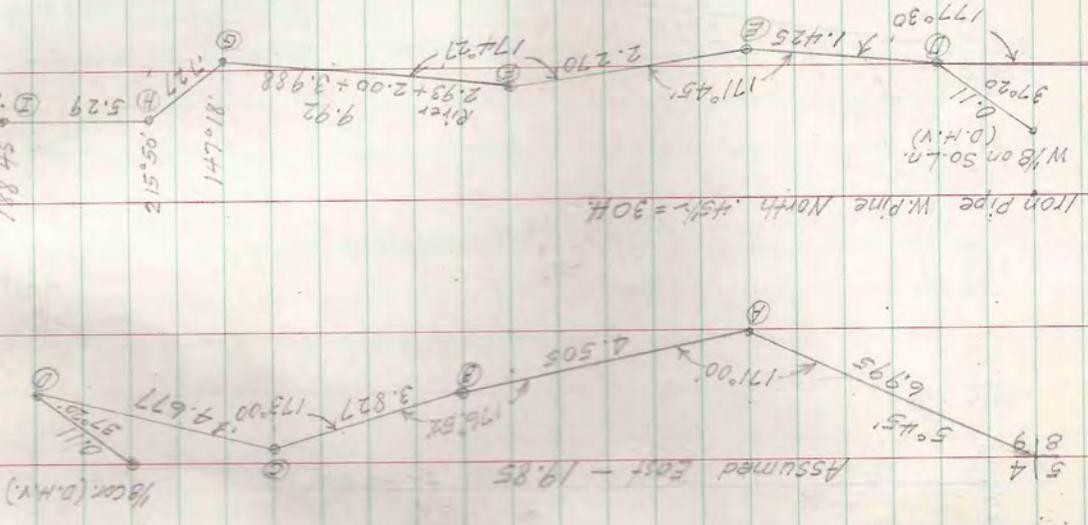

Lony Grobet
x
July 6 '48

Assumed East - 19.85

5 4 8 9

5°45'

6.995

171°00'

4.505

176°57'

3.827

173°00'

4.677

0.11

37°20'

W 1/8 on 50 L.N. (D.H.V.)

0.11

177°30'

1.425

171°45'

2.270

174°27'

9.92

2.93 + 2.00 + 3.988

147°18'

5.29

215°56'

188°31'

57°38'

177°30'

North Grid

T 39 N - R 6 E SEC. 4

July 7, 48


Orig Y.P. N53°W 20.2'
 " Y.P. N75°E 39.8'
 New Jack P. 16" N67°W 49.3'
 " " P. 12" S59°W 33.6'

1/4 conc. Mon.

11.01
 11.06
 11.036

180° 1/2


180° 8.328
 180° 9.67
 180° 9.67
 180° 5.155



9.28
 5.155
 7.658
 9.670
 8.328
 11.036

9.87
 5.155
 7.658
 9.670
 8.328
 11.036

J N 19° 58' E
 K N 0° 12' W
 L
 M
 N
 North
 N 1/4



N 1/4 con. found concrete monument under sod
 from which stumps of Original Y.P. 12" N53°W 20.2'
 " " Y.P. 6" N75°E 39.8'
 Marked new Jack Pine 16" N67°W 49.3'
 " " 12" S59°W 33.6'

5/4 Cor.

From S.W. Sec. Cor. traversed east following
 brushed line by L.G. Swartz. At 19.85 found iron pipe
 set by A.H. Vaughan in 1910 from S.T. Pine by S.F. Dorr.
 Extended true line E to 19.89 x 2 = 39.78 (Dorr)
 39.78 + 0.93 = 39.81 fell in line with old fence N
 and old fence E + W. From this point W. Pine
 stump N 10° E 3.3' No marks. Another W. Pine tree
 down and roted about 5.17° E 8.0'. These trees
 are only W. Pine stumps in near vicinity. Accepted
 stumps as original and set concrete monument
 for S 1/4 con.
 from which new W. Pine S 78° 45' E 56.7'

Corrected line from N 1/4 to S 1/4


Iron rd
N.C.
Spike in Jack pine 14"
N50°E 29.4'

1.12
1/8 Cor
977.1
89°44'

SPiKe
CABIN
SPiKe


T 39N - R 6E SEC. 4

1278.2 So. of N 1/4 cor.

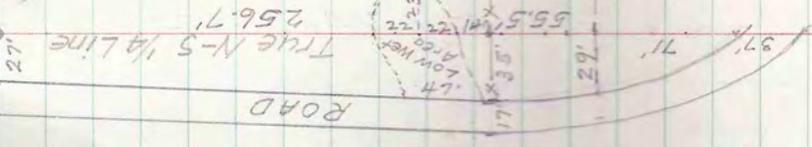


Larry Gruber

July 19, 48

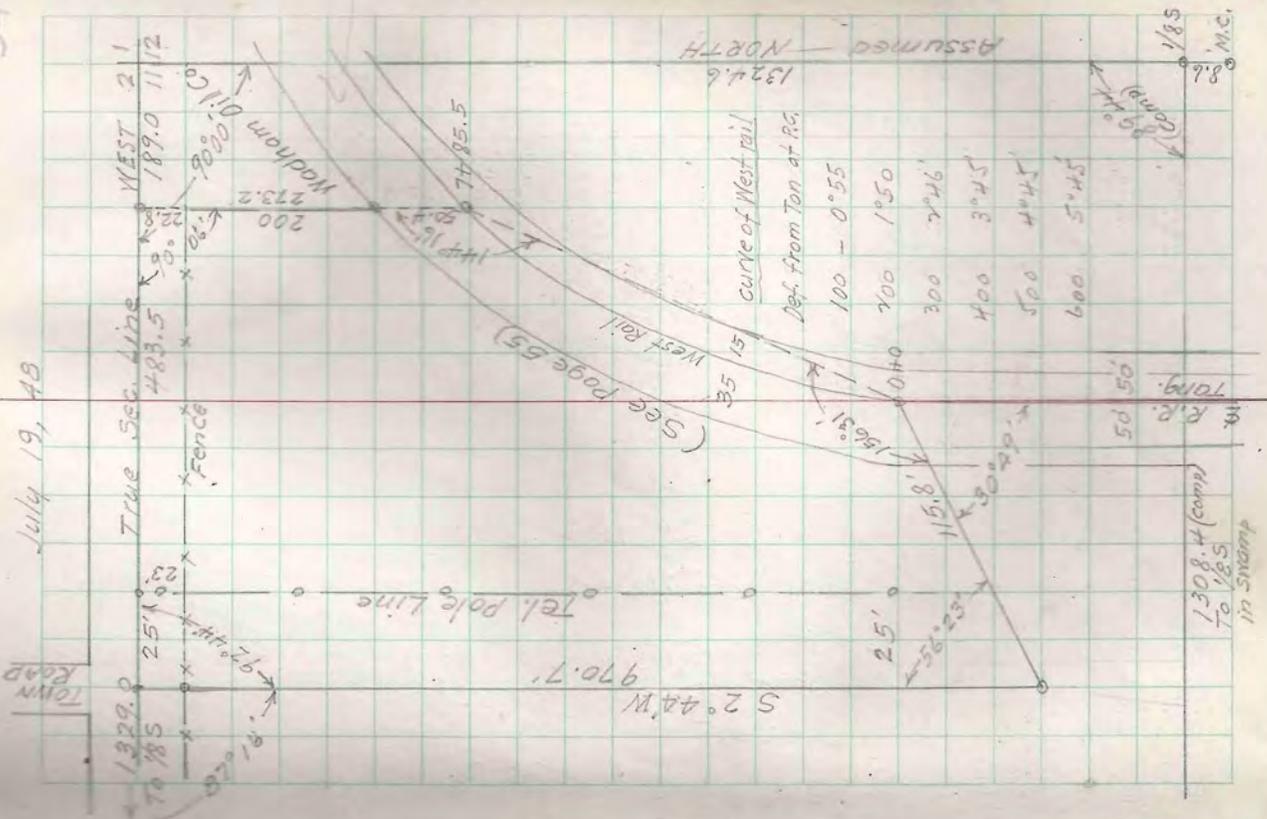


T 39N-R6E SEC 11 NE-NE
Subdivision
For Dr. Gale W. Huber
Begin July 16 48

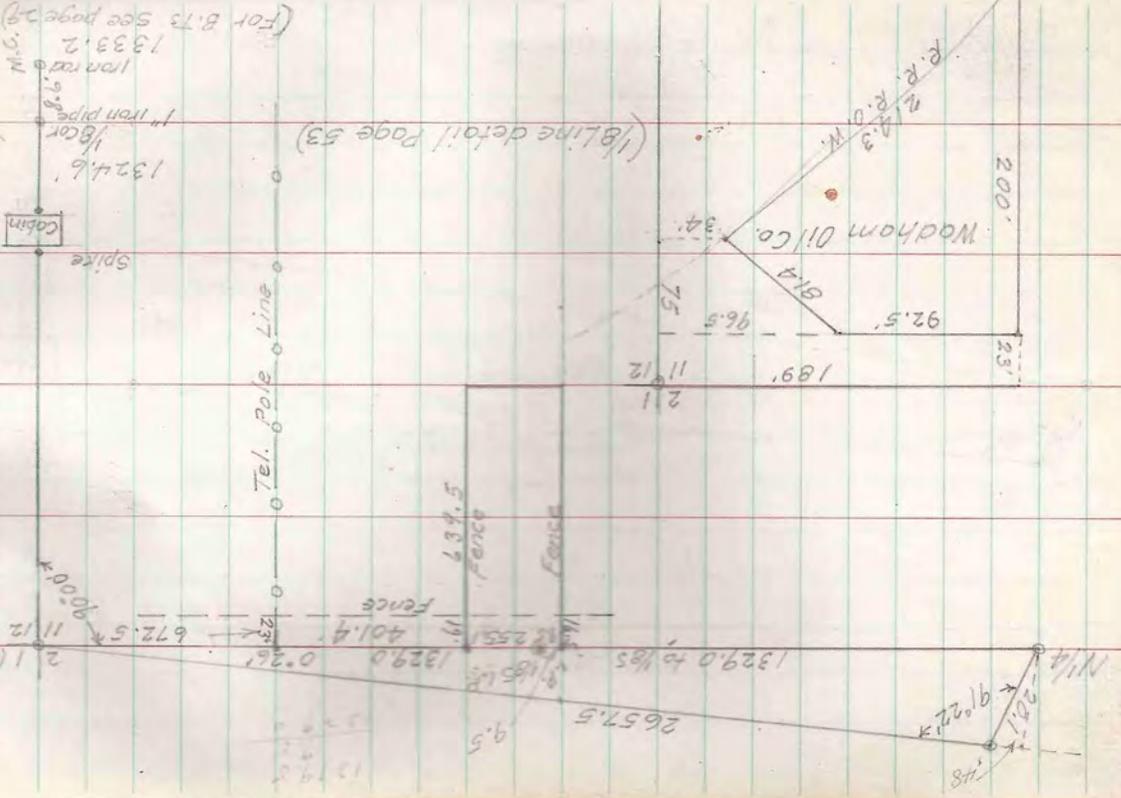


CEMETERY

± TOWN ROAD

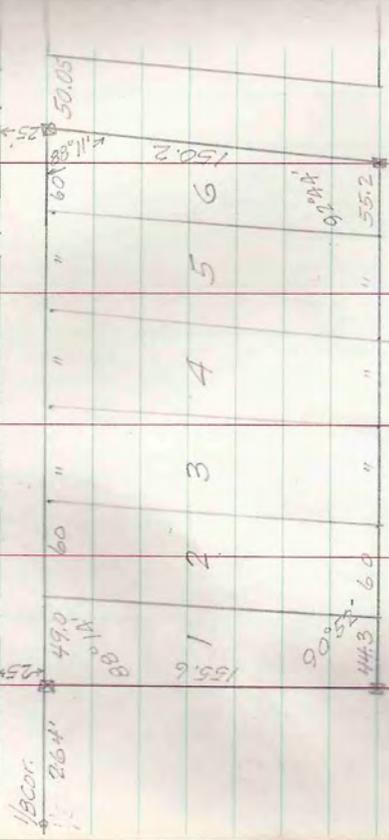

Parallel with 1/8 Line 1 264 E

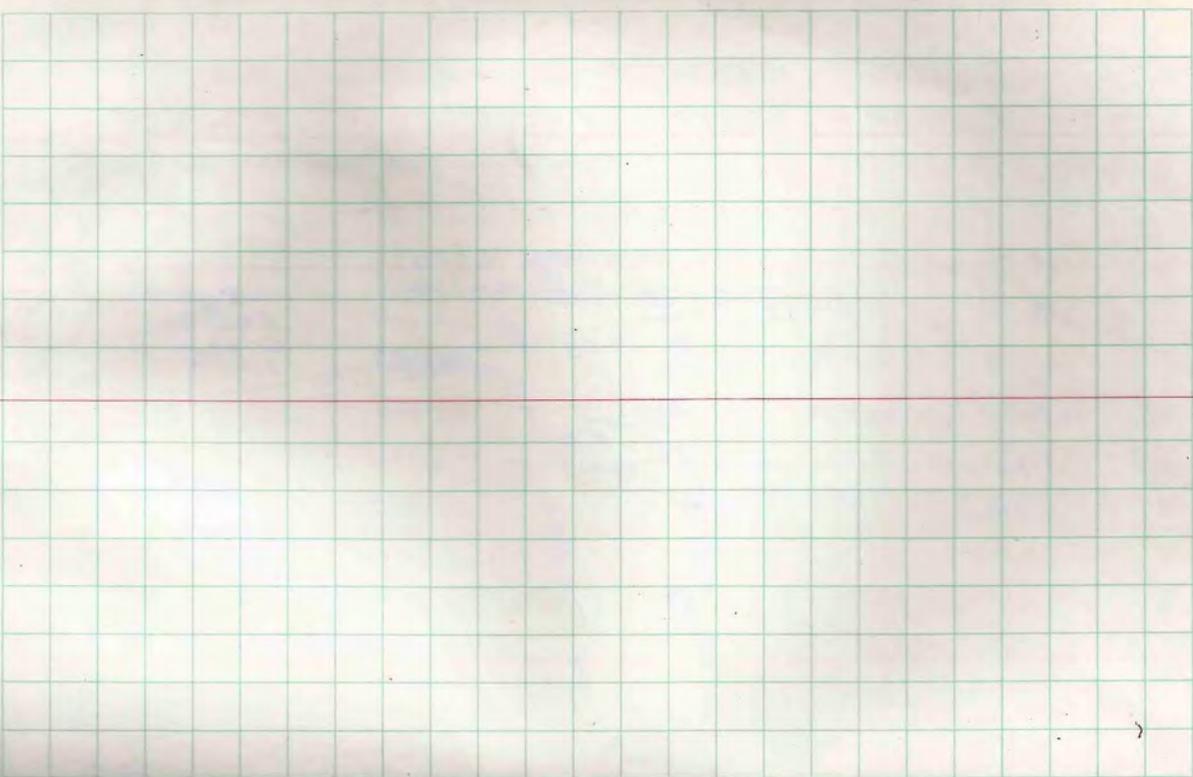

T43N-R6E SEC. 30

July 23-24

Retracement of Survey by S.D. Burnett
1926

North Line

From stake marked 4VI random E

Var. 0°45'E 11.00 Road. Did not find

NE. cor. of 20.00

East Line

Followed brushed line south from

about 20.10 E Var. 1°45'E

40.00 fell N 87°W 318 from post

by S.D. Burnett. Did not find O.B.T.S.

Thence South Var. 1°45'E (CANTY L.)

13.54 fell 10 W of M.G. by Burnett.

His W.P. 12" No°. 04 + W.B. 585E, 22 1/2 x 0.5

E-W 1/4 Line

Random W from E1/4 Var. 1°15'W

At 19.48 temp 1/8. Did not find 1/8 by S.D.B.

At 27.03 Road

At 47.58 Papoose Lake No stake

Found stake marked 41 No O.B.T.S.

about 5.00 further W along shore.

Went to Strawberry Island + found nothing

T43N-R6E SEC 30

North Line

Found stake on shore of Papoose Lake

marked 41 + 4VI. Also a stake on E shore

of bay in MARY L. marked 42

Distance from Papoose L. to MARY L. 4.65

+ over bay 8.93 to stake 42

From this stake 12.65 fell 1.30 south

of stake marked 4VI

Total dist from M.G. 21.23

V. T 43N - R 6E SEC. 30

Aug. 12 '48

E 1/8 cor on 1/4 line

At Sta. (D) angle from random S 83° 30' E
113° 08' to S 29° 38' W Distance 2.13 = 140.6
Set cedar post at south edge of swamp.

C 1/6 of SE. 1/4

At E 1/8 on 1/4 line angle from N 29° 38' W
148° 00' to S 2° 22' E on true 1/8 line.

Magnetic S 2° 35' E

3.20 Town Road.

1044' 15.86 set cedar post at edge of marsh
and end of bay in Conty Lake. No B.T.

1336' 20.25 set cedar post for 1/6 cor.

B.T. Maple 8' S 47° E 16.1 ft.

Aug. 13 '48 C 1/4 cor. Sec. 30

At Sta. (E) from random S 88° 37' E

angle 179° 27' to N 89° 10' W Dist 2.87

Thence south Dist .425 to C 1/4 cor.

Set cedar post for corner.

B.T. Oak 7" S 11° E 74.7 ft.

T 43N - R 6E SEC. 30

N 1/4 cor. on island

Offset temp N 1/4 .094 E

Set cedar post

B.T. W. Birch 13" S 16° E 20.5 ft.

To close traverse of N 1/2 Sec. 30.

At M.C. on N end of island observed

angle from random S 0° 05' W to N 1/4 cor
131° 49'

Course N 48° 16' W ✓

Course computed from coordinates

M.C. 32.290 S - 36.192 E and N 1/4 = 90

32.290 = cot 548° 16' W (check)

36.192

E 1/8 on North Line Sec. 30

At temp. 1/8 from N 88° 45' E 30° W to N 58° 34' E

22.6 to true 1/8 cor. in line between NE. Sec. cor.
and East M.C. and of mid distance between

NE. Sec. cor. and N 1/4 cor.

Set cedar post. B.T. Maple 4" S 33° W 30.6'

Birch 10" N 84° W 52.4'


N 1/6 on East Line Sec. 30

At 20. ch S on random angle from N 0° 47' W

84° 49' to N 84° 02' E - 3.246 to true 1/8 cor. Cedar B.T.


Double Elm 9" N 44° W - 5.5 ft.

T 39 N - RTE SEC. 34
 To locate road in NW - SW

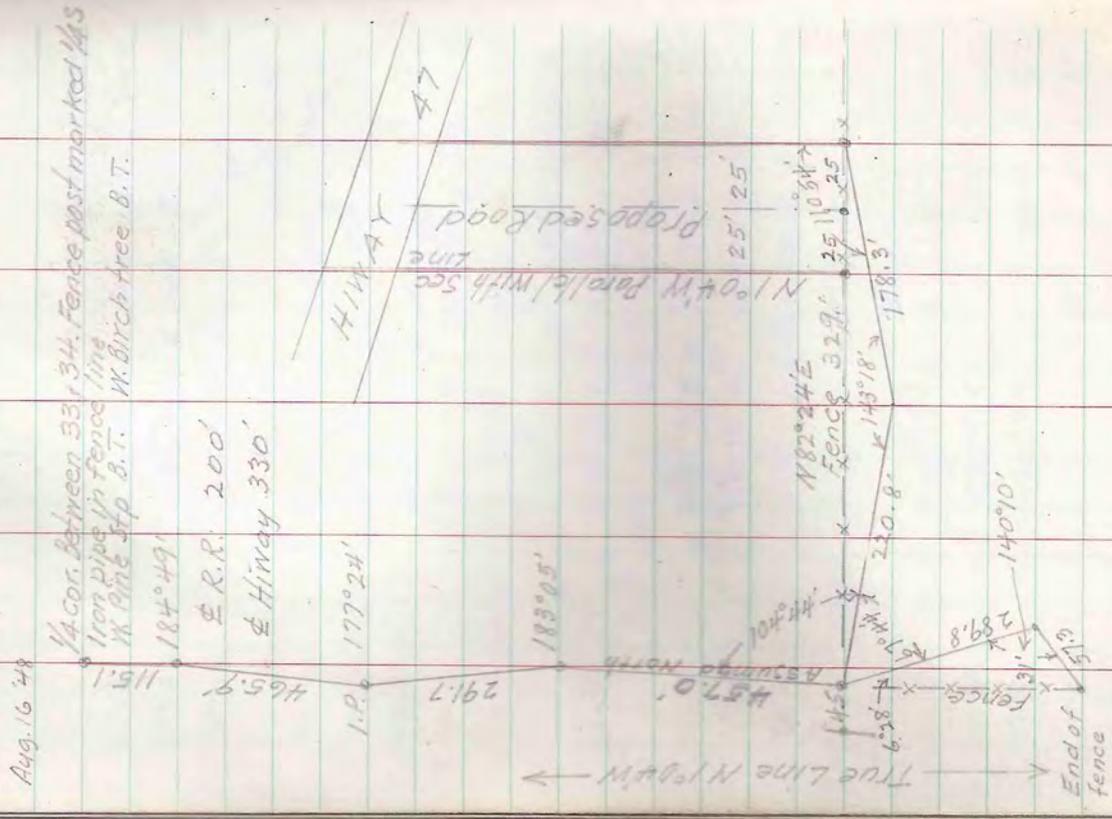


West	North	East	West
N 32° 18' E	57.3	48.43	30.62
N 7° 32' W	289.8	287.29	37.99
N 1	457.0	459.00	
N 30° 05' W	291.7	291.27	15.69
N 0° 29' W	465.9	465.87	3.12
N 5° 18' W	115.1	114.61	10.63
67.43 - 30.62 = 36.81		166.47	
True Line N 10° 41' W		30.62	
67.43		67.43	
S 75° 16' E	220.8	56.15	213.54
N 68° 02' E	178.3	66.69	165.36
66.69 - 56.15 = 10.54		378.9	

T 36N-R9E SEC. 25

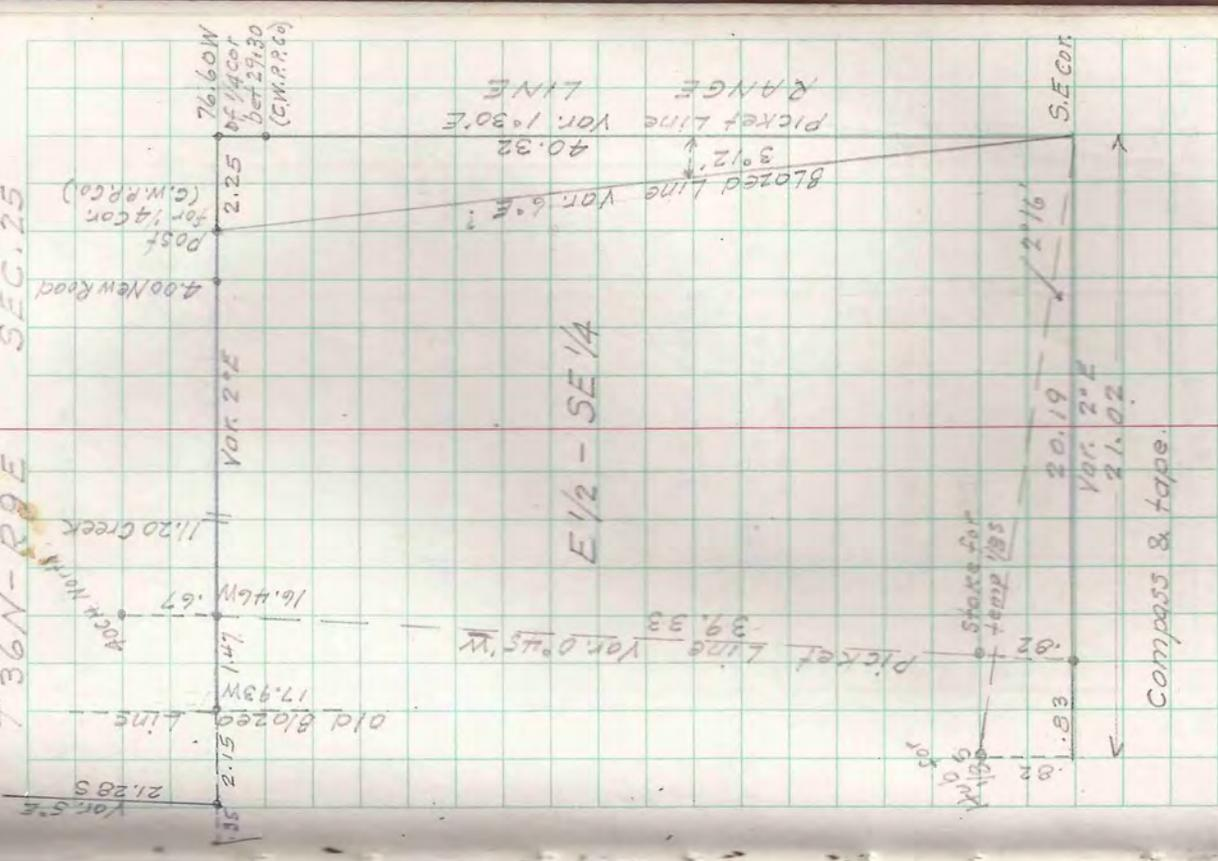

T 36N-R9E SEC. 25

Copy of survey notes by H.C. Lawrence
for Consol. W.E. Power & Paper Co.
July 1947

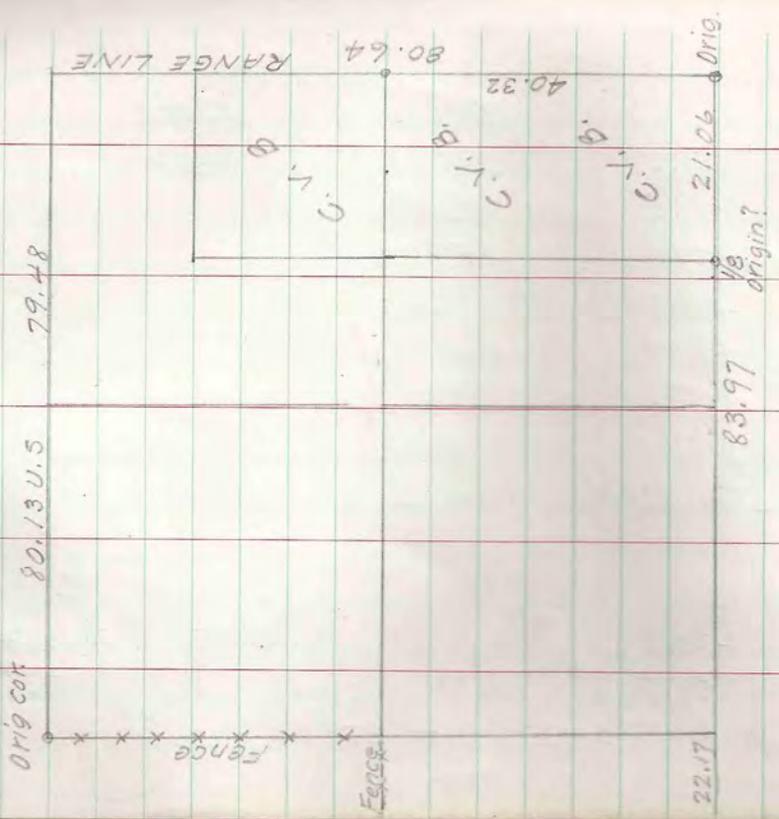


79.48
83.97
✓ 163.45
H 81.72
20.43
17.93
7.50

479.48
19.87
20.43
✓ 140.30
70.15

G.L. Bingham
Aug 20, 21, 48

T 36 N - R 9 E SEC. 25
Compass & tape Aug. 21 '40

C.V. Brennan

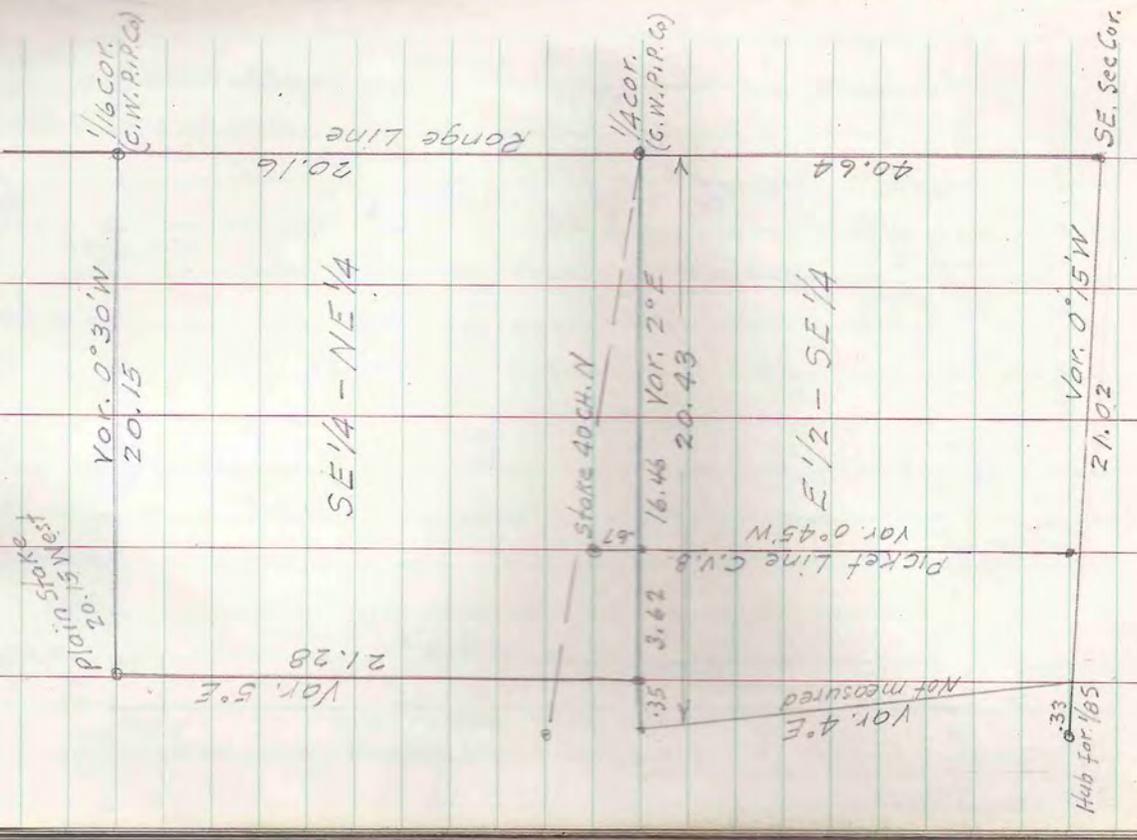


LOT 6
SEC. 19
T43N-R6E

Retracement of original survey by C.W. Fisher
Aug 24 Sept 2 + 3 48

110' N
5-P
Frank Milk

MARY LAKE

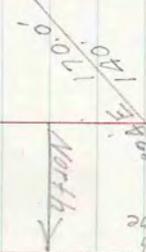

ROAD

327.2'

325'
365'


N 89° 50' E

Cedar post
Iron pipe
B.T. Birch 6"
N 10° W 3.4'

M.C.
N 3° 51' E
36.1'
35.5'

Passoose


LOXG

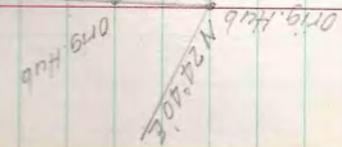


N	65.95	M.C.-A	N 3° 51' E
S	4.44	A-B	N 24° 40' E
F	14.82	B-C	S 87° 26' E
	200.90	C-D	S 58° 24' E
	365.16	D-M.C.	
	98.20		
	98.21		
	365.00		

W 1

Retrocemeent of J. A. Carlsons's survey dated June 22 1948

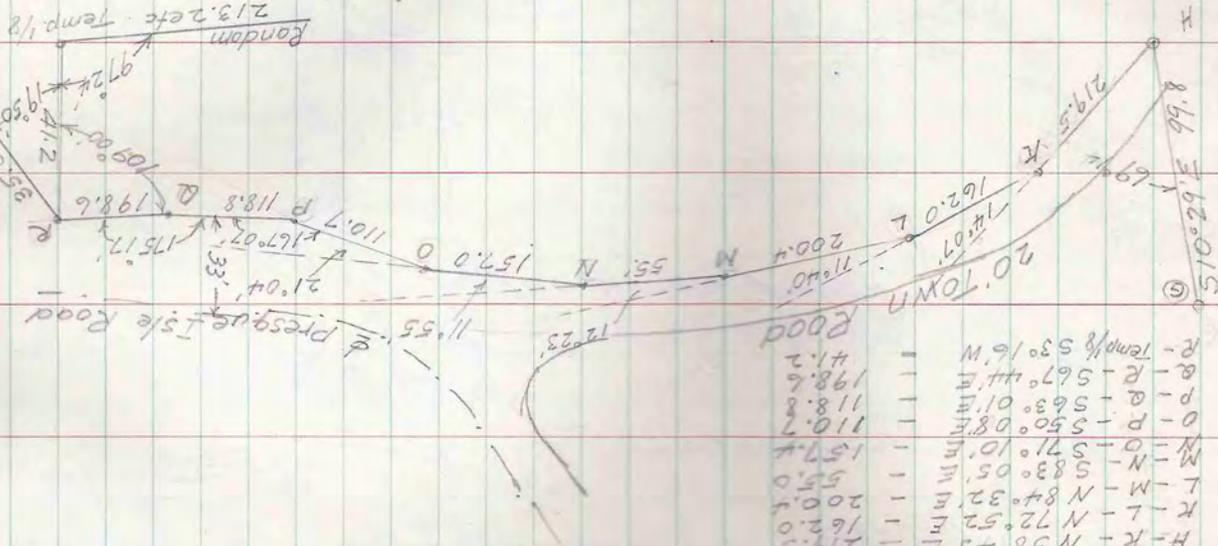

Copy of notes recorded by C. W. Fisher Aug 1944

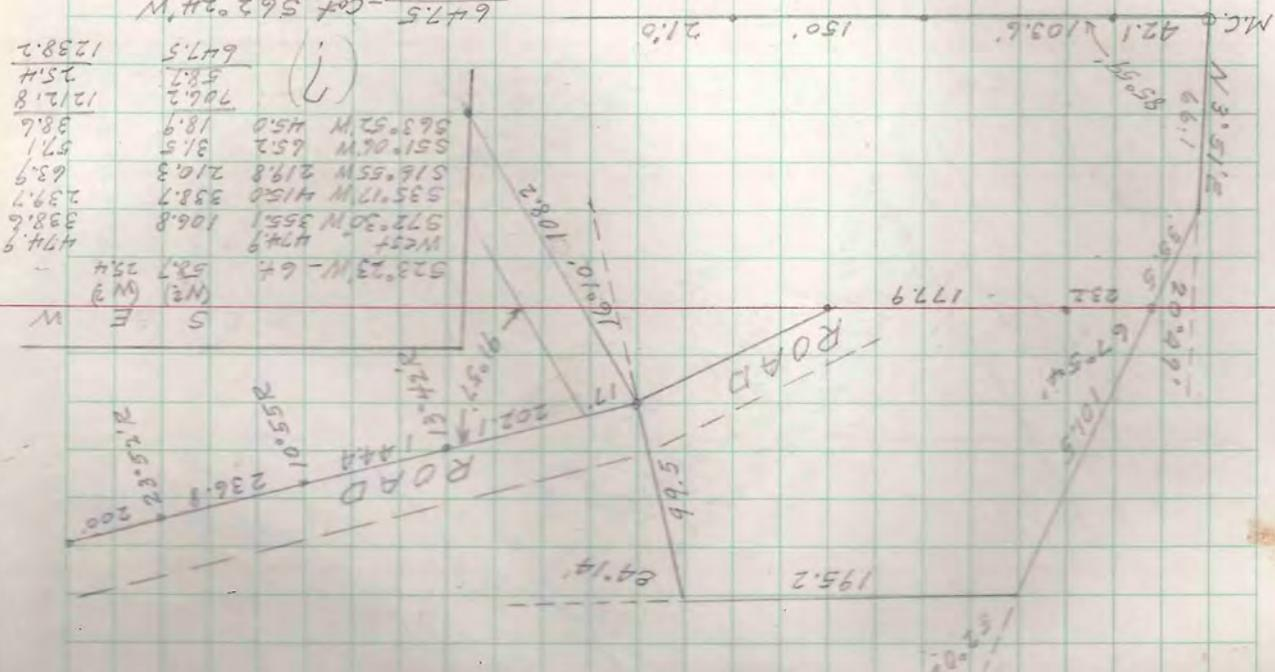

T40N-R7E SEC. 30 LOT 2

Sept. 29 48
30

PLAT OF ARBOR VITAE

West Var 2°30'E Mag. N87°30'W
Line of stakes 766.5
iron pipe in place

COMMON EXCHANGE

1/4 line as per deed 7.50CH
Fence 16R=264
M.D. 4.62


Fence 25R=412.5
16R=264
Vol-34 Pg-31
2.5 AC.

SHY TO 251'



25R=412.5

TOWN ROAD


SHORES TO AUG. CANIKS (see next page)

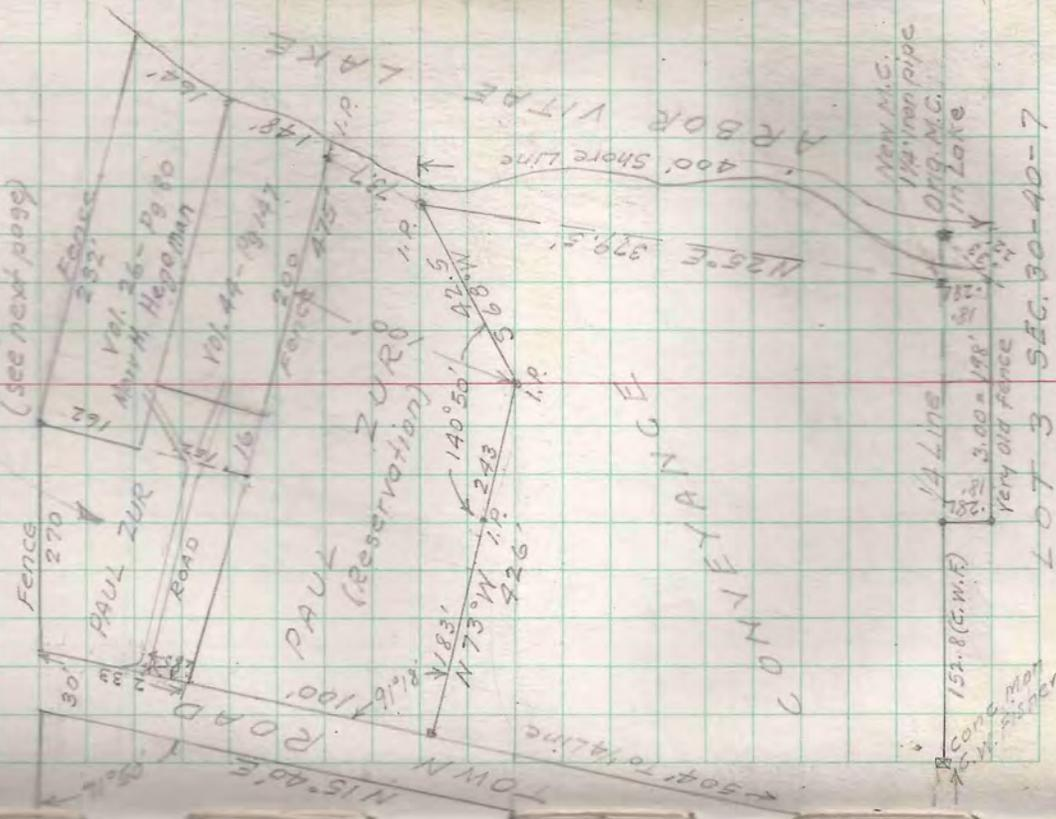

LOT 3 SEC. 30-40-7

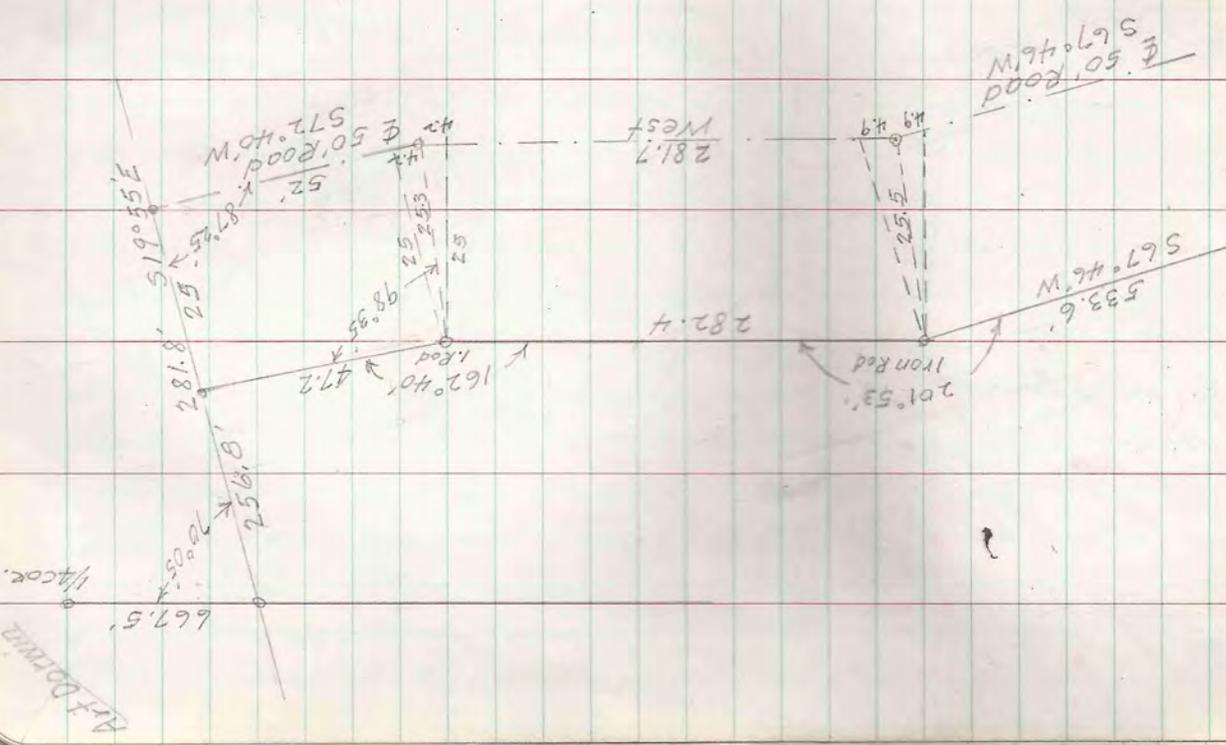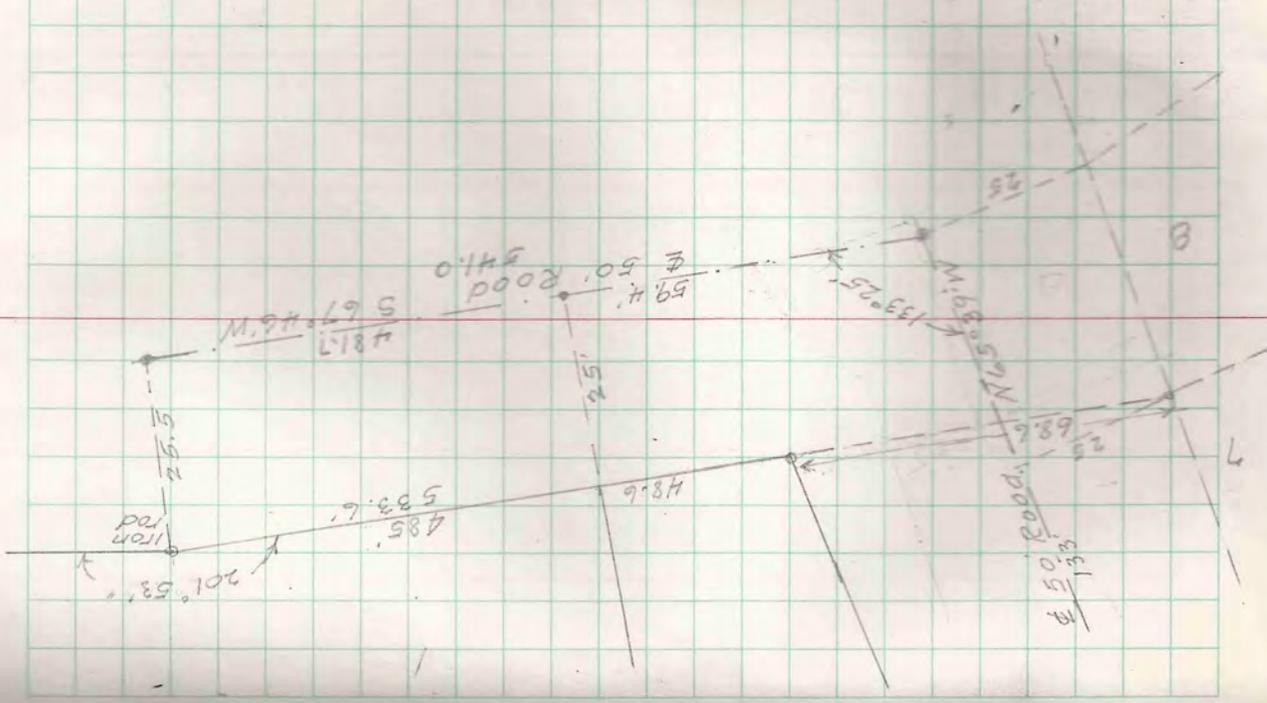

5.30.
 42 ft. W...
 E=118.37
 for 8° 30'
 H for curve
 Defect
 ton ang
 2° 16.2'
 III x C
 etc. For
 Defect
 tangent to
 divided by
 offset=1.27
 offset for
 158 on wher
 D and wher
 Offset
 746.00 and
 414.85 ft.
 3454.1 and
 and P. T.
 Station
 Long C
 Extern
 Middle
 Tangent
 Radiu
 DIE

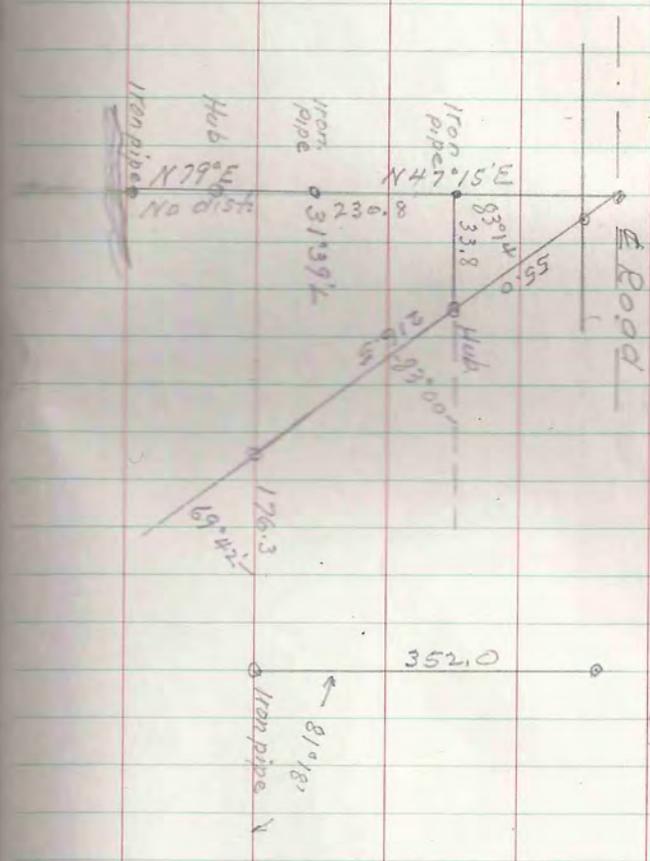

C. W. Fisher
 Oct. 31 - 1944
 Lot 6 Sec 19-43-6