


Sec 8 T. 38 N. R. 8 E.

① N¹/₄ NE¹/₄

RECEIVED & FILED	L689
Oneida County Surveyor's Office	
Date	FEB. 5 1988
By	P.W.
OCS Area #	

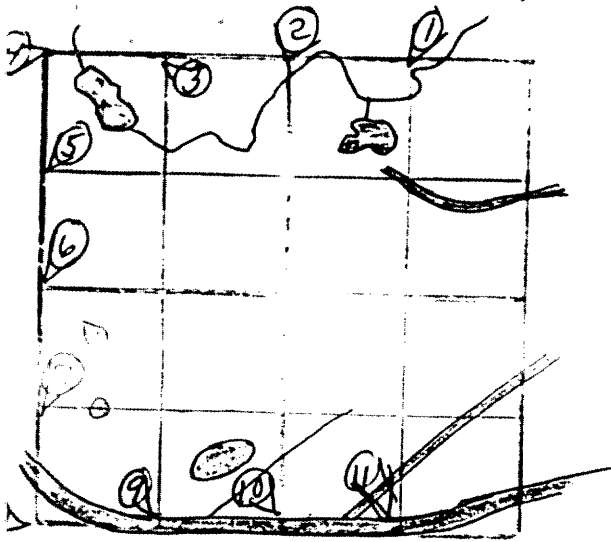

② N¹/₄ Sec 8 Tam 5" - N61°W - 0.185 ch.; - SB 7" - N2°E - 0.500 ch.;
 Stp. - S32°W - 0.160 ch. ()

③ N¹/₄ NW¹/₄

④ NW Cor. Sec 8

Iron pipe MK 4 - N83°E - 2330 ft

⑤ W¹/₄ NW¹/₄

⑥ W¹/₄ Sec 8

⑦ W¹/₄ SW¹/₄

L689^m

8) SW cor. sec 8 2 1" iron pipes & oak post. PW 24" N70°W -
1.027 ch.; PJ 12" N W - 1.788 ch (Northwoods)


9) S¹/₄ SW¹/₄

10) S¹/₄ sec 8 at 38.350 each way. an old iron pipe just west of
driveway is too far east. (Northwoods)

SEC. 8 T. 38 N. R. 8

① N¹/₄ NE¹/₄

L 689

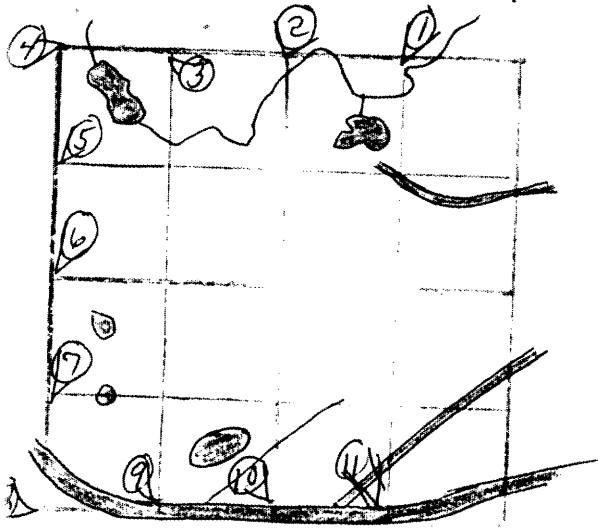

② N¹/₄ Sec 8 Tam 5" - N 61° W - 0.185 ch.; - SB 7" - N 2° E - 0.500 ch.;

Stp. - S 32° W - 0.160 ch. (?)

) single proportion

Found above mon. & Acc., Set D.N.R. Brass cap in new location, as this mon. was

Too far north & west, also no history of mon. BTs for new cor. Tam. 6" N 20° W 60.60;

SB 5" N 85° E 17.35', PR 18" S 15° E 33.35', PR 16" S 19° W 60.75', (Vissers 1985)

③ N¹/₄ NW¹/₄

④ NW Cor. Sec 8 Iron ~~found~~. MK 4 - N83°E - 2330 d L.

found 2" I.P. with above BT, ~~made New BTs~~ also found MR 3" S28E 27.70',
mkd New BTs, Asp 14" S32°W 16.52', Asp 14" N86W 15.45', (Vissers 1985)

⑤ W¹/₄ NW¹/₄ Found No evidence of cor. Set 14" I.P., BTs, PW 7" North 11.15',

SB 5" S60E 6.70', SB 3" S73W 8.35', (Vissers 1985)

⑥ W¹/₄ Sec 8 Found No evidence of man or Acc., Set DNR Brass Cap by Single

Prop., on South edge of Key. BTs. Tam 6" S85W 61.10', Tam 8" S56W 23.60', BW 5"
S 12W 33.70', SB 7" S08E 42.60' (Vissers 1985)

⑦ W¹/₄ SW¹/₄ found No Evidence of man, found ^{old} painted Blue line going
westerly, Set 14" I.P. BTs, PJ 12" N87E 52.95', PJ 14" S40W 24.00' (Vissers, 85)

⑧ SW cor. sec 8 2 1" iron pipes & oak post. PW 24" ^{67 1/2} N70°W -
^{67.78} 1.027 ch.; PJ 12" N W - 1.788 ch (Northwoods)

Found mon and pw 24", also MS 7" S50W 26.57', PR 13" S48E 42.70', OR 5" N49E 7.20'
 (Visser's 55')

⑨ S 1/4 SW 1/4 found 2" [□] Iron Rod in Rd.

⑩ S 1/4 sec 8 at 38.350 each way. an old iron pipe just west of
 driveway is too far east. (Northwoods) found RR spine in Rd. made BTs.

PJ 12" S67 1/2 W 37.75', BW 10" N04W 33.65', OR 6" N55E 53.45', also 1/4" I.P

Marking NE cor? Lot #1 S01W 32.95' (Visser's, 55)

also old Northwoods BT N17°W, pw 18", 72.5' (1964)