

CERTIFIED LAND CORNER RESTORATION

Index No. R-17

State of Wisconsin }
 County of Oneida } ss.


History of original corner establishment:
 Smith and Branham recovered an old rock cairn which they accepted as this corner in 1950 when they ran the south line of section 22. Set a 1-1/2" iron pipe but no mention made to BT's established.

I, Phillip T. Hansen, do hereby certify that on the 12th day of June, 1980, I found evidence of the Section corner of Sections 22, 23, 26, 27 Township 37, North, Range 9 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Description of corner evidence found:
 Recovered Ripco's 1-1/2" iron pipe with 4" square brass cap, in good condition, projecting 3' - stamped:
 A rock cairn was recovered around base of monument.
 Recovered OBT - B.Spruce 7" S45°W 72.3 links.

T37N R9E
 S ~~22~~ S23
 27-26


Resident witnesses:
Jim Claflin
Herb Wagoner

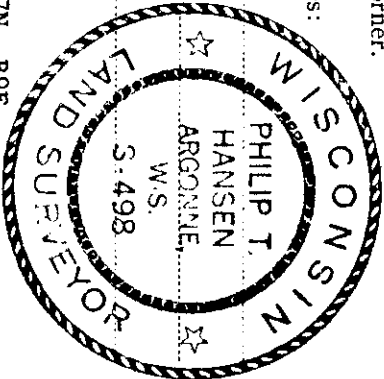

T37N R9E

Description of monument and accessories I established to perpetuate the original location of this corner.
 Left monument in place as recovered.

Marked NBT's -
 Maple 5" N74°W 40.7 links
 Maple 6" S14°W 38.3 links
 Maple 5" S80°E 45.5 links
 all scribed SC BT.

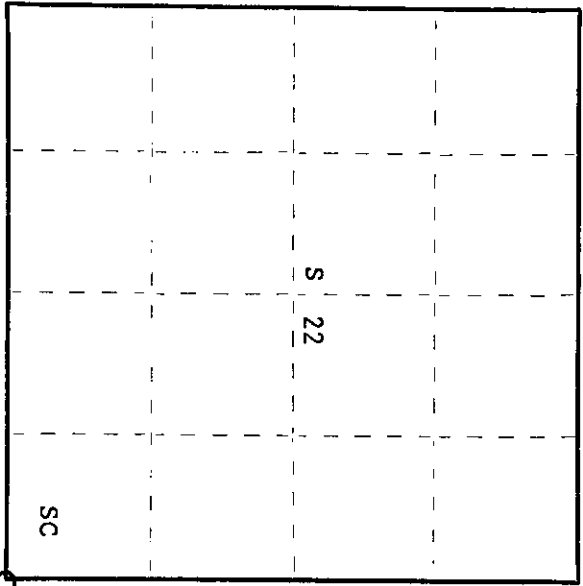

○ = Corner monument restored.

Dated at Rhineland, Wis., this 21st day of July, 1980.

Signature Phillip T. Hansen Title Registered Land Surveyor Registration No. S-498
 (County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Oneida, I hereby certify that the within instrument was filed in his office for record on the 30th day of July, 1980 at 10:15 o'clock M.

Donna George Fisher
 (Register of Deeds)

By: _____ Deputy

3709220000