

LAND CORNER PRESERVATION RECORD

It is the purpose of this record to preserve the location of a survey or land corner monument that may be disturbed, removed or inaccessible due to road construction or other activity. ROAD CONSTRUCTION

County: ONEIDA	City, Village, Town: TOWN OF SUGAR CAMP	Section: 34	Town: 39 N	Range 09 E
-------------------	--	----------------	---------------	---------------


Describe what was found, its location and origin. If known, describe if the monument found is a 1/16 corner or other subdivisional corner; a monument called for in a deed; a monument shown on a survey map or plat etc and in what GL or 1/4 - 1/4 section or subdivision the monument is located.

Approximate Location within Section. 34

06/03/09 - KEVIN BIXBY FINDS 1" IRON PIPE AS NOTED ON CORNER FORM X-17, AND WITNESSES.


06/11/09 - I VERIFY THE 1" IRON PIPE FOUND BY BIXBY, MATCHES THE ONEIDA COUNTY COORDINATES AS PUBLISHED AND SET ADDITIONAL WITNESSES AS SHOWN. PRIOR TO ROAD CONSTRUCTION.

MAP # **L 2659**
DATE FILED 10-29-09
BY [Signature]
DESCRIPTION FILED

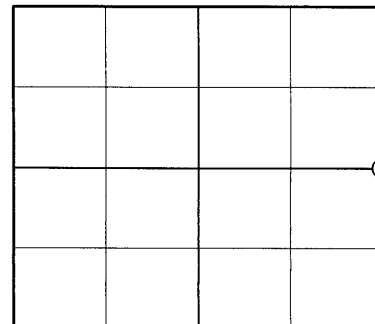

3909342000

Plan view map of landmark monument location with bearing and distance ties to a minimum of four described witness or reference monuments of concrete, natural stone, metal, live bearing trees or equivalent material or indicate datum & coordinates if tied out using GPS. Indicate what was reset.

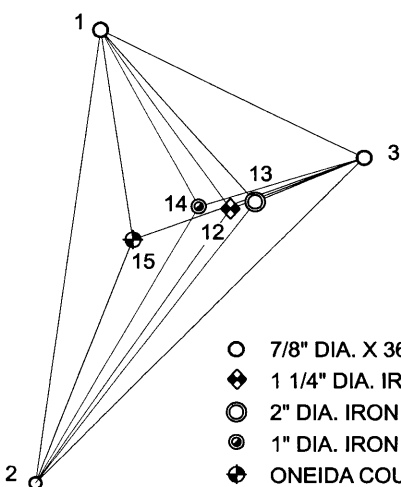

- 7/8" DIA. X 36" LONG IRON ROD, SET
- ◆ 1 1/4" DIA. IRON PIPE, FOUND
- ⊙ 2" DIA. IRON PIPE WITH RIPCO TABLET, FOUND
- ⊗ 1" DIA. IRON PIPE, FOUND
- ◆ ONEIDA COUNTY WITNESS MONUMENT, FOUND

BS	∩	FS	BS ANGLE	BS DISTANCE	FS ANGLE	FS DISTANCE
2	1	3	00°00'00"	145.36'	71°29'27"	90.54'
		12	"	"	43°11'55"	69.36'
		13	"	"	49°06'38"	72.32'
		14	"	"	36°21'34"	63.63'
		15	"	"	16°32'37"	67.38'
1	2	3	00°00'00"	145.36'	36°21'39"	144.81'
		12	"	"	26°36'16"	106.02'
		13	"	"	29°09'18"	112.23'
		14	"	"	21°50'29"	101.39'
		15	"	"	13°21'54"	83.01'
2	3	1	00°00'00"	144.81'	72°08'54"	90.54'
		12	"	"	24°00'55"	44.14'
		13	"	"	22°48'54"	36.30'
		14	"	"	28°35'04"	53.13'
		15	"	"	25°21'59"	75.69'



PROFESSIONAL LAND SURVEYOR CERTIFICATE:

This land corner was referenced out in advance of road construction or other activity as an act of preserving survey evidence or monuments. This corner has not been tested for its accuracy during the course of this preservation. It is recommended that those using the corner position evaluate and verify it prior to use in a survey or other use.

I hereby certify that I am a duly licensed Professional Land Surveyor in the State of Wisconsin; that the location of this Survey or Land Corner was referenced by me or under my direct supervision and control and that the information shown on this record is true and correct to the best of my knowledge and belief.

Signature [Handwritten Signature]

Date 10/06/2009