



PART OF
GOVERNMENT LOT 7, 8 AND 9
SECTION 11, TOWNSHIP 37 NORTH, RANGE 6 EAST
TOWN OF CASSIAN
ONEIDA COUNTY, WISCONSIN

LITTLE
BEARSKIN
LAKE

NOTE: SURVEY PERFORMED TO MARK/FLAG A PORTION OF THE EAST LINE OF LOT 15 ONLY,
EXISTING STRUCTURES NOT LOCATED PER THIS SURVEY.

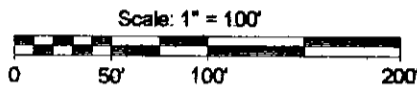

ASSUMED NORTH, BASED ON
THE WESTERLY LINE OF LOT 14 WHICH
BEARS NORTH 26° 28' 00" WEST

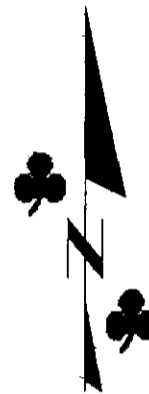

AREA (INCLUDES ROAD
RIGHT-OF-WAY):
3.63 ACRES
158192.63 SQ. FEET
MORE OR LESS

MAP # **A1410**
DATE FILED **SEP 23 2004**
BY *MBK*
DESCRIPTION FILED
ONEIDA CO. SURVEYOR'S OFFICE

DESCRIPTION

Part of Government Lot 7, 8 and 9, Section 11, Township 37 North, Range 6 East, town of Cassian, Oneida County, Wisconsin more particularly described as follows:

Commencing at the southeast corner of said section marked by a brass capped iron pipe found in place; thence North 36° 04' 51" West (ASSUMED), a distance of 1525.95 feet to a found 1 1/4" iron pipe, said point being the POINT OF BEGINNING;

Thence South 74° 54' 41" West, a distance of 70.12 feet to a found 1 1/4" iron pipe; thence South 75° 04' 36" West, a distance of 65.29 feet to a found 1 1/4" iron pipe; thence North 26° 28' 00" West, a distance of 598.20 feet to a found 1 1/4" iron pipe; thence North 43° 58' 53" West, a distance of 244.28 feet to a found 1 1/4" iron pipe near the southerly shore of Little Bearskin Lake; thence meandering along said lake shore North 20° 23' 52" East, a distance of 149.68 feet to a found 1 1/4" iron pipe; thence North 43° 10' 48" East, a distance of 100.00 feet; thence South 83° 20' 29" East, a distance of 50.00 feet to a found 1 1/4" iron pipe; thence leaving said lake shore South 24° 10' 51" East, a distance of 968.62 feet to the POINT OF BEGINNING.

Said described tract containing 3.63 acres (158192.63 square feet), more or less. This area includes road right-of-way of Jackson Heights Road.

Subject to any easements, restrictions, or rights of way of record or of use.

Including all those lands lying between the above described meander line and the water's edge of Little Bearskin Lake.

FIELD SURVEY WORK COMPLETED ON THE 27TH DAY OF JULY, 2004.

SURVEYOR'S CERTIFICATE

I, Benton A. McMullen, Wisconsin Registered Land Surveyor # S-2555, do hereby certify that I have surveyed and mapped the property shown hereon, and that I have complied with the applicable requirements of the Wisconsin Administrative Code Chapter A-E 7, and that this map represents a true and accurate survey of said property to the best of my knowledge and belief.

This survey was performed under the order of:
Paul Schoenenberger

This survey is made for the use of the present owners of the property, and also those who purchase, mortgage, or guarantee the title thereto within one year from date hereof.



Registered Land Surveyor # S-2555

LEGEND

- ⊙ - 1 1/4" Iron Pipe Found
 - ⊕ - Brass Capped Iron Pipe Found
 - () - Recorded as values
- (NOTE: Iron pipe diameter is outside diameter)

SOUTHEAST CORNER OF SECTION 11
MARKED BY A BRASS CAPPED IRON
PIPE FOUND IN PLACE



**MCMULLEN & ASSOCIATES,
INCORPORATED.**
LAND SURVEYING AND SOIL TESTING
9832 BOLGER LAKE ROAD
MINOCQUA, WISCONSIN 54548
TELEPHONE # (715) 356-3011 FAX # (715) 356-1501

DRAFTED BY: Dwight A. Miesbauer
SCALE: 1" = 100'

DATE: AUGUST 9, 2004
JOB #204069