


A 361

Sections 3 & 4  
T 37 NR 11 E.  
MARGARET LAKE.


RECEIVED & FILED # A 361 3.1  
Oneida County Surveyor's Office  
Date MAR 2 - 1971  
By M. R.  
OCS Area #

N.H.E., Oneida Co. Wis.

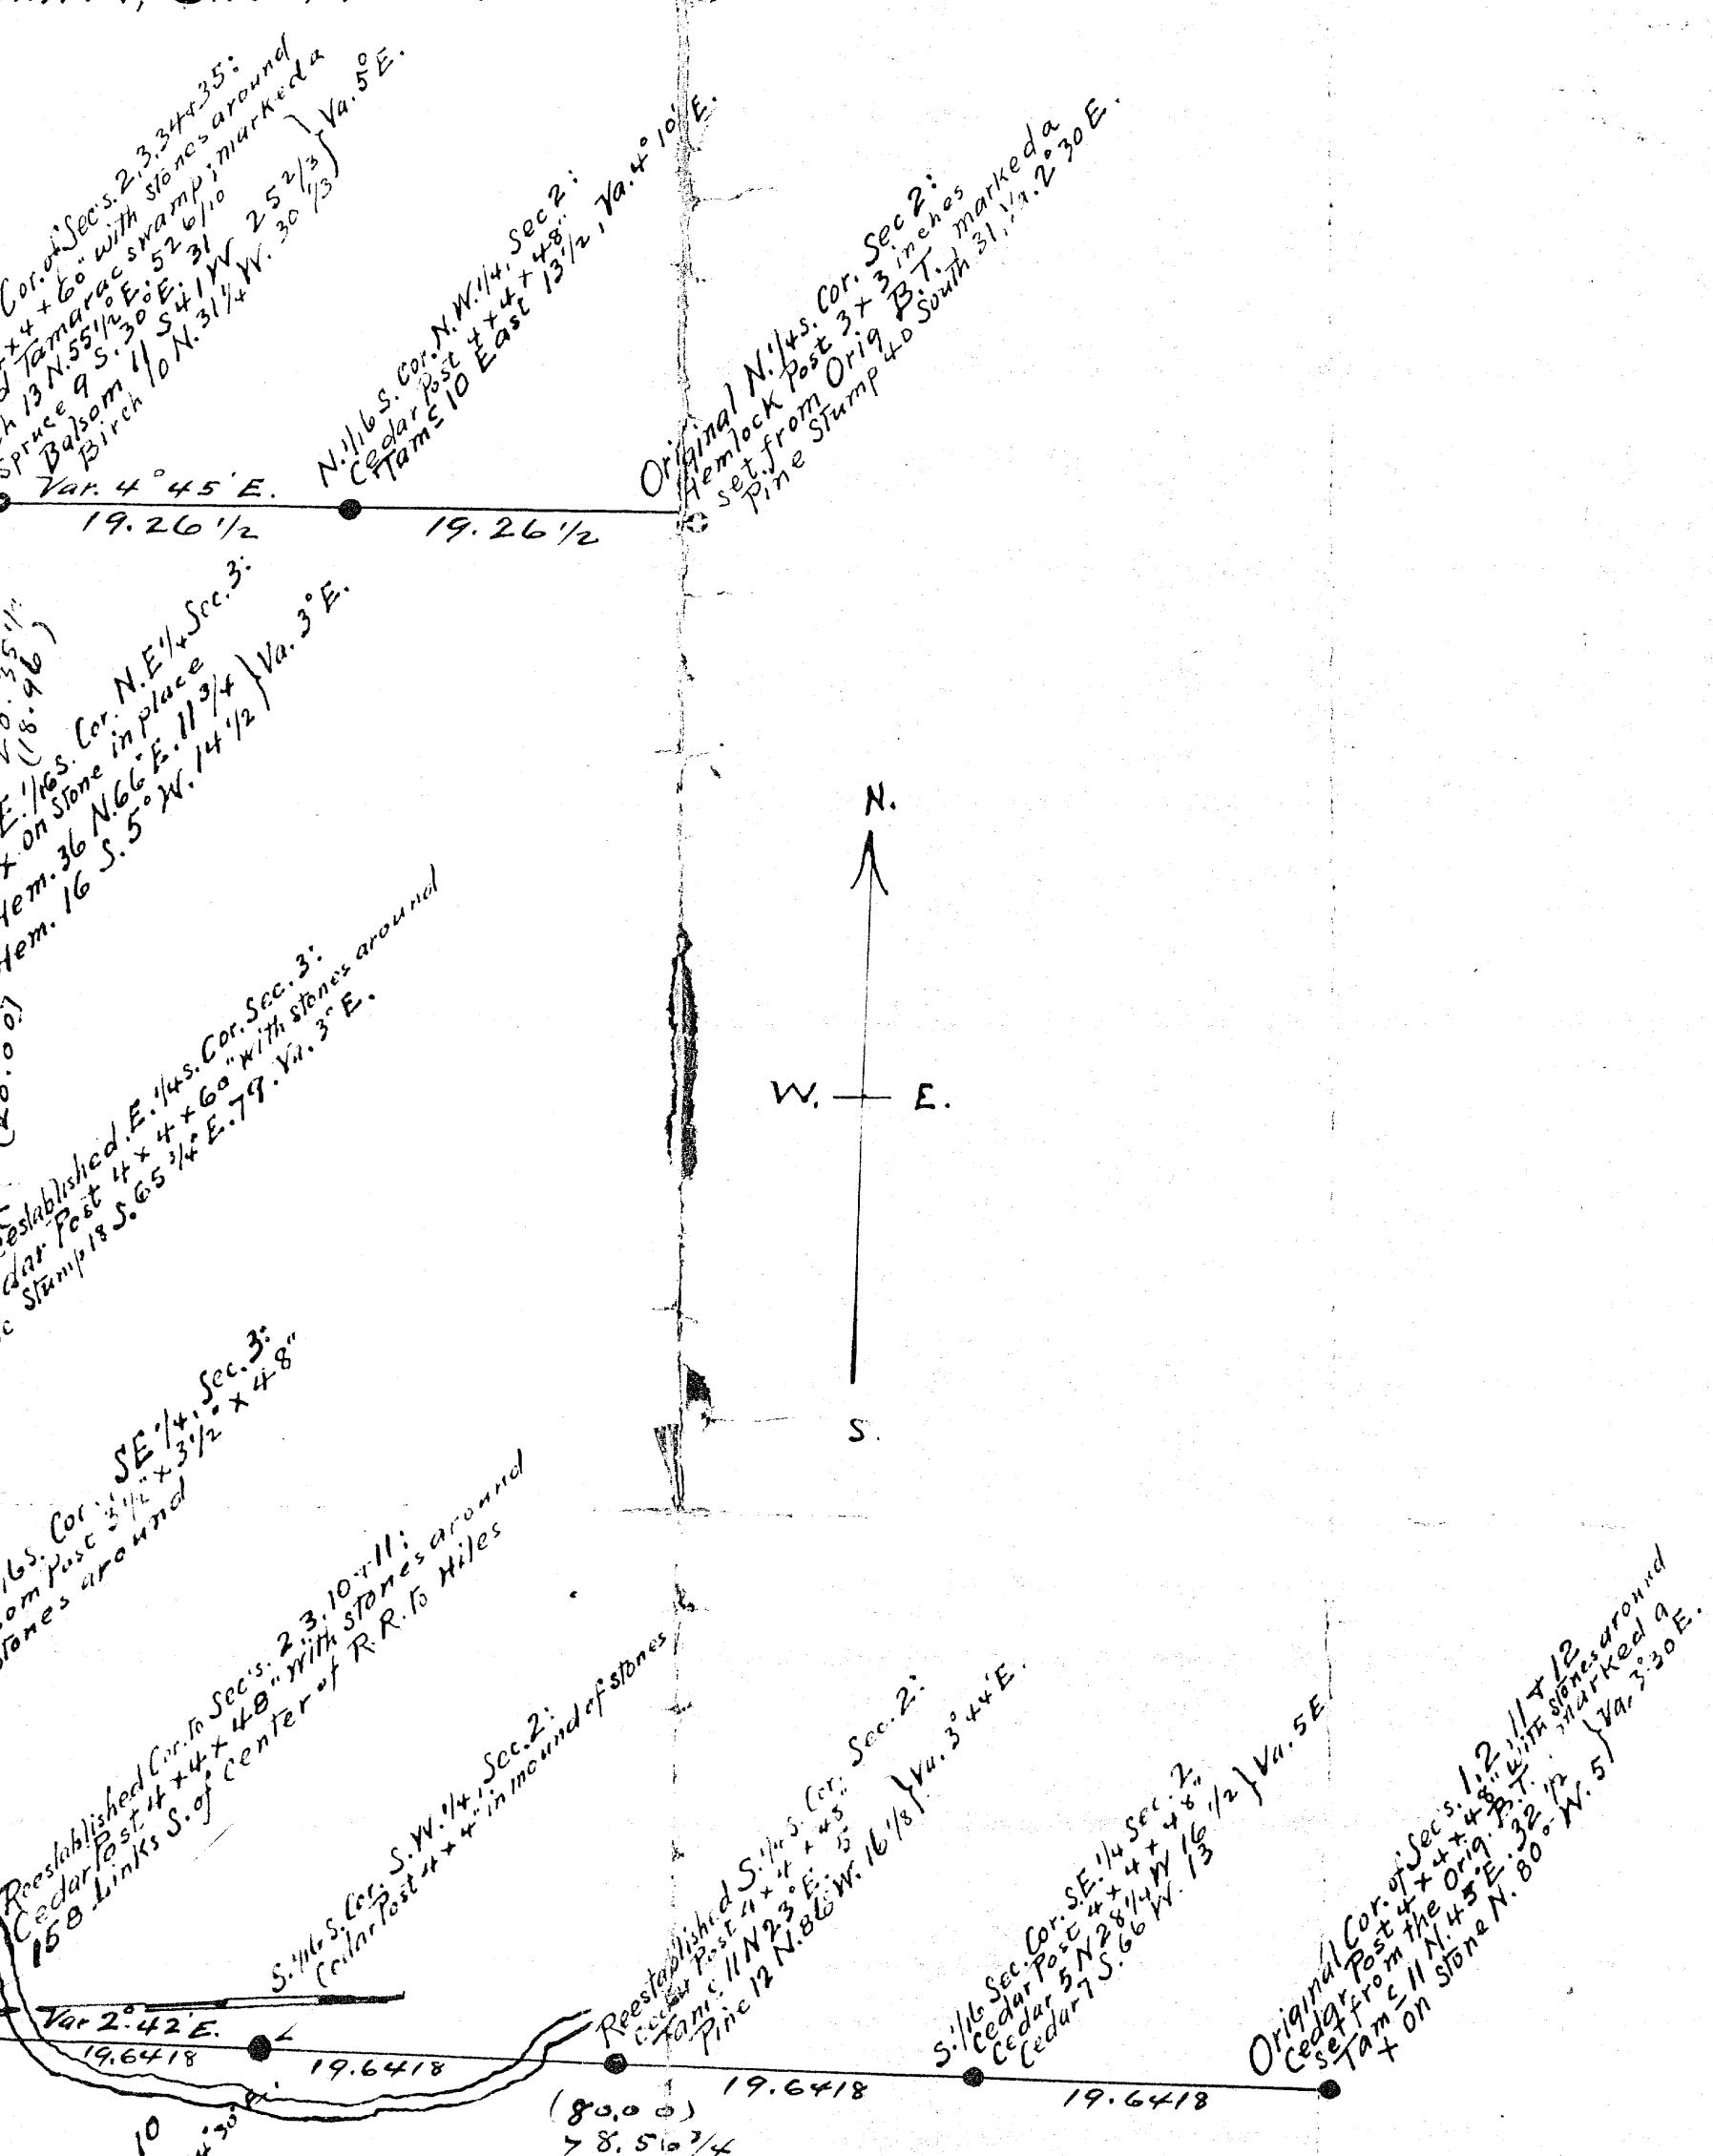

ASCALE: 1 INCH TO CHAINS  
J.A. Melendy, Surveyor.  
as in parentheses ( ) are the original.

Sec. 3: Va. 3° E.  
W. 9<sup>1</sup>/<sub>2</sub> E. 23<sup>1</sup>/<sub>2</sub> N.  
1.66 S. 9<sup>1</sup>/<sub>2</sub> E. 23<sup>1</sup>/<sub>2</sub> N.  
Original N. 1<sup>1</sup>/<sub>4</sub> E. by D. H. Vaughan, marked a  
place cedar tree, orig. fl., 14 N. 75<sup>3</sup>/<sub>4</sub> E. i. 4.2. Va. 3° E.  
Sec. 3: set from the  
H. +  
T. 16 S. 9<sup>1</sup>/<sub>2</sub> E. 23<sup>1</sup>/<sub>2</sub> N.  
T. 16 S. 9<sup>1</sup>/<sub>2</sub> E. 23<sup>1</sup>/<sub>2</sub> N.  
Reestablish  
Cedar  
in

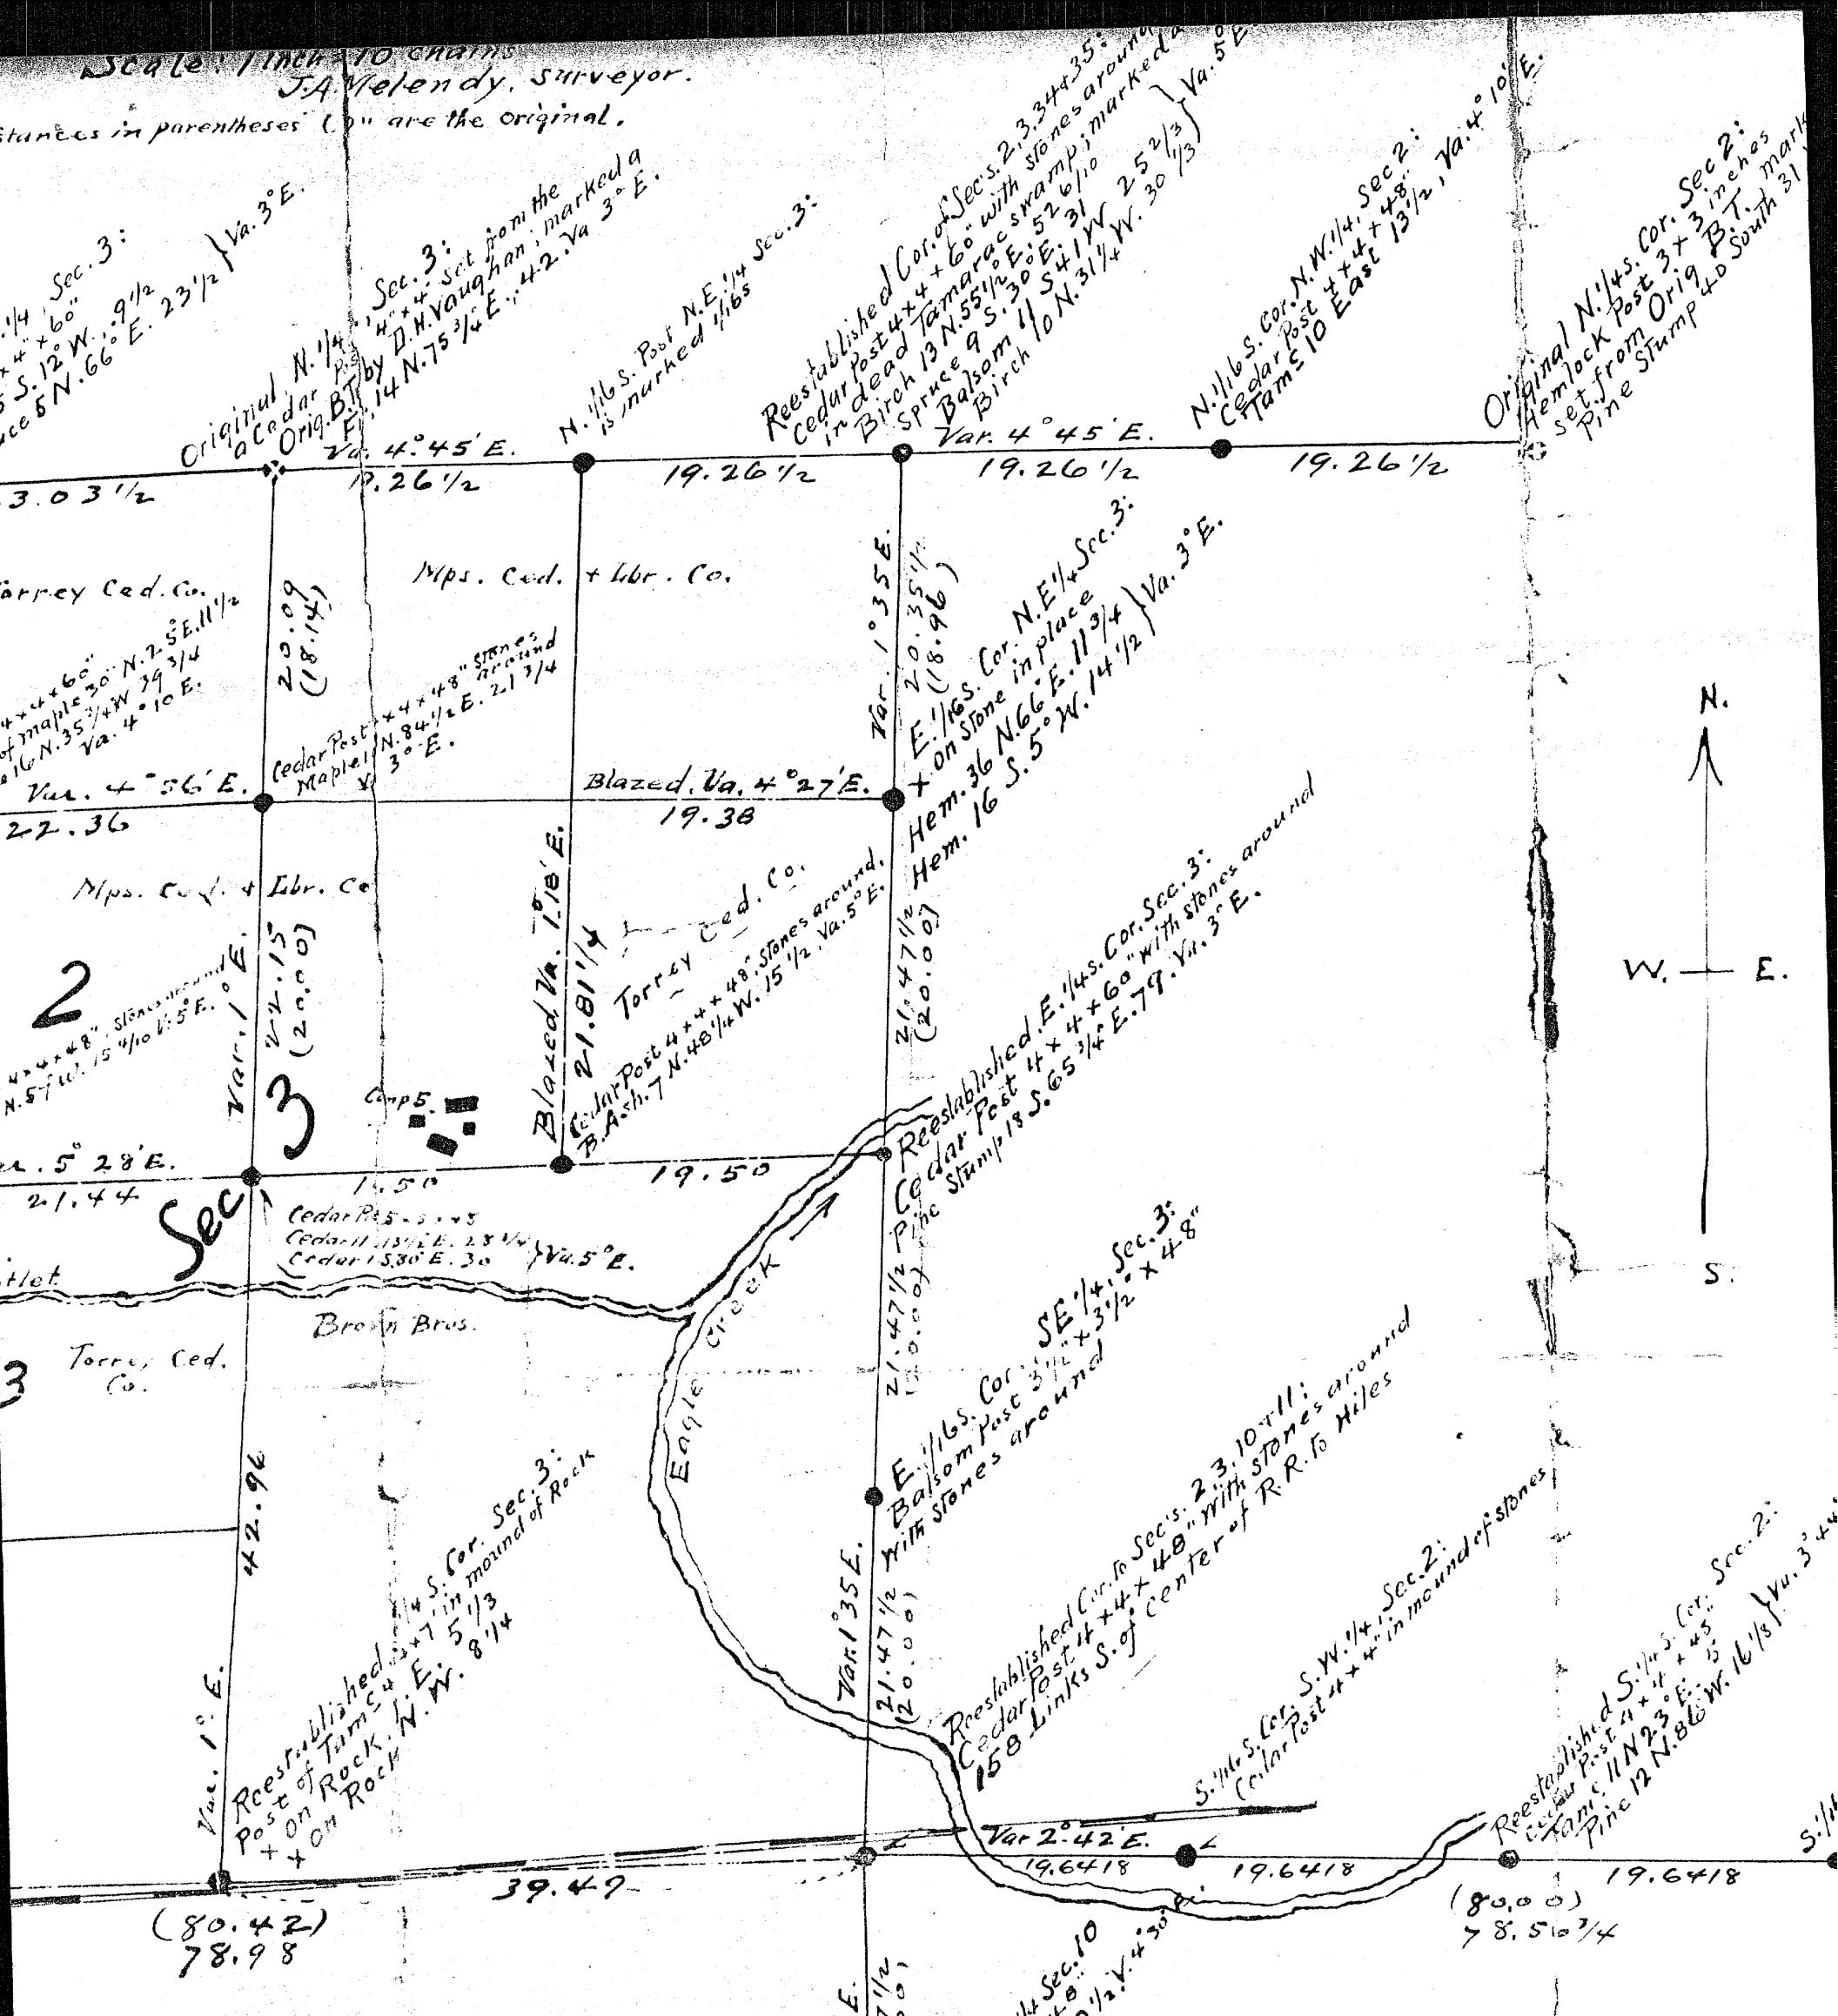

State of Wisconsin  
County of Shawano } ss. I, J.A. Melendy, surveyor  
to hereby certify that I have surveyed and  
subdivided Section No. 3, of Township No. 37  
Range No. 11 East, in Oneida Co. Wisc.  
represented by the courses, distances, notes  
map hereon, That I made said Survey  
division for the Minneapolis Cedar & Lbr. Co.  
the month of Aug. & Sept. 1910  
Shawano Wisc. This 29<sup>th</sup> day of Dec. 1910  
J. A. Melendy  
Surveyor.

Aug. 4

Original, N. 1/4 Post, Sec. A:  
Very old Post standing 6 S. 15° W.  
Tummarac var. 3° E.

Original Cor of Sec's. 3, A. 33  
Found Stumps of the Four C  
with Iron marks on the N  
Drove Tam. Post and  
old spruce 3 N  
Var. 3° 30' E. Var. 5° 52' E

Notes, regarding the West Quarter Post of Sec. 3:  
The dotted line (----) indicates the location of the Lake per Gov-  
ernment field notes and plat. The actual location of the Lake  
is indicated by line thus (—). The original field notes  
call for the 1/4 Post at 19.50 Chs. N. of the M.C. at a sharp angle  
in the meander line of the N. and W. shore of the Lake.  
In reality a point 19.50 chs. N. of the M.C. would fall on an  
Island in the Lake 48 Lks. from the S. shore of the Island  
and 76 Rods S. of where the section line intersects the  
extreme N. shore of the Lake, and 13 Rods W. and  
83 3/4 Rods South of place known as the Russell Traver-  
1/4 Post. To locate the 1/4 Post where the section line  
intersects the extreme N. shore of the Lake 76 Rods from  
or at the place known as the Russell Traver 1/4 Post 84 or  
85 Rods from the point where the 1/4 Post is called for in  
the field notes, would be inconsistent and could not be  
reconciled with the field notes of the meander line of the  
Lake, and would destroy the description and configura-  
tion of the Government lots as shown on the official  
plat of the original survey; it seems that under these  
circumstances, natural and artificial monuments  
should give way to distances, so as to best preserve  
such description and configuration of lots as is  
indicated on such official plat. Therefore the West  
1/4 Post of Sec. 3, was established at 19.50 Chs. Original  
measurement, or 2.1. 1/16 sec. 4 ins. present measurement  
N. of the M.C. by a 1/4 Post 5 x 5" driven in shallow  
Lake 58 Lks. N. of a W. 1/4 Post: a Tamarac 4 ins. in  
diam. by 8 ft. long 4 ins. N. Shore of Island.

Original N.C on south side of Lake  
between Secs 3 & 4 squared and  
Marked a Balsam spr. in place  
Orig. Pine B.T. 18 S 70 E 12.  
Decayed spr. of Old Spruce 10'  
S. 45° W. 10. Va. " 34' E.

Original  $\frac{1}{4}$  S. Cor. B. & S. Spec's 44 & 9:  
 Cedar Post 4 x 4 x 6' 0"  
 Orig. Birch H.Ng. 9' 4" 6' 3 $\frac{1}{4}$ "  
 Orig. Hem. 9 S. 15 E. 9' 1 $\frac{1}{2}$ " } Va. 3° E.

Reestablished  
Tamarac  
Tam-cb H.  
Tam-cg S.  
Spruce  
Spruce S.