





Stock No 26273

SURVEY NOTES

This survey was made by North Country Surveyors pursuant to United States Department of Agriculture, Forest Service Contract No 53-56A6-4-00035, Cadastral Survey for the purpose of recovering, restoring, establishing, marking and perpetuating the corners and boundary lines of the U S Government land on the perimeter and within Section 1, T38N, R11E, Fourth Principal Meridian, Oneida, County, Wisconsin as shown on the plat herewith

The original Government Survey of the North Township line was completed by Hiram C Fellows in 1859 The East line of the Township was surveyed by Alfred Millard in 1858 The remainder of the Township was surveyed by Alfred Millard in 1859

Two Dependent Resurveys have been made which are used for the control of this survey and established the exterior corners of Section 1 In 1937 the Range line between R11E and R12E was re-surveyed which established and monumented the corners on the East Section line In 1941 a Dependent Resurvey of Sections 1,2,11 to 14, 23 to 26, 35, and 36 established and monumented the corners for the remainder of the section

Bearings between corner positions are true bearings by reference to a solar observation All distances shown thereon are in feet and hundredths of feet The control traverse was measured by use of electronic distance measuring equipment Corners recovered, restored and established by this survey are marked by the monument described in the map legend Each monumented corner position is referenced to blazed and scribed bearing trees and described reference objects

CORNERS RECOVERED

1 Corner to Sections 1-6-31-36

Corner is monumented by a 6 round concrete monument with a General Land Office brass tablet stamped to identify the corner

## Corner References

Nail in Cedar	9	N24°W	20 0 feet
Nail in Cedar	11	N66°E	15 0 feet
Nail in Hemlock	11	S26°E	44 0 feet
Nail in Cedar	9	S62°W	46 0 feet
Wood Post		EAST	1 4 feet
Steel Post		SOUTH	0 9 feet



Stock No 26273

## 2 Quarter Corner to Sections 1-36

Corner is monumented by a 6 round concrete monument with a General Land Office brass tablet stamped to identify the corner

## Corner References

Nail in Tamarack	12	S58°W	80 0 feet
Nail in Black Spruce	6	S34°W	58 7 feet
Nail in Black Spruce	5	N68°E	26 2 feet
Nail in White Pine	24	N47°W	128 0 feet
Steel Post		SOUTH	1 3 feet

## 3 Corner to Sections 1-2-35-36

Corner is monumented by a 6 round concrete monument with a General Land Office brass tablet stamped to identify the corner

## Corner References

Nail in Red Maple	10	N63°E	22 6 feet
Nail in Red Pine	12	N42°W	88 1 feet
Nail in Hemlock	20	S35°E	94 0 feet
Nail in White Pine	14	S11°W	104 0 feet
Wood Post		S72°E	1 7 feet

## 4 Quarter Corner to Sections 1-2

Corner is monumented by a 6 round concrete monument with a General Land Office brass tablet stamped to identify the corner

## Corner References

Nail in White Pine	20	N9°W	40 5 feet
Nail in Black Spruce	8	N47°E	35 5 feet
Nail in Black Spruce	6	N13°E	16 3 feet
Nail in Black Spruce	5	S42°E	5 1 feet
Wood Post		N45°E	1 7 feet



Stock No 26273

## 5 South 1/16 Corner to Sections 1-2

Corner is monumented by a 2 iron pipe with a Forest Service cap stamped by R L S number S-802 to identify the corner

## Corner References

Nail in Red Pine	15	N58°W	7 0 feet
Nail in White Pine	14	S19°W	41 0 feet
Nail in Red Pine	16	N77°E	27 5 feet
Steel Post		S58°W	0 9 feet

## 6 Corner to Sections 1-2-11-12

Corner is monumented by a 6 round concrete monument with a General Land Office brass tablet stamped to identify the corner

## Corner References

Nail in Black Spruce	10	S69°E	25 5 feet
Nail in Tamarack	10	S69°W	50 7 feet
Nail in Black Spruce	7	N73°W	40 2 feet
Nail in Black Spruce	6	S79°E	17 4 feet
Wood post		N38°W	1 0 feet

## 7 Quarter Corner to Sections 1-12

Corner is monumented by a 2 iron pipe with a General Land Office brass tablet stamped to identify the corner

## Corner References

Nail in White Pine	9	S80°W	18 1 feet
Nail in Balsam	8	N28°W	12 0 feet
Nail in White Pine	14	S3°E	20 0 feet
Nail in White Spruce	8	S36°W	24 5 feet
Steel post		EAST	1 4 feet

## Stock No 26273

## 8 Meander Corner to Sections 1-12

Corner is monumented by a 6 round concrete monument with a General Land Office brass tablet stamped to identify the corner

## Corner References

Nail in Red Pine	26	S70°W	22 0 feet
Nail in White Pine	5	N38°E	12 3 feet
Nail in Red Pine	5	N10°E	7 1 feet
Nail in White Pine	10	S29°W	42 9 feet
Steel Post		S66°E	1 0 feet

## 9 South Meander Corner to Sections 1-6

Corner is monumented by a 6 round concrete monument with a General Land Office brass tablet stamped to identify the corner

## Corner References

Nail in White Pine	6	N14°W	6 3 feet
Nail in Red Pine	6	N12°E	25 6 feet
Nail in White Pine	4	N86°E	17 4 feet
Steel Post		SOUTH	0 7 feet

## 10 North Meander Corner to Sections 1-6

Corner is monumented by a 6 round concrete monument with a General Land Office brass tablet stamped to identify the corner

## Corner References

Nail in Oak	9	N52°E	57 3 feet
Nail in Tamarack	6	N43°E	42 3 feet
Nail in Black Spruce	3	N3°E	28 0 feet
Nail in Red Pine	7	N1°W	27 0 feet
Steel Post		SOUTH	1 0 feet



Stock No 26273

## 11 Quarter Corner to Sections 1-6

Corner is monumented by a 6 round concrete monument with a General Land Office brass tablet stamped to identify the corner

## Corner References

Nail in Tamarack	9	N34°W	17 1 feet
Nail in Spruce	6	N54°E	15 0 feet
Nail in Tamarack	7	N72°E	11 3 feet
Nail in Tamarack	9	S20°E	32 9 feet
Steel Post		WEST	1 0 feet

CORNERS ESTABLISHED

## 1 East 1/16 Corner to Sections 1-36

Corner is monumented by a 2 aluminum pipe 3 long with a 3 diameter aluminum tablet stamped to identify the corner. Corner is placed on line and at single proportionate measure between the corner to Sections 1-6-31-36 and the Quarter Corner to Sections 1-36

## Corner References

Nail in Red Pine	4	N62°W	14 8 feet
Nail in Red Pine	6	S33°W	33 3 feet
Nail in Red Pine	8	S16°E	21 8 feet
Steel post		SOUTH	1 0 feet

## 2 West 1/16 Corner to Sections 1-12

Corner is monumented by a 2 aluminum pipe 5 long with a 3 diameter aluminum tablet stamped to identify the corner. Corner is placed on line and at single proportionate measure between the corner to Sections 1-2-11-12 and the Quarter Corner to Sections 1-12

## Corner References

Nail in White Pine	18	S74°W	32 4 feet
Nail in White Pine	12	S23°W	16 4 feet
Nail in Spruce	7	N8°W	26 0 feet
Steel post		EAST	1 0 feet

20117

Stock No 26273

## 3 East 1/16 to Sections 1-12

Corner is monumented by a 2 aluminum pipe 3 long with a 3 diameter aluminum tablet stamped to identify the corner. Corner is placed on line and at single proportionate measure between the corner to Sections 1-6-7-12 and the Quarter Corner to Sections 1-12

## Corner References

Nail in Spruce	5	S37°W	40 1 feet
Nail in White Pine	12	N75°E	24 7 feet
Nail in White Pine	6	N3°W	11 7 feet
Steel Post		WEST	0 7 feet

## 4 South 1/16 Corner to Sections 1-6

Corner is monumented by a 2 aluminum pipe 5 long with a 3 diameter aluminum tablet stamped to identify the corner. Corner is placed on line and at single proportionate measure between the corner to Sections 1-6-7-12 and the Quarter Corner to Sections 1-6

## Corner References

Nail in Spruce	6	N12°E	28 7 feet
Nail in Tamarack	11	N71°E	8 0 feet
Nail in Spruce	9	S11°W	21 7 feet
Iron Pipe	2	SOUTH	2 15 feet
Steel Post		WEST	1 1 feet

## 5 North 1/16 Corner to Sections 1-6

Corner is monumented by a 2 aluminum pipe 5 long with a 3 diameter aluminum tablet stamped to identify the corner. Corner is placed on line and at single proportionate measure between the corner to Sections 1-6-31-36 and the Quarter Corner to Sections 1-6

## Corner References

Nail in Spruce	12	N13°E	36 0 feet
Nail in Cedar	14	N85°E	47 4 feet
Nail in Spruce	3	S37°E	8 0 feet
Steel Post		SOUTH	0 7 feet

20117

Stock No 26273

## 6 Center Quarter Corner to Section 1

Corner is monumented by a 2 aluminum pipe 5 long with a 3 diameter aluminum tablet stamped to identify the corner. Corner is placed at the intersection of the lines connecting the Quarter Corners on the exterior of Section 1.

## Corner References

Nail in White Pine	16	NORTH	18 0 feet
Nail in Hemlock	17	N66°W	42 0 feet
Nail in White Pine	14	S9°W	31 0 feet
Steel Post		NORTH	0 7 feet

## 7 Center-East 1/16 Corner

Corner is monumented by a 2 aluminum pipe 7 long with a 3 diameter aluminum tablet stamped to identify the corner. Corner is placed on line and equidistant between the Center Quarter Corner and the Quarter Corner to Sections 1-6.

## Corner References

Nail in Red Pine	10	N10°W	26 1 feet
Nail in Red Pine	7	N29°E	18 8 feet
Nail in White Pine	11	S80°E	36 2 feet
Steel Post		EAST	1 0 feet

## 8 Center West 1/16 Corner

Corner is monumented by a 2 aluminum pipe 5 long with a 3 diameter aluminum tablet stamped to identify the corner. Corner is placed on line and equidistant between the Center Quarter Corner and the Quarter Corner to Sections 1-2.

## Corner References

Nail in Tamarack	6	N21°E	33 0 feet
Nail in White Pine	7	S83°E	14 5 feet
Nail in Tamarack	8	N65°W	14 5 feet
Iron Pipe	1	N78°W	2 6 feet
Steel Post		SOUTH	0 7 feet





Stock No 26273

## 9 Southeast 1/16 Corner

Corner is monumented by a 2 aluminum pipe 5 long with a 3 diameter aluminum tablet stamped to identify the corner. Corner is placed at the intersection of the lines connecting the 1/16 Corners on the exterior of the Southeast 1/4 of Section 1.

## Corner References

Nail in Tamarack	5	S35°E	18 4 feet
Nail in Tamarack	5	S80°W	7 1 feet
Nail in White Pine	8	N70°E	12 1 feet
Iron Pipe	1	S63°W	4 27 feet
Steel Post		EAST	0 9 feet

SURVEYORS AFFIDAVIT


State of Wisconsin)  
County of Oneida )<sup>ss</sup>

I, John H. Fisher, Land Surveyor, Registered in the State of Wisconsin, hereby certify That I have surveyed and subdivided Section 1, T38N, R11E, Fourth Principal Meridian, County of Oneida, State of Wisconsin, in accordance with the rules of the survey of the public lands and with the statutes of the State of Wisconsin. The plat map and survey notes are an accurate representation of the corners recovered and established.

*John H. Fisher*  
-----  
Registered Land Surveyor,  
State of Wisconsin

Certificate No S-836

Date of Survey June, 1984 - March 1985

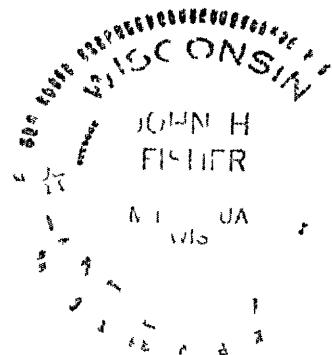

Plat ready for filing

*Frank H. Huber*  
-----  
District Ranger

L1107