

LAND PRESERVATION RECORD

IT IS THE PURPOSE OF THIS RECORD TO PRESERVE THE LOCATION OF A SURVEY OR LAND CORNER MONUMENT THAT MAY BE DISTURBED, REMOVED OR INACCESSIBLE DUE TO ROAD CONSTRUCTION OR OTHER ACTIVITY.

COUNTY: ONEIDA	CITY, VILLAGE, TOWN: TOWN OF PELICAN	SECTION: 20	TOWN: 36 NORTH	RANGE: 10 EAST
--------------------------	--	-----------------------	--------------------------	--------------------------


DESCRIBE WHAT WAS FOUND, IT'S LOCATION AND ORIGIN. IF KNOWN, DESCRIBE IF THE MONUMENT FOUND IS A 1/16 CORNER OR OTHER SUBDIVISIONAL CORNER; A MONUMENT CALLED FOR IN A DEED; A MONUMENT SHOWN ON A SURVEY MAPS OR PLAT, ETC., AND IN WHAT GOV'T LOT, 1/4-1/4 SECTION OR SUBDIVISION THE MONUMENT IS LOCATED.

1975 - SEE CERTIFIED LAND CORNER RESTORATION FORM BY PHILIP HANSEN FOR PRIOR INFORMATION.

1986/1995- GLEN BARKER NOTES FOUND 1" BOLT IN HAYMEADOW ROAD W/ REF. CORNER. SEE ONEIDA COUNTY LAND INFORMATION MAP Nos. B3023 AND B3037 FOR PRIOR RECORD INFORMATION.

JUNE 30, 2011- ANTHONY R. JONES FOUND UNDOCUMENTED PK NAIL IN HAYMEADOW ROAD. NEW TIES SHOWN BELOW. NEARBY OWNER RECALLS SEEING WITNESS CORNER (BY HANSEN) YEARS AGO, BUT IS NOW LOST. FOUND 24" JACK PINE W/ BLAZE, SCRIBED MARKS AND BLUE PAINT AS SHOWN BELOW. THERE ARE TWO JACK PINES EAST OF THIS MONUMENT BETWEEN 40' AND 45' EAST, BUT NO BLAZE OR PAINT EVIDENT.


APPROXIMATE LOCATION WITHIN SECTION 20

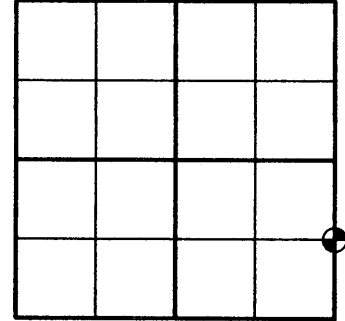

36 10 20 10 00
5/16 EAST LINE SEC 20

PLAN VIEW OF LANDMARK MONUMENT LOCATION WITH BEARING AND DISTANCE TIES TO A MINIMUM OF FOUR DESCRIBED WITNESS OR REFERENCE MONUMENTS OF CONCRETE, NATURAL STONE, METAL, LIVE BEARING TREES OR EQUIVALENT MATERIAL OR INDICATE DATUM AND COORDINATES IF TIES OUT USING GPS. INDICATE TYPE OF MONUMENT RESET.

WITNESS MONUMENT TIES:

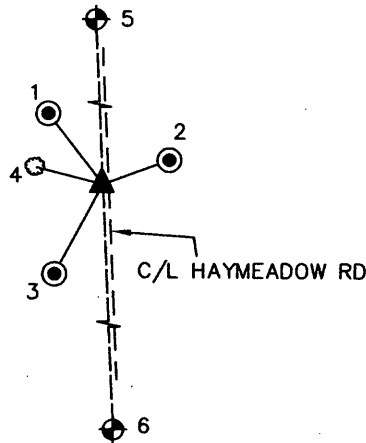

- 1: SET 3/4" BY 18" IRON ROD
N 37°39'36" E, 46.86'
- 2: SET 3/4" BY 18" IRON ROD
N 69°36'54" E, 36.91'
- 3: SET 3/4" BY 18" IRON ROD
S 27°59'30" W, 53.43'
- 4: FOUND BLAZED/SCRIBED JACK PINE WITH BLUE PAINT (N77°W, 51 LKS)
SET 60D SPIKE IN NORTH SIDE OF TREE
N 75°54'39" W, 35.62'
N 74°07'04" W, 36.90'
- 5: FOUND 2 1/2" IRON PIPE W/ BRASS CAP
E 1/4, SEC. 20-36-10
N 02°34'11" W, 1246.45'
- 6: FOUND 1" IRON PIPE, SE CORNER
SEC. 20-36-10
S 02°34'11" E, 1246.24'

NORTH BASED EAST LINE OF THE SE 1/4, S20-36-10, ASSUMED TO BEAR: S 02°34'11" E

SEAL:



PROFESSIONAL LAND SURVEYOR CERTIFICATE:

THIS LAND CORNER WILL BE RESET AFTER THE RECONSTRUCTION THE ROADS AS SHOWN HEREON. THIS CORNER HAS NOT BEEN TESTED FOR ITS ACCURACY DURING THE COURSE OF THIS PRESERVATION. IT IS RECOMMENDED THAT THOSE USING THE CORNER POSITION EVALUATE AND VERIFY IT PRIOR TO USE IN A SURVEY OR OTHER USE.

I HEREBY CERTIFY THAT I AM A DULY LICENSED PROFESSIONAL LAND SURVEYOR IN THE STATE OF WISCONSIN; THAT THE LOCATION OF THIS SURVEY OR LAND CORNER WAS REFERENCED BY ME OR UNDER MY DIRECT SUPERVISION AND CONTROL AND THAT THE INFORMATION SHOWN ON THIS RECORD IS TRUE AND CORRECT TO THE BEST OF MY KNOWLEDGE AND BELIEF.

Anthony R. Jones
ANTHONY R. JONES, R.L.S. No. S-2508

6/30/11
DATE

MAP # **L 2784**

DATE FILED 8/8/11

BY RA

DESCRIPTION FILED

ONEIDA CO. SURVEYOR'S OFFICE

